

**CEDAR CREEK STREAM AND WETLAND RESTORATION
PROJECT
MONITORING REPORT
MONITORING YEAR 2**

SAMPSON COUNTY, NORTH CAROLINA
CONTRACT No. 005011 - PROJECT No. 95718



Prepared for:

Division of Mitigation Services
North Carolina Department of Environment and Natural Resources
1652 Mail Service Center
Raleigh, NC 27699-1652

January 2017

**Cedar Creek
Sampson County, North Carolina
DMS Project ID 95718**

**Cape Fear River Basin
HUC 3030006090060**

Prepared by:



**Resource Environmental Solutions, LLC
302 Jefferson Street, Suite 110
Raleigh, NC 27605
919-209-1061**

EXECUTIVE SUMMARY

The Cedar Creek Stream Restoration Project is located within an agricultural watershed in Sampson County, North Carolina, approximately three miles southwest of Clinton. The stream channels had been heavily impacted by channelization and agricultural practices. This project involved the restoration and protection of streams in the Great Coharie Creek watershed. The purpose of this restoration project is to restore and enhance a stream and wetland complex located within the Cape Fear River Basin.

The project area is comprised of a single easement area along four tributaries to Great Coharie Creek (UT1, UT2, UT3 and UT4). UT1 is the primary channel at this site, and had been channelized throughout the project area. It flows westward through the site from Boykin Bridge Road to Great Coharie Creek. The upper drainage of UT1 originates to the southwest of Boykin Bridge Road (SR 1214) near Butlers Crossroads. The tributaries UT2, UT3, and UT4 flow southward into UT1. UT2 begins at the confluence of two headwater streams and had been ditched to the edge of the field. Flow is redirected along the upslope side of the cultivated field to an unnamed tributary to Cedar Creek. This unnamed tributary (UT4) enters Cedar Creek upstream of the natural valley for UT2. UT3 begins below a pond east of the airport and had been channelized down to a cultivated field where it had been redirected to the west. The historical flow path continues in a southerly direction through the cultivated field to its confluence with UT1.

The Year 2 Annual Monitoring Report presents the data from 20 vegetation monitoring plots, four manual crest gauges, four auto crest gauges, an auto-logging rain gauge, eleven wetland restoration groundwater gauges, three reference groundwater gauges, 26 stream cross sections, eight sets of bank pins, and photo reference locations, as required by the approved Mitigation Plan for the site.

The Cedar Creek Year 2 Monitoring activities were completed in October 2016. All Year 2 monitoring data is presented below and in the appendices. Data presented shows the site has three stream problem areas and two vegetation problem areas; however, the site is on track to meeting stream, wetland and vegetation interim success criteria.

Throughout the Year 2 monitoring season, the restoration and enhancement reaches remained stable and continued to provide the intended habitat and hydrologic functions. Minimal changes were noticed for Year 2 cross section surveys resulting from stable bed and bank conditions. Crest gauge 1 and 3 both recorded bankfull events during the Year 2 monitoring period. Three stream problem areas were documented consisting of a debris jam, a log ramp structure failing, and localized bank erosion. These problem areas are addressed below in the report detailing the severity and recommendations.

Nine of the eleven wetland gauges achieved the success criteria by remaining continuously within 12 inches of the soil surface for at least nine percent of the growing season. Groundwater gauge data indicate the hydroperiods being very responsive to rainfall events. Wetland hydrology gauges AW7 and AW11 both fell short of the nine percent success criteria; however, they show signs of trending toward being jurisdictional wetlands. AW11 documented 6 days consecutively (2%) or 38 days cumulatively (15%) where groundwater was within 12 inches of the soil surface and AW7 documented 4 days consecutively (2%) throughout the growing season. RES plans to evaluate these wetland gauges closely to make sure wetland hydrology is accurately documented.

The Year 2 vegetation monitoring observations are summarized in this report. Planted-stem survival for all 20 of the Vegetation Plots (VP) at Cedar Creek was above the interim success criterion of 320 trees per acre at the end of Monitoring Year 3. The average stem density (excluding live stakes)

across all vegetation plots was 749 stems per acre. Two minor vegetation problems were noted during the Year 2 monitoring period. One vegetation problem area (VPA1) consists of invasive species Chinese Privet (*Ligustrum sinense*) located at the upstream portion of UT-1. The remaining vegetation problem (VPA2) is a small bare area (0.05 ac.) along UT-2 above the stream crossing (Sta. 4+00). This area lacks herbaceous cover. Reseeding and mulching is recommended in this area. The Cedar Creek Site is on track to meet the Year 3 vegetation survival success criterion of 320 trees per acre as specified in the Mitigation Plan.

TABLE OF CONTENTS

1	PROJECT GOALS, BACKGROUND AND ATTRIBUTES.....	1
1.1	Location and Setting.....	1
1.2	Project Goals and Objectives.....	1
1.3	Project Structure.....	3
1.3.1	Restoration Type and Approach.....	3
1.4	Project History, Contacts and Attribute Data.....	5
1.4.1	Project History.....	5
1.4.2	Project Watersheds.....	5
2	Success Criteria.....	6
2.1	Stream Restoration.....	6
2.1.1	Bankfull Events.....	6
2.1.2	Cross Sections.....	6
2.1.3	Bank Pin Arrays.....	6
2.1.4	Digital Image Stations.....	7
2.2	Wetland Restoration.....	7
2.3	Vegetation Success Criteria.....	7
2.4	Scheduling/Reporting.....	7
3	MONITORING PLAN.....	8
3.1	Stream Restoration.....	8
3.1.1	As-Built Survey.....	8
3.1.2	Bankfull Events.....	8
3.1.3	Cross Sections.....	8
3.1.4	Digital Image Stations.....	8
3.1.5	Bank Pin Arrays.....	8
3.1.6	Visual Assessment Monitoring.....	9
3.1.7	Surface Flow.....	9
3.2	Wetland Hydrology.....	9
3.3	Vegetation.....	9
4	Maintenance and Contingency plan.....	10
4.1	Stream.....	10
4.2	Wetlands.....	10
4.3	Vegetation.....	10
5	Year 2 Monitoring Conditions (MY2).....	11
5.1	Year 2 Monitoring Data Collection.....	11
5.1.1	Morphological State of the Channel.....	11
5.1.2	Vegetation.....	12
5.1.3	Photo Documentation.....	12
5.1.4	Stream Hydrology.....	12
5.1.5	Wetland Hydrology.....	12
6	REFERENCES.....	12

Appendices

Appendix A. General Tables and Figures

Table 1. Project Components and Mitigation Credits
Table 2. Project Activity and Reporting History
Table 3. Project Contacts
Table 4. Project Information
Figure 1. Project Vicinity Map
Figure 2. Project USGS Map

Appendix B. Visual Assessment Data

Figure 3. Current Conditions Plan View Map (CCPV)
Table 5. Visual Stream Morphology Stability Assessment
Table 6. Vegetation Condition Assessment
Table 7. Stream Problem Areas
Table 8. Vegetation Problem Areas
Stream Photos
Vegetation Plot Photos
Stream and Vegetation Problem Photos

Appendix C. Vegetation Plot Data

Table 9a. Vegetation Plot Criteria Attainment Summary
Table 9b. CVS Vegetation Plot Metadata
Table 9c. Planted and Total Stem Counts (Species by Plot)

Appendix D. Stream Geomorphology Data

Table 10. Morphological Parameters Summary Data
Table 11. Dimensional Morphology Summary – Cross-Section Data
Table 12. Bank Pin Array Summary Data
Cross Section Plots

Appendix E. Hydrology Data

Table 13. Documentation of Geomorphological Significant Flow Events
Table 14. Rainfall Summary
Table 15. Wetland Hydrology Criteria Attainment
Chart 1. 2016 Precipitation Data for Cedar Creek Site
Chart 2. 2016 Groundwater Monitoring Gauge Hydrographs
Crest Gauge Verification Photos

1 PROJECT GOALS, BACKGROUND AND ATTRIBUTES

1.1 Location and Setting

The Cedar Creek Stream and Wetland Site is located in Sampson County approximately 3.1 miles southwest of Clinton, NC (**Figure 1**). To access the Site from the town of Clinton, travel west on Highway 24 (Sunset Avenue), take a left onto Airport Road and go 1.3 miles. Turn right onto West Main Street Extension, go approximately 350 feet, and turn left onto a dirt farm path. Follow the farm path along the cultivated field edge to the southwest corner and enter the forest. Follow the dirt path to cultivated fields adjacent to the project below UT2. Turning to the left will take you to UT2. Going to the right will take you to UT3.

1.2 Project Goals and Objectives

The Cedar Creek Stream and Wetland Restoration Project has provided numerous ecological and water quality benefits within the Cape Fear River Basin. While many of these benefits are limited to the project area, others, such as pollutant removal and improved aquatic and terrestrial habitat, have more far-reaching effects. Expected improvements to water quality, hydrology, and habitat are outlined below.

Design Goals and Objectives

Benefits Related to Water Quality	
Nutrient removal	Benefit will be achieved through filtering of runoff from adjacent agricultural fields through buffer areas, the conversion of active farm fields to forested buffers, improved denitrification and nutrient uptake through buffer zones, and installation of BMPs at the headwaters of selected reaches.
Sediment removal	Benefit will be achieved through the stabilization of eroding stream banks and reduction of sediment loss from field areas due to lack of vegetative cover. Channel velocities will also be decreased through a reduction in slope, therefore decreasing erosive forces.
Increase dissolved oxygen concentration	Benefit will be achieved through the construction of instream structures to increase turbulence and dissolved oxygen concentrations and riparian canopy restoration to lower water temperature to increase dissolved oxygen capacity.
Runoff filtration	Benefit will be achieved through the restoration of buffer areas that will receive and filter runoff, thereby reducing nutrients and sediment concentrations reaching water bodies downstream.
Benefits to Flood Attenuation	
Water storage	Benefit will be achieved through the restoration of buffer areas which will infiltrate more water during precipitation events than under current site conditions. Wetland areas will provide additional storage of runoff and flood waters.
Improved groundwater recharge	Benefit will be achieved through the increased storage of precipitation in buffer areas, ephemeral depressions, and reconnection of existing floodplain. Greater storage of water will lead to improved infiltration and groundwater recharge.
Improved/restored hydrologic connections	Benefit will be achieved by restoring the stream to a natural meandering pattern with an appropriately sized channel, such that the channel's floodplain will be flooded more frequently at flows greater than the bankfull stage.
Benefits Related to Ecological Processes	
Restoration of habitats	Benefit will be achieved by restoring riparian buffer habitat to appropriate bottomland hardwood ecosystem. Protected riparian corridors will create contiguous natural areas with uninterrupted migration corridors.
Improved substrate and instream cover	Benefit will be achieved through the construction of instream structures designed to improve bedform diversity and to trap detritus. Stream will be designed with the appropriate channel dimension and will prevent aggradation and sedimentation within the channel. Substrate will become coarser as a result of the stabilization of stream banks and an overall decrease in the amount fine materials deposited in the stream.

Addition of large woody debris	Benefit will be achieved through the addition of wood structures as part of the restoration design. Such structures may include log vanes, root wads, and log weirs.
Reduced temperature of water due to shading	Benefit will be achieved through the restoration of canopy tree species to the stream buffer areas.
Restoration of terrestrial habitat	Benefit will be achieved through the restoration of riparian buffer bottomland hardwood habitats.

The Cedar Creek Stream and Wetland Restoration Project is located in the Great Coharie Creek Watershed (<http://portal.ncdenr.org/web/DMS/priorities-map>). This 14-digit Hydrologic Unit Code (HUC 03003006090060) is identified as a Targeted Local Watershed (TLW) in the Cape Fear River Basin Restoration Priority (RBRP).

The North Carolina Division of Mitigation Services (NCDMS) develops River Basin Restoration Priorities (RBRP) to guide its restoration activities within each of the state's 54 cataloging units. RBRPs delineate specific watersheds that exhibit both the need and opportunity for wetland, stream and riparian buffer restoration. These TLWs receive priority for DMS planning and restoration project funds. Currently, no Local Watershed Plan (LWP) is available for the project area.

The 2009 Cape Fear RBRP identified water quality and agricultural impacts as major stressors within this TLW. The Cedar Creek Stream and Wetland Restoration Project was identified as a Stream and Wetland opportunity to improve water quality, habitat, and hydrology within the TLW.

The project goals addressed stressors identified in the TLW, and include the following:

- Water quality improvements,
- Natural resource protection, and
- Manage agricultural impacts.

The project goals were addressed through the following project objectives:

- Converting active farm fields to forested buffers,
- Stabilization of eroding stream banks,
- Reduction in stream bank slope,
- Restoration of riparian buffer bottomland hardwood habitats, and
- Construction of in-stream structures designed to improve bedform diversity.

1.3 Project Structure

Table 1a. Cedar Creek Site Project Components – Stream Mitigation

Reach	Mitigation Type	Proposed Stationing	Existing Length (LF)	As-Built Length (LF)	Mitigation Ratio	SMUs
UT1	Enhancement II	1+01 to 31+65	3,064	3,064	1:2.5	1,226
UT1	Enhancement I	31+65 to 35+80	415	415	1:1.5	277
UT1	Enhancement II	35+80 to 41+95	615	615	1:2.5	246
UT1	Enhancement I	41+95 to 44+60	265	265	1:1.5	177
UT1	Enhancement II	44+60 to 53+51	891	827	1:2.5	331
UT2	Headwater Valley	0+11 to 3+48	364	337	1:1	337
UT2	P1 Restoration	3+48 to 9+28	587	518	1:1	518
UT2C	Headwater Valley	0+02 to 1+95	NA	193	1:1	193
UT3	P1 Restoration	0+69 to 20+10	1,428	1,941	1:1	1,941
UT4	Enhancement II	0+36 to 1+14	78	78	1:2.5	31
Total			7,707	8,253		5,277

Table 1b. Cedar Creek Site Project Components – Wetland Mitigation

Wetland	Mitigation Type	Mitigation Area (ac)	Mitigation Ratio	WMUs
W1	Restoration	13.72	1:1	13.72
Total		13.72		13.72

1.3.1 Restoration Type and Approach

Stream restoration efforts along the unnamed tributaries to Great Coharie Creek were accomplished through analyses of geomorphic conditions and watershed characteristics. The design approach applied a combination of analytical and reference and/or analog reach based design methods that meet objectives commensurate with both ecological and geomorphic improvements. Proposed treatment activities ranged from minor bank grading and planting to re-establishing stable planform and hydraulic geometry. Reaches that required full restoration, natural design concepts have been applied and verified through rigorous engineering analyses and modeling. The objective of this approach was to design a geomorphically stable channel that provides habitat improvements and ties into the existing landscape.

Priority Level I stream restoration, headwater valley restoration, stream Enhancement Levels I and II, and stream buffers throughout the project site have been restored and protected in perpetuity. Priority Level I stream restoration was incorporated into the design of a single-thread meandering channel, with parameters based on data taken from the reference site. Priority 1 stream restoration was performed on 2,459 linear feet of stream channel. Headwater valley restoration was applied to 530

linear feet of channel. Enhancement Level I was applied to 680 linear feet of channel that required buffer enhancement, bank stabilization and habitat improvements. Enhancement Level II was applied to an additional 4,584 linear feet of channel that required buffer enhancement and/or minimal bank and habitat improvements.

UT1

UT1 flows from southeast to northwest across the project, totaling 5,186 linear feet of Enhancement Level I and II. The upper-most portion of UT1 (reaches UT1A and UT1B) is stable and has a forested buffer along both banks; however, privet was dominant within the right buffer. The downstream portion of UT1 (reaches UT1C, UT1D and UT1E) was moderately stable and exhibited some areas of localized erosion prior to mitigation activities. The buffer along this section consisted of a five year old clear-cut along the left bank and cultivated fields along the right bank. A 60-foot easement break is present within the downstream section (UT1E) to account for an existing farm crossing which has been upgraded. 680 linear feet of Enhancement Level I was performed along reach UT1. Selective locations were identified to include streambed structures, minor bank grading, planting a native stream buffer and invasive species control. Primarily, Stabilization/Enhancement II activities included performing minor bank grading, planting the buffer with native vegetation, and invasive species control.

UT2

UT2 is the middle tributary of the project, totaling 337 linear feet of headwater valley restoration along the upstream section and 518 linear feet of Priority 1 restoration through the downstream section. The upper section of the channel was channelized and bordered by cultivated fields to the northwest and a pine stand to the southeast, while the lower portion was a small ditch surrounded by cultivated fields. The headwater valley portion relocated the flow path to the natural valley (to the left of the existing ditch), and the abandoned ditch has been back filled. The performed P1 restoration included relocating the channel to follow the natural valley and emptying into Cedar Creek near STA 25+50. A 60-foot easement break crossing is present at STA 4+66 along UT2. Twin 24" HDPE culverts were installed within the easement break crossing. Restoration activities included constructing a meandering channel, installing habitat and drop structures, filling and plugging the abandoned channel, planting the buffer with native vegetation, and invasive species control.

UT2C

UT2C is also located in the middle of the project (adjacent to UT2), totaling 193 linear feet of headwater valley restoration. The upstream end of the reach begins at an existing wetland that borders a farm path to the north. Flow from the wetland originally had been diverted to a ditch that ran east-west along the farm path before it was conveyed across the path and into UT2 near the upstream end. Restoration activities involved redirecting channel flow to the natural valley and grading out the existing ditch and path such that the area matches existing grade on either side of the path. Additional activities included planting the buffer with native vegetation and invasive species control.

UT3

UT3 is the western most tributary of the project, totaling 1,941 linear feet of Priority 1 restoration. The upper section of the channel was incised/oversized and began at a pond outlet east of the airport and flowed through a wooded area consisting of saplings and some mature hardwoods, while the lower section flowed through a cultivated field. The restored channel has been relocated to the west to follow the natural valley, and now flows through the middle of the wetland restoration area (W1). UT3 now outlets into Cedar Creek near STA 43+10. Restoration activities included constructing a meandering channel, installing habitat and grade control structures, filling and plugging the abandoned channel, planting the buffer with native vegetation, and invasive species control. Small

ditches located adjacent to UT3 and within the conservation easement have also been plugged and filled to redirect and diffuse flow through the wetland restoration area and/or into UT3.

UT4

UT4 is the eastern most tributary of the project, totaling 78 linear feet of Enhancement Level II. The reach was relatively stable, but had been historically channelized. The buffer along this section consisted of an agricultural field along the right bank, and a forested buffer along the left bank; however, privet was common within the left buffer. Stabilization/Enhancement II activities included performing minor bank grading, cutting a floodplain bench, and planting the buffer with native vegetation, and invasive species control.

Wetland W1

This 13.72-acre wetland is located along UT3 and where it reaches the confluence of with UT1 Reach E. The pre-restoration land use was sparsely wooded and active cropland. Wetland restoration activities consisted of removing valley fill, filling drainage ditches, removing subsurface drainage tiles, and raising adjacent stream channels to reconnect the floodplain with seasonal and out of bank flows. Raising the stream bed will also reduce the “dry shoulder” effect near the stream channel. Specific wetland restoration activities included: reconnecting low lying areas of hydric soil with the floodplain, plugging agricultural drainage ditches, planting native tree and shrub species commonly found in small stream swamp ecosystems, and surface roughening to increase infiltration and storage. Wetland restoration limits and hydroperiods will be determined by on-site soil investigations and hydrologic modeling in conjunction with pre-construction water table monitoring at the restoration sites and reference wetlands. Combined with the stream restoration, these actions will result in a sufficiently high water table and flood frequency to support hydrophytic vegetation and wetland hydrology, resulting in restored riparian wetlands.

1.4 Project History, Contacts and Attribute Data

1.4.1 Project History

The Cedar Creek Stream and Wetland Restoration Site was restored by Resource Environmental Solutions, LLC (RES) through a full-delivery contract awarded by NCDMS in 2012. Tables 2, 3, and 4 in **Appendix A** provide a time sequence and information pertaining to the project activities, history, contacts, and baseline information.

1.4.2 Project Watersheds

The easement totals 42.0 acres and is broken into four tributaries, UT1, UT2, UT3, and UT4. The land use in the 2,778-acre (4.34 mi²) project watershed that drains to UT1 consisted of row crop production, livestock production, silviculture, and sand mining areas. Past land use practices caused increased erosion and sedimentation along drainage-ways and stream banks in the watershed.

UT2 has a drainage area of 32 acres (0.05 mi²) and flows southwest into UT1. Land use in this small drainage area consisted entirely of row crop production and disturbed hardwood forest. UT2 originated in a disturbed hardwood forest and flows through a cultivated field to its confluence with UT1.

UT3 has a drainage area of 147 acres (0.23 mi²) and flows south into UT1. Land use in this drainage area consisted of row crop production, historical and future livestock production, disturbed hardwood forest, maintained open space, and impervious surfaces associated with residential commercial

development. Portions of the Sampson County Airport, including parts of the runway, terminal, and apron areas, lie within the UT3 drainage area. UT3 originates at a pond that is adjacent to the airport property. This reach flowed through a disturbed hardwood forest, and then through a cultivated field to its confluence with UT1.

UT4 has a drainage area of 77 acres (0.12 mi²), originates within a disturbed hardwood forest, and flows southwest into UT1. Land use in this small drainage area consisted of a mix of row crop production and disturbed hardwood forest located primarily along the drainage way.

UT2, UT3 and UT4 were straightened, dredged, or re-aligned in the past to promote drainage. Soil investigations showed that much of the low-lying landscape adjacent to UT1 and its confluences with UT2 and UT3 exhibited hydric characteristics and a shallow seasonal high water table. The low lying fields in this area were considered prior converted wetlands (PC) that were drained and are currently utilized for row crop and livestock production.

The land use in the watershed is characterized by evergreen forest (47 percent), cultivation (31 percent), woody wetlands (9 percent), open space (8 percent) and shrub/scrub (5 percent).

2 Success Criteria

The success criteria for the Cedar Creek Site stream restoration will follow accepted and approved success criteria presented in the USACE Stream Mitigation Guidelines and subsequent NCDMS and agency guidance. Specific success criteria components are presented below.

2.1 Stream Restoration

2.1.1 Bankfull Events

Two bankfull flow events must be documented within the seven-year monitoring period. The two bankfull events must occur in separate years. Otherwise, the stream monitoring will continue until two bankfull events have been documented in separate years. Bankfull events will be documented using crest gauges, auto-logging crest gauges, photographs, and visual assessments for evidence of debris rack lines.

2.1.2 Cross Sections

There should be little change in as-built cross-sections. If changes do take place, they should be evaluated to determine if they represent a movement toward a less stable condition (for example down-cutting or erosion), or are minor changes that represent an increase in stability (for example settling, vegetative changes, deposition along the banks, or decrease in width/depth ratio). Cross-sections are classified using the Rosgen stream classification method, and all monitored cross-sections should fall within the quantitative parameters defined for channels of the design stream type.

2.1.3 Bank Pin Arrays

Bank pin arrays will be used as a supplemental method to monitor erosion on selected meander bends where there is not a cross section. Bank pin arrays will be installed along the outer bend of the meander. Bank pins will be installed just above the water surface and every two feet above the lowest pin. Bank pin exposure will be recorded at each monitoring event, and the exposed pin will be driven flush with the bank. There should be little change in as-built cross-sections. If changes do take place, they should be evaluated to determine if they represent a movement toward a less stable condition

(for example down-cutting or erosion), or are minor changes that represent an increase in stability (for example settling, vegetative changes, deposition along the banks, or decrease in width/depth ratio).

2.1.4 Digital Image Stations

Digital images are used to subjectively evaluate channel aggradation or degradation, bank erosion, success of riparian vegetation, and effectiveness of erosion control measures. Longitudinal images should not indicate the absence of developing bars within the channel or an excessive increase in channel depth. Lateral images should not indicate excessive erosion or continuing degradation of the banks over time. A series of images over time should indicate successional maturation of riparian vegetation.

2.2 Wetland Restoration

Success criteria and monitoring for wetland hydrology within the wetland restoration areas on the site follows NCDMS Guidance dated 7 November 2011. The target minimum wetland hydroperiod is 9 percent of the growing season. Stream hydrology and water balance calculations indicate the wetland area will meet jurisdictional criteria (5 percent hydroperiod). However, due to immature vegetation and reduced PET, a longer success criterion is appropriate. Auto recording gauges are used to measure daily groundwater elevations throughout the Sampson County growing season in all seven years of monitoring.

If a hydrology gauge location fails to meet these success criteria in the seven year monitoring period then monitoring may be extended, remedial actions may be undertaken, or groundwater modeling may be used to demonstrate the limits of wetland restoration.

2.3 Vegetation Success Criteria

Specific and measurable success criteria for plant density within the wetland restoration and riparian buffers on the site will follow NCDMS Guidance dated 7 November 2011. Vegetation monitoring plots are a minimum of 0.02 acres in size, and cover a minimum of two percent of the planted area. The following data is recorded for all trees in the plots: species, height, planting date (or volunteer), and grid location. Monitoring occurs in the fall of Years 1, 2, 3, 5, and 7. The interim measures of vegetative success for the site is the survival of at least 320 three-year old planted trees per acre at the end of Year 3, and 260 planted trees per acre at the end of Year 5. The final vegetative success criteria is the survival of 210 planted trees per acre at the end of Year 7 of the monitoring period.

Invasive and noxious species will be monitored and controlled so that none become dominant or alter the desired community structure of the site. If necessary, RES will develop a species-specific control plan.

2.4 Scheduling/Reporting

The monitoring program will be implemented to document system development and progress toward achieving the success criteria. The restored stream morphology is assessed to determine the success of the mitigation. The monitoring program will be undertaken for seven years or until the final success criteria are achieved, whichever is longer.

Monitoring reports will be prepared in the fall of each year of monitoring and submitted to NCDMS. The monitoring reports will include all information, and be in the format required by NCDMS in Version 2.0 of the NCDMS Monitoring Report Template (Oct. 2010).

3 MONITORING PLAN

Annual monitoring data will be reported using the DMS monitoring template. Annual monitoring shall be conducted for stream, wetland, and vegetation monitoring parameters as noted below.

3.1 Stream Restoration

3.1.1 As-Built Survey

An as-built survey was conducted following construction to document channel size, condition, and location. The survey will include a complete profile of thalweg, water surface, bankfull, and top of bank to compare with future geomorphic data. Longitudinal profiles will not be required in annual monitoring reports unless requested by NCDMS or USACE.

3.1.2 Bankfull Events

Three sets of manual and auto-logging crest gauges were installed on the site, one along UT2, one along UT2C, and one along UT3. The auto logging crest gauges were installed within the channel and will continuously record flow conditions at an hourly interval. Manual crest gauges were installed on the bank at bankfull elevation. Crest gauges will be checked during each site visit to determine if a bankfull event has occurred since the last site visit. Crest gauge readings and debris rack lines will be photographed to document evidence of bankfull events.

3.1.3 Cross Sections

A total of 27 permanent cross sections were installed to monitor channel dimensions and stability. Cross sections were typically located at representative riffle/shallows and pool sections along each stream reach. Four cross sections were installed along UT1 where enhancement activities were performed. Eight cross sections (three pools, two runs, and three shallows) were installed along UT2. UT2C has one cross section installed throughout its length. Stream reach UT3 has 14 cross sections installed along its length where stream restoration was performed. Each cross section was permanently marked with 3/8 rebar pin to establish a monument location at each end. A marker pole was also installed at both ends of each cross section to allow ease locating during monitoring activities. Cross section surveys will be performed once a year during annual monitoring years 1, 2, 3, 5, and 7 and will include all breaks in slope including top of bank, bottom of bank, streambed, edge of water, and thalweg.

3.1.4 Digital Image Stations

Digital photographs will be taken at least once a year to visually document stream and vegetation conditions. This monitoring practice will continue for seven years following construction and planting. Permanent photo point locations at cross sections and vegetation plots have been established so that the same directional view and location may be repeated each monitoring year. Monitoring photographs will also be used to document any stream and vegetation problematic areas such as erosion, stream and bank instability, easement encroachment and vegetation damage.

3.1.5 Bank Pin Arrays

Eight bank pin array sets have been installed at pool cross sections located along UT2 and UT3. These bank pin arrays were installed along the upstream and downstream third of the meander. Bank pins are a minimum of three feet long, and have been installed just above the water surface and every

two feet above the lowest pin. Bank pin exposure will be recorded at each monitoring event, and the exposed pin will be driven flush with the bank.

3.1.6 Visual Assessment Monitoring

Visual monitoring of all mitigation areas is conducted a minimum of twice per monitoring year by qualified individuals. The visual assessments include vegetation density, vigor, invasive species, and easement encroachments. Visual assessments of stream stability include a complete stream walk and structure inspection. Digital images are taken at fixed representative locations to record each monitoring event as well as any noted problem areas or areas of concern. Results of visual monitoring are presented in a plan view exhibit with a brief description of problem areas and digital images. Photographs will be used to subjectively evaluate channel aggradation or degradation, bank erosion, success of riparian vegetation, and effectiveness of erosion control measures. Longitudinal photos should indicate the absence of developing bars within the channel or an excessive increase in channel depth. Lateral photos should not indicate excessive erosion or continuing degradation of the banks over time. A series of photos over time should indicate successional maturation of riparian vegetation.

3.1.7 Surface Flow

The headwater valley restoration reaches on UT2 and UT2C will be monitored to document intermittent or seasonal surface flow. This will be accomplished through direct observation, photo documentation of dye tests, and continuous flow monitoring devices (pressure transducers). An auto logging crest gauges has been installed within the headwater valley channel and will continuously record flow conditions at an hourly interval. This gauge will be downloaded during each site visit to determine if intermittent or seasonal flows conditions are present.

3.2 Wetland Hydrology

Wetland hydrology will be monitored to document hydric conditions in the wetland restoration areas. This will be accomplished with automatic recording pressure transducer gauges installed in representative locations across the restoration areas and reference wetland areas. A total of fourteen automatic recording pressure transducers (Auto-Wells) have been installed on the site. Eleven auto-wells have been installed within the wetland restoration area and three within reference areas. The gauges will be downloaded quarterly and wetland hydroperiods will be calculated during the growing season. Gauge installation followed current regulatory and DMS guidance. Visual observations of primary and secondary wetland hydrology indicators will also be recorded during quarterly site visits.

3.3 Vegetation

A total of 20 vegetation plots were randomly established within the planted stream riparian buffer easement. Vegetation plots measure 10 meters by 10 meters or 5 meters by 20 meters (0.02 acres) and have all four corners marked with metal posts. Planted woody vegetation was assessed within each plot to establish a baseline dataset. Within each vegetation plot, each planted stem was identified for species, “X” and “Y” origin located, and measured for height. Reference digital photographs were also captured to document baseline conditions. Species composition, density, growth patterns, damaged stems, and survival ratios will be measured and reported on an annual basis. Vegetation plot data will be reported for each plot as well as an overall site average.

4 MAINTENANCE AND CONTINGENCY PLAN

All identified problematic areas or areas of concern such as stream bank erosion/instability, aggradation/degradation, lack of targeted vegetation, and invasive/exotic species which prevent the site from meeting performance success criteria will be evaluated on a case by case basis. These areas will be documented and remedial actions will be discussed amongst NCDMS staff to determine a plan of action. If it is determined remedial action is required, a plan will be provided.

4.1 Stream

One stream problem was identified during the Year 1 monitoring period and was mapped on the Current Conditions Plan View (CCPV), specifically Figure 3b. The problem was noted on the right bank of Reach UT1, just before the confluence with Reach UT2 (Sta 25+50). The problem area consisted of a tree that had fallen into the channel, associated bank erosion, and scouring with the disturbed root system. This problem area was monitored throughout MY2 and did not worsen or need any remediation. Following Hurricane Matthew, several areas with fallen trees similar to the problem area documented in MY1 report are present along UT-1. These areas will be monitored; however, they are not documented on the stream problem areas table or CCPV for MY2. During MY2 activities, three stream problem areas were documented. Stream Problem Area 1 (SPA1) consists of a debris jam associated from a fallen tree at the upstream portion (Sta. 0+50 – 1+00) of UT-2. The fallen tree has diverted stream flow out of the stream channel and across the floodplain on the right stream bank. Minor bank erosion has resulted in this area. Removal of the fallen tree is recommended along with any additional debris within the stream channel to allow natural channel flow pattern. Stream Problem Area 2 (SPA2) is located at the downstream end (Sta. 9+28) of UT-2. SPA2 is a log ramp structure that has become dislodged and non-functional. The footer logs are no longer tied into the banks resulting in piping around and under the log structure. Repair or replacing this log structure is recommended. The last stream problem area (SPA3) is localized erosion along UT-1. Bank erosion on both left and right stream banks was documented from station 27+50 to 28+75. Most areas are minor; however, a few consists of bank failures. These areas are primarily a result of severe flooding and high flow events resulting from Hurricane Matthew. Remediation is recommended on these areas of localized erosion. Most areas can be matted and live staked to remedy the problem. The more extensive bank failures will need the banks sloped back and matting and live stakes installed.

4.2 Wetlands

No wetland problems areas were noted during the Year 2 monitoring period. Wetland hydrology and vegetation represent typical conditions of a site in Year 2 post construction monitoring. If any wetland problem areas are identified in the future, they will be documented and mapped on the CCPV as part of the annual monitoring report. Nine of the eleven wetland gauges achieved the success criteria by remaining continuously within the 12 inches of the soil surface for at least nine percent of the growing season.

4.3 Vegetation

Two vegetation problem areas were identified during the Year 2 monitoring period. These vegetation problem areas are mapped on the Current Conditions Plan View (CCPV) as part of the annual monitoring report. The first vegetation problem area (VPA1) consists of invasive species Chinese

Privet (*Ligustrum sinense*) located at the upstream portion of UT-1. This problem area is approximately 0.60 acres; however, invasive control treatment (cutting and spraying) is recommended before it grows larger and spreads throughout the easement. The other vegetation problem (VPA2) is a small bare area (0.05 ac.) along UT-2 above the stream crossing (Sta. 4+00). This area lacks herbaceous cover. Reseeding and mulching is recommended in this area.

5 YEAR 2 MONITORING CONDITIONS (MY2)

The Cedar Creek Year 2 Monitoring activities were completed in late October 2016. All Year 2 monitoring data is present below and in the appendices. Data presented shows the site has three stream problem areas and two vegetation problem areas; however, the site is on track to meeting stream, wetland and vegetation interim success criteria.

5.1 Year 2 Monitoring Data Collection

5.1.1 Morphological State of the Channel

All morphological stream data for the MY2 dimensions were collected during the annual monitoring survey performed during July 2016. Appendix B includes summary data tables, morphological parameters, and stream photographs.

Profile

The baseline (MY-0) profiles closely matches the proposed design profiles. The plotted longitudinal profiles can be found on the As-Built Drawings. Longitudinal profiles will not be performed in annual monitoring reports unless requested by NCDMS or USACE. Morphological summary data tables can be found in Appendix D.

Dimension

The Year 2 (MY-2) cross sectional dimensions closely matches the baseline cross section parameters. Minimal changes were noticed for most Year 2 cross section surveys resulting from stable bed and bank conditions. All cross section plots and data tables can be found in **Appendix D**.

Sediment Transport

The Year 2 conditions show that shear stress and velocities have been reduced for all six restoration reaches. Pre-construction conditions documented all six reaches as sand bed channels and remain classified as sand bed channels post-construction. Visual assessments (Appendix B) show the channels are transporting sediment as designed and will continue to be monitored for aggradation and degradation.

Bank Pin Arrays

Eight pool cross section locations with bank pin arrays were observed and measured for bank erosion located on the outside meander bends. If bank pin exposure was noticeable, it was measured, recorded, photographed, and then driven flush with the bank at each monitoring location. No bank pin arrays recorded any exposure during the Year 2 monitoring season. Bank pin array data tables can be found in Appendix D.

5.1.2 Vegetation

The Year 2 monitoring (MY-2) vegetation survey was completed in September 2016 and resulted in an average of 749 planted stems per acre, well above the interim survival density of 320 stems per acre at the end of Year 3 monitoring. The average stems per vegetation plot was 19 planted stems. The minimum planted stem per plot was 13 stems and the maximum was 32 stems per plot. Sweetgum (*Liquidambar styraciflua*) and red maple (*Acer rubrum*) were noted during MY1 activities; however, during MY2 these volunteer species were not noticed. Abundant herbaceous ground cover may have prevented the observance of these species. Vegetation summary data tables can be found in **Appendix C** and vegetation plot photos in **Appendix B**.

5.1.3 Photo Documentation

Permanent photo point locations have been established at cross sections, vegetation plots, stream crossings, and stream structures by RES staff. Any additional problem areas or areas of concern will also be documented with a digital photograph during monitoring activities. Stream digital photographs can be found in **Appendix B** and **Appendix C** for vegetation photos.

5.1.4 Stream Hydrology

Three sets of manual and auto-logging crest gauges were installed on the site, one along UT2, one along UT2C, and one along UT3. The auto logging crest gauges were installed within the channel and continuously record flow conditions at hourly intervals. Both UT-2 and UT-3 restoration reaches documented bankfull events during the Year 2 monitoring period. Crest gauge 1, which is located on UT-3, documented four out of bank events during MY2 with the highest reading of 1.15 feet. Crest gauge 3 (UT-2) logged one bankfull event during monitoring year 2 with a reading of 0.4 feet above bankfull elevation. Crest gauge 2 is installed on UT-2C where headwater valley restoration was performed and documented nearly 118 days of consecutive flow. This intermittent stream reach flowed for a total of 186 days during the monitoring year 2 period. Crest gauge summary data and photo documentation of the bankfull events can be found in **Appendix E**.

5.1.5 Wetland Hydrology

Nine of the eleven wetland gauges achieved the success criteria by remaining continuously within 12 inches of the soil surface for at least nine percent of the growing season. Groundwater gauge data indicate the hydroperiods being very responsive to rainfall events. Wetland hydrology gauges AW7 and AW11 both fell short of the nine percent success criteria. AW11 documented 6 days consecutively (2%) or 38 days cumulatively (15%) where groundwater was within 12 inches of the soil surface and AW7 documented 4 days consecutively (2%) throughout the growing season. RES plans to evaluate these wetland gauges closely to make sure wetland hydrology is accurately documented. All three reference gauges documented hydroperiods well above the nine percent success criteria ranging from 23 to 41 percent of the growing season. Wetland gauge and rainfall data is presented in **Appendix E**.

6 REFERENCES

Chow, Ven Te. 1959. Open-Channel Hydraulics, McGraw-Hill, New York.

Cowardin, L.M., V. Carter, F.C. Golet and E.T. LaRoe. 1979. Classification of Wetlands and DDMSwater Habitats of the United States. U.S. Fish and Wildlife Service, Office of Biological Services, FWS/OBS-79/31. U.S. Department of the Interior, Washington, DC.

Environmental Banc & Exchange (2014). Cedar Creek Stream Restoration Project Final Mitigation Plan. North Carolina Ecosystems Enhancement Program, Raleigh, NC.

Horton, J. Wright Jr. and Victor A. Zullo. 1991. The Geology of the Carolinas, Carolina Geological Society Fiftieth Anniversary Volume. The University of Tennessee Press. Knoxville, TN.

Johnson PA. 2006. Assessing stream channel stability at bridges in physiographic regions. U.S. Department of Transportation. Federal Highway Administration. Report Number FHWA-HRT-05-072.

Lee, Michael T., R.K. Peet, S.S. Roberts, and T.R. Wentworth. 2008. CVS-EEP Protocol for Recording Vegetation, Version 4.2 (<http://cvs.bio.unc.edu/methods.htm>)

Natural Resources Conservation Service (NRCS). 2007. Stream Restoration Design Handbook (NEH 654), USDA

NCDENR. "Water Quality Stream Classifications for Streams in North Carolina." Water Quality Section. <http://h2o.enr.state.nc.us/wqhome/html> (June 2005).

Radford, A.E., H.E. Ahles and F.R. Bell. 1968. Manual of the Vascular Flora of the Carolinas. The University of North Carolina Press, Chapel Hill, North Carolina.

Schafale, M.P. and A.S. Weakley. 1990. Classification of the Natural Communities of North Carolina, Third Approximation. North Carolina Natural Heritage Program, Division of Parks and Recreation, NCDENR, Raleigh, NC.

Appendix A

Project Background Data and Maps

Table 1. Project Components and Mitigation Credits

Table 2. Project Activity and Reporting History

Table 3. Project Contacts

Table 4. Project Information and Attributes

Figure 1. Project Vicinity Map

Figure 2. Project USGS Map

Appendix A. General Tables and Figures

Table 1 Project Components and Mitigation Credits
Monitoring Report Year 2

Table 1. Project Components and Mitigation Credits Cedar Creek Stream and Wetland Restoration Project/DMS Project # 95718										
Mitigation Credits										
	Stream		Riparian Wetland		Non-riparian Wetland		Buffer	Nitrogen Nutrient Offset	Phosphorous Nutrient Offset	
Type	R	RE	R	RE	R	RE				
Totals	2,989	2,288	13.72	N/A	N/A	N/A	N/A	N/A	N/A	
Project Components										
Project Component -or- Reach ID	As-Built Stationing/Location (LF)		Existing Footage/Acreage		Approach (PI, PII etc.)		Restoration - or-Restoration Equivalent	Restoration Footage or Acreage	Mitigation Ratio	SMUs/ WMUs
UT1	0+01 to 31+65		3,064		Enhancement II		RE	3,064	1 : 2.5	1,226
UT1	31+65 to 35+80		415		Enhancement I		RE	415	1 : 1.5	277
UT1	35+80 to 41+95		615		Enhancement II		RE	615	1 : 2.5	246
UT1	41+95 to 44+60		265		Enhancement I		RE	265	1 : 1.5	177
UT1	44+60 to 53+51		891		Enhancement II		RE	827	1 : 2.5	331
UT2	0+11 to 3+48		364		Headwater Valley		R	337	1 : 1.0	337
UT2	3+48 to 9+28		587		P1 Restoration		R	518	1 : 1.0	518
UT2C	0+02 to 1+95		NA		Headwater Valley		R	193	1 : 1.0	193
UT3	0+69 to 20+10		1,428		P1 Restoration		R	1,941	1 : 1.0	1,941
UT4	0+36 to 1+14		78		Enhancement II		RE	78	1 : 2.5	31
Wetland 1	Adjacent to UT1 & UT3		13.72		Restoration		R	13.72	1 : 1.0	13.72
Component Summation										
Restoration Level	Stream (linear feet)		Riparian Wetland (acres)		Non-riparian Wetland	Buffer (square feet)	Upland (acres)			
			Riverine	Non-Riverine						
Restoration	2,459		13.72							
Headwater Valley	530									
Enhancement I	680									
Enhancement II	4,584									
Creation										
Preservation										
High Quality Preservation										
BMP Elements										
Element	Location		Purpose/Function			Notes				
---	---		---			---				
---	---		---			---				
---	---		---			---				
BMP Elements										
BR = Bioretention Cell; SF = Sand Filter; SW = Stormwater Wetland; WDP = Wet Detention Pond; DDP = Dry Detention Pond; FS = Filter Strip; S = Grassed Swale; LS = Level Spreader; NI = Natural Infiltration Area; FB = Forested Buffer										

Table 2. Project Activity and Reporting History

Project Activity and Reporting History Cedar Creek Stream and Wetland Restoration Project / DMS Project #95718		
Activity or Report	Data Collection Complete	Completion or Delivery
Mitigation Plan	NA	August 2014
Final Design – Construction Plans	NA	December 2014
Construction Completed	March 2015	May 2015
Site Planting Completed	May 2015	May 2015
Baseline Monitoring Document (Year 0 Monitoring – baseline)	July 2015	November 2015
Year 1 Monitoring	December 2015	February 2016
Year 2 Monitoring	October 2016	November 2016
Year 3 Monitoring		
Year 4 Monitoring		
Year 5 Monitoring		
Year 6 Monitoring		
Year 7 Monitoring		

Table 3. Project Contacts

Project Contacts Table Cedar Creek Stream and Wetland Restoration Project /DMS Project #95718	
Designer	WK Dickson and Co., Inc. 720 Corporate Center Drive Raleigh, NC 27607 (919) 782-0495 Frasier Mullen, PE
Construction Contractor	Wright Contracting PO Box 545 Siler City, NC 27344 (919) 663-0810 Joseph Wright
Planting Contractor	Resource Environmental Solutions, LLC 302 Jefferson Street, Suite 110 Raleigh, NC 27605 (919) 209-1061 David Godley
Seeding Contractor	Wright Contracting PO Box 545 Siler City, NC 27344 (919) 663-0810 Joseph Wright
Seed Mix Sources	Green Resource
Nursery Stock Suppliers	Arbogen, NC Forestry Services Nursery
Full Delivery Provider	Resource Environmental Solutions, LLC 302 Jefferson Street, Suite 110 Raleigh, NC 27605 (919) 209-1056
Project Manager:	Daniel Ingram
Monitoring Performers	Resource Environmental Solutions, LLC 302 Jefferson Street, Suite 110 Raleigh, NC 27605 (919) 209-1054
Project Manager:	Brian Hockett, PLS

Table 4. Project Information**Project Information**

Project Name	Cedar Creek Site
County	Sampson
Project Area (acres)	42.0
Project Coordinates (latitude and longitude)	34° 57' 59.663" N 78° 22' 0.778" W

Project Watershed Summary Information

Physiographic Province	Outer Coastal Plain
River Basin	Cape Fear
USGS Hydrologic Unit 8-digit	03030006
USGS Hydrologic Unit 14-digit	03030006090060
DWQ Sub-basin	03-06-19
Project Drainage Area (acres)	2,890 acres
Project Drainage Area Percentage of Impervious Area	4.5%
CGIA Land Use Classification	Woody wetlands, Shrub/scrub, cultivated crops, evergreen forest

Reach Summary Information (As-Built Conditions)

Parameters	UT1	UT2	UT3	UT4
Length of reach (linear feet)	5,250	917	1941	78
Valley Classification	X	X	X	X
Drainage area (acres)	2780	35	151	77
NCDWQ stream identification score	50.0	34.5	40.0	42.5
NCDWQ Water Quality Classification	N/A	N/A	N/A	N/A
Morphological Description (stream type)	E5	E5	E5	E5
Evolutionary trend	Stage II	Stage II/III	Stage II/III	Stage II/III
Underlying mapped soils	BH	Jo	BH	BH
Drainage class	frequently flooded	undrained	frequently flooded	frequently flooded
Soil Hydric status	Hydric	Hydric	Hydric	Hydric
Slope	0.20%	1.40%	1.10%	1.0%
FEMA classification	N/A	N/A	AE	N/A
Native vegetation community	cultivated , mixed hardwood forest	cultivated, mixed hardwood forest	mixed hardwood forest	mixed hardwood forest
Percent composition of exotic invasive vegetation	<5	0	0	<5

Wetland Summary Information	
Parameters	Wetland 1 UT1/3
Size of Wetland (acres)	13.72
Wetland Type (non-riparian, riparian riverine or riparian non-riverine)	Riparian Riverine
Mapped Soil Series	Bibb/Johnson
Drainage class	Frequently Flooded
Soil Hydric Status	Hydric
Source of Hydrology	Runoff/Groundwater Discharge
Hydrologic Impairment	Incised Channel, Dredging
Native vegetation community	Forested
Percent composition of exotic invasive vegetation	1 – 2%

Regulatory Considerations

Regulation	Applicable	Resolved	Supporting Documentation
Waters of the United States - Section 404	Yes	Yes	SAW-2013-00389
Waters of the United States - Section 401	Yes	Yes	DWR # 13-0186
Endangered Species Act	Yes	Yes	USFWS (Corr. Letter)
Historic Preservation Act	Yes	Yes	SHPO (Corr. Letter)
Coastal Zone Management Act (CZMA)/Coastal Area Management Act (CAMA)	No	NA	N/A
FEMA Floodplain Compliance	Yes	Yes	EEP Floodplain Requirements Checklist
Essential Fisheries Habitat	No	NA	N/A


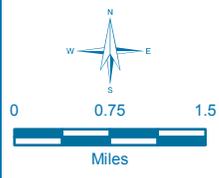



Figure1
Project Vicinity Map
Cedar Creek Stream and Wetland Restoration Site
Sampson County, North Carolina

Date: 11/6/2015

Drawn by: BSH

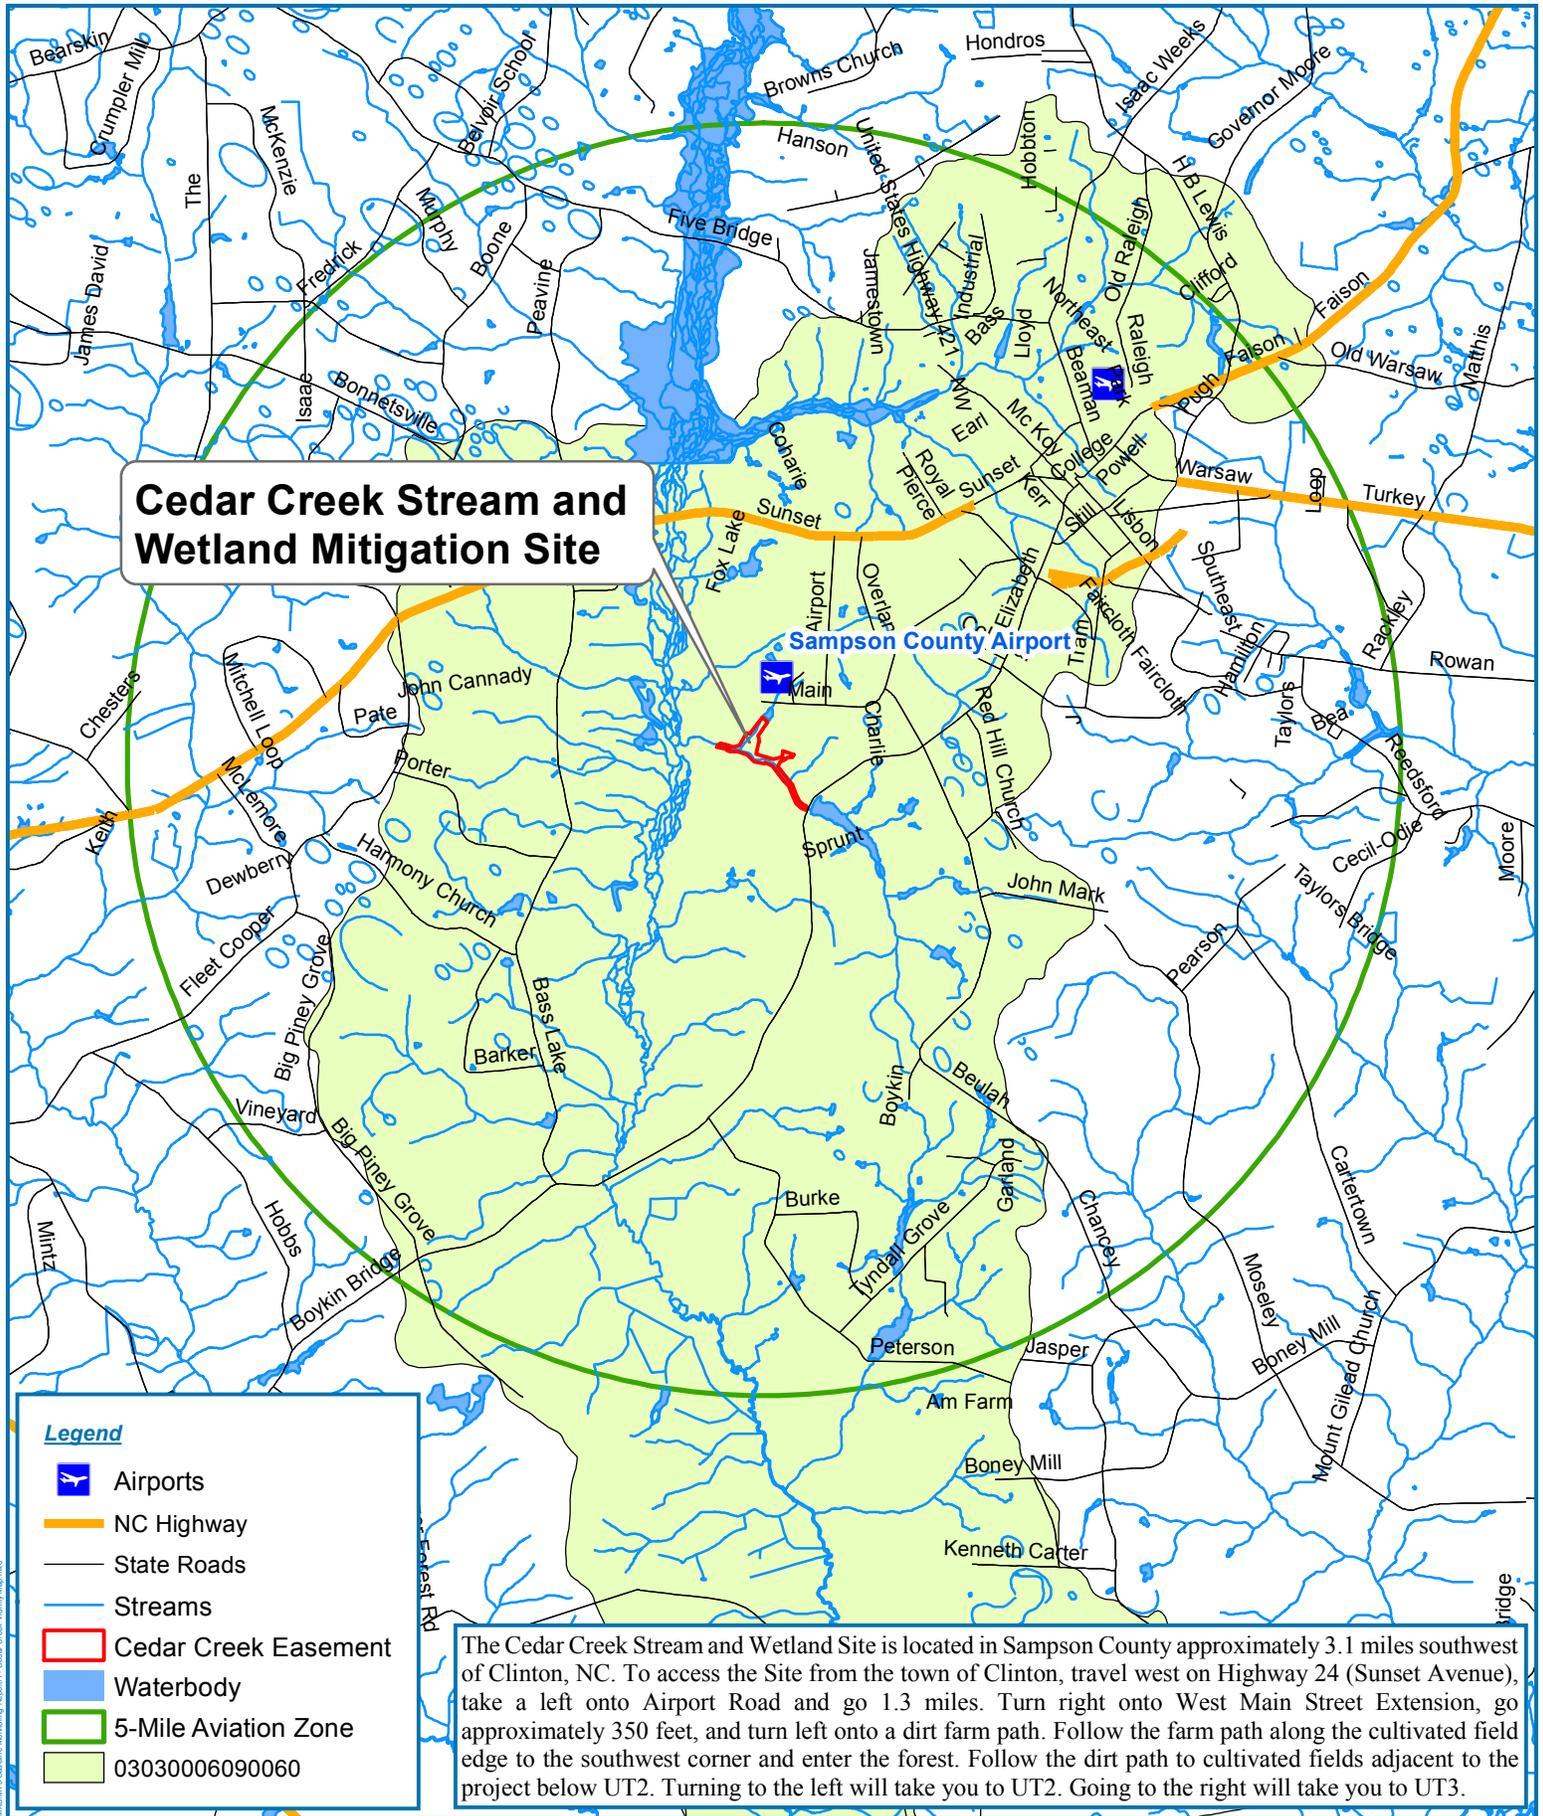

Document Path: E:\RES Files\Cedar_Creek\CAD\GIS\MXD\03030006090060.mxd; Report: 1_Cedar_Creek_Vicinity_Map.mxd

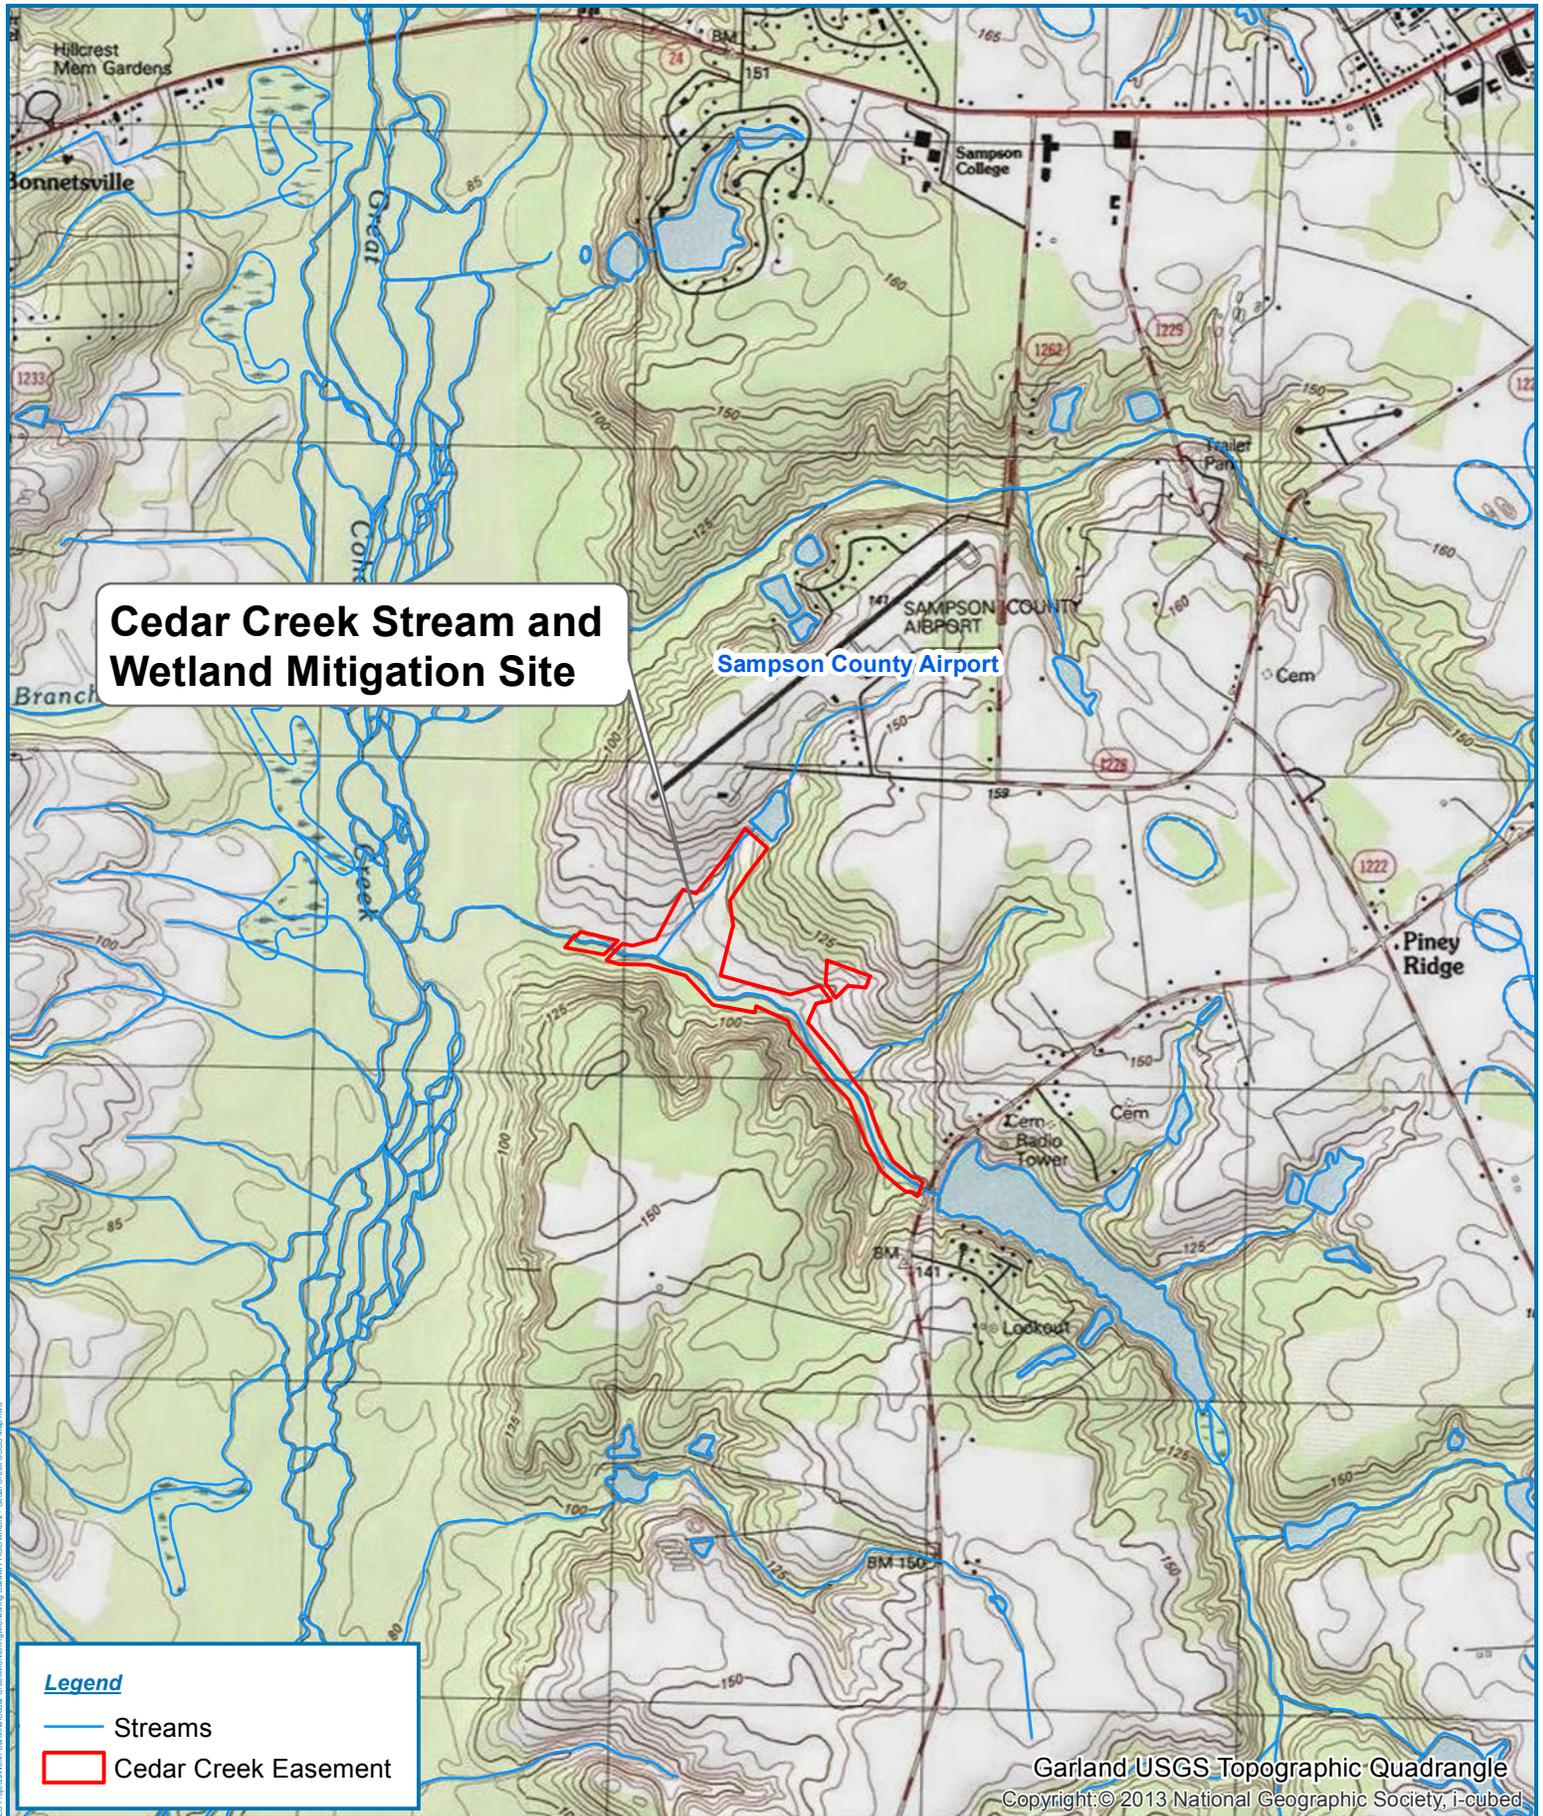

Legend

- Streams
- Cedar Creek Easement

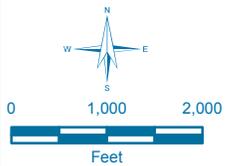


Figure2
Project USGS Map
Cedar Creek Stream and Wetland Restoration Site
Sampson County, North Carolina

Date: 2/16/2016

Drawn by: BSH



Document Path: C:\Users\shelton\Documents\RES\GIS\ESRI\Projects\North Carolina\Cedar Creek\Map\Map.mxd

Appendix B

Visual Assessment Data

Figure 3. Current Conditions Plan View Map (CCPV)

Table 5. Visual Stream Morphology Stability Assessment

Table 6. Vegetation Condition Assessment

Table 7. Stream Problem Areas

Table 8. Vegetation Problem Areas

Stream Photos

Vegetation Plot Photos

Stream and Vegetation Problem Area Photos



1 inch = 100 feet

Figure 3b.
Cedar Creek
Restoration Project
UT1
Current Conditions
Plan View Map

Date: 11/29/2016 Drawn by: BSH

LEGEND

- ▭ Conservation Easement
- ▭ Vegetation Plots
- Stream/Wetland Gauges
- State Roads
- Bank Erosion
- Enhancement I
- Enhancement II
- Headwater Valley Restoration
- P1 Restoration
- Cross Sections
- ▨ Wetland Restoration Area

Riparian Buffer Conditions			
Invasive Species	Target Community		
	Present	Marginal	Absent
Absent	No Fill	 	
Present	 	 	
Common	 	 	



Source: 2013 NC Onemap Aerial Imagery



1 inch = 100 feet


Figure 3c.
Cedar Creek
Restoration Project
UT1
Current Conditions
Plan View Map

Date: 11/29/2016 Drawn by: BSH

LEGEND


- ▭ Conservation Easement
- Crest Gauge Locations
- Vegetation Plots
- Wetland Well Hydroperiods**
- ⊕ >9% Successful
- ⊕ <9% Not Successful
- State Roads
- Enhancement I
- Enhancement II
- Headwater Valley Restoration
- P1 Restoration
- Cross Sections
- Wetland Restoration Area

Riparian Buffer Conditions			
Invasive Species	Target Community		
	Present	Marginal	Absent
Absent	No Fill	 	
Present	 	 	
Common	 	 	

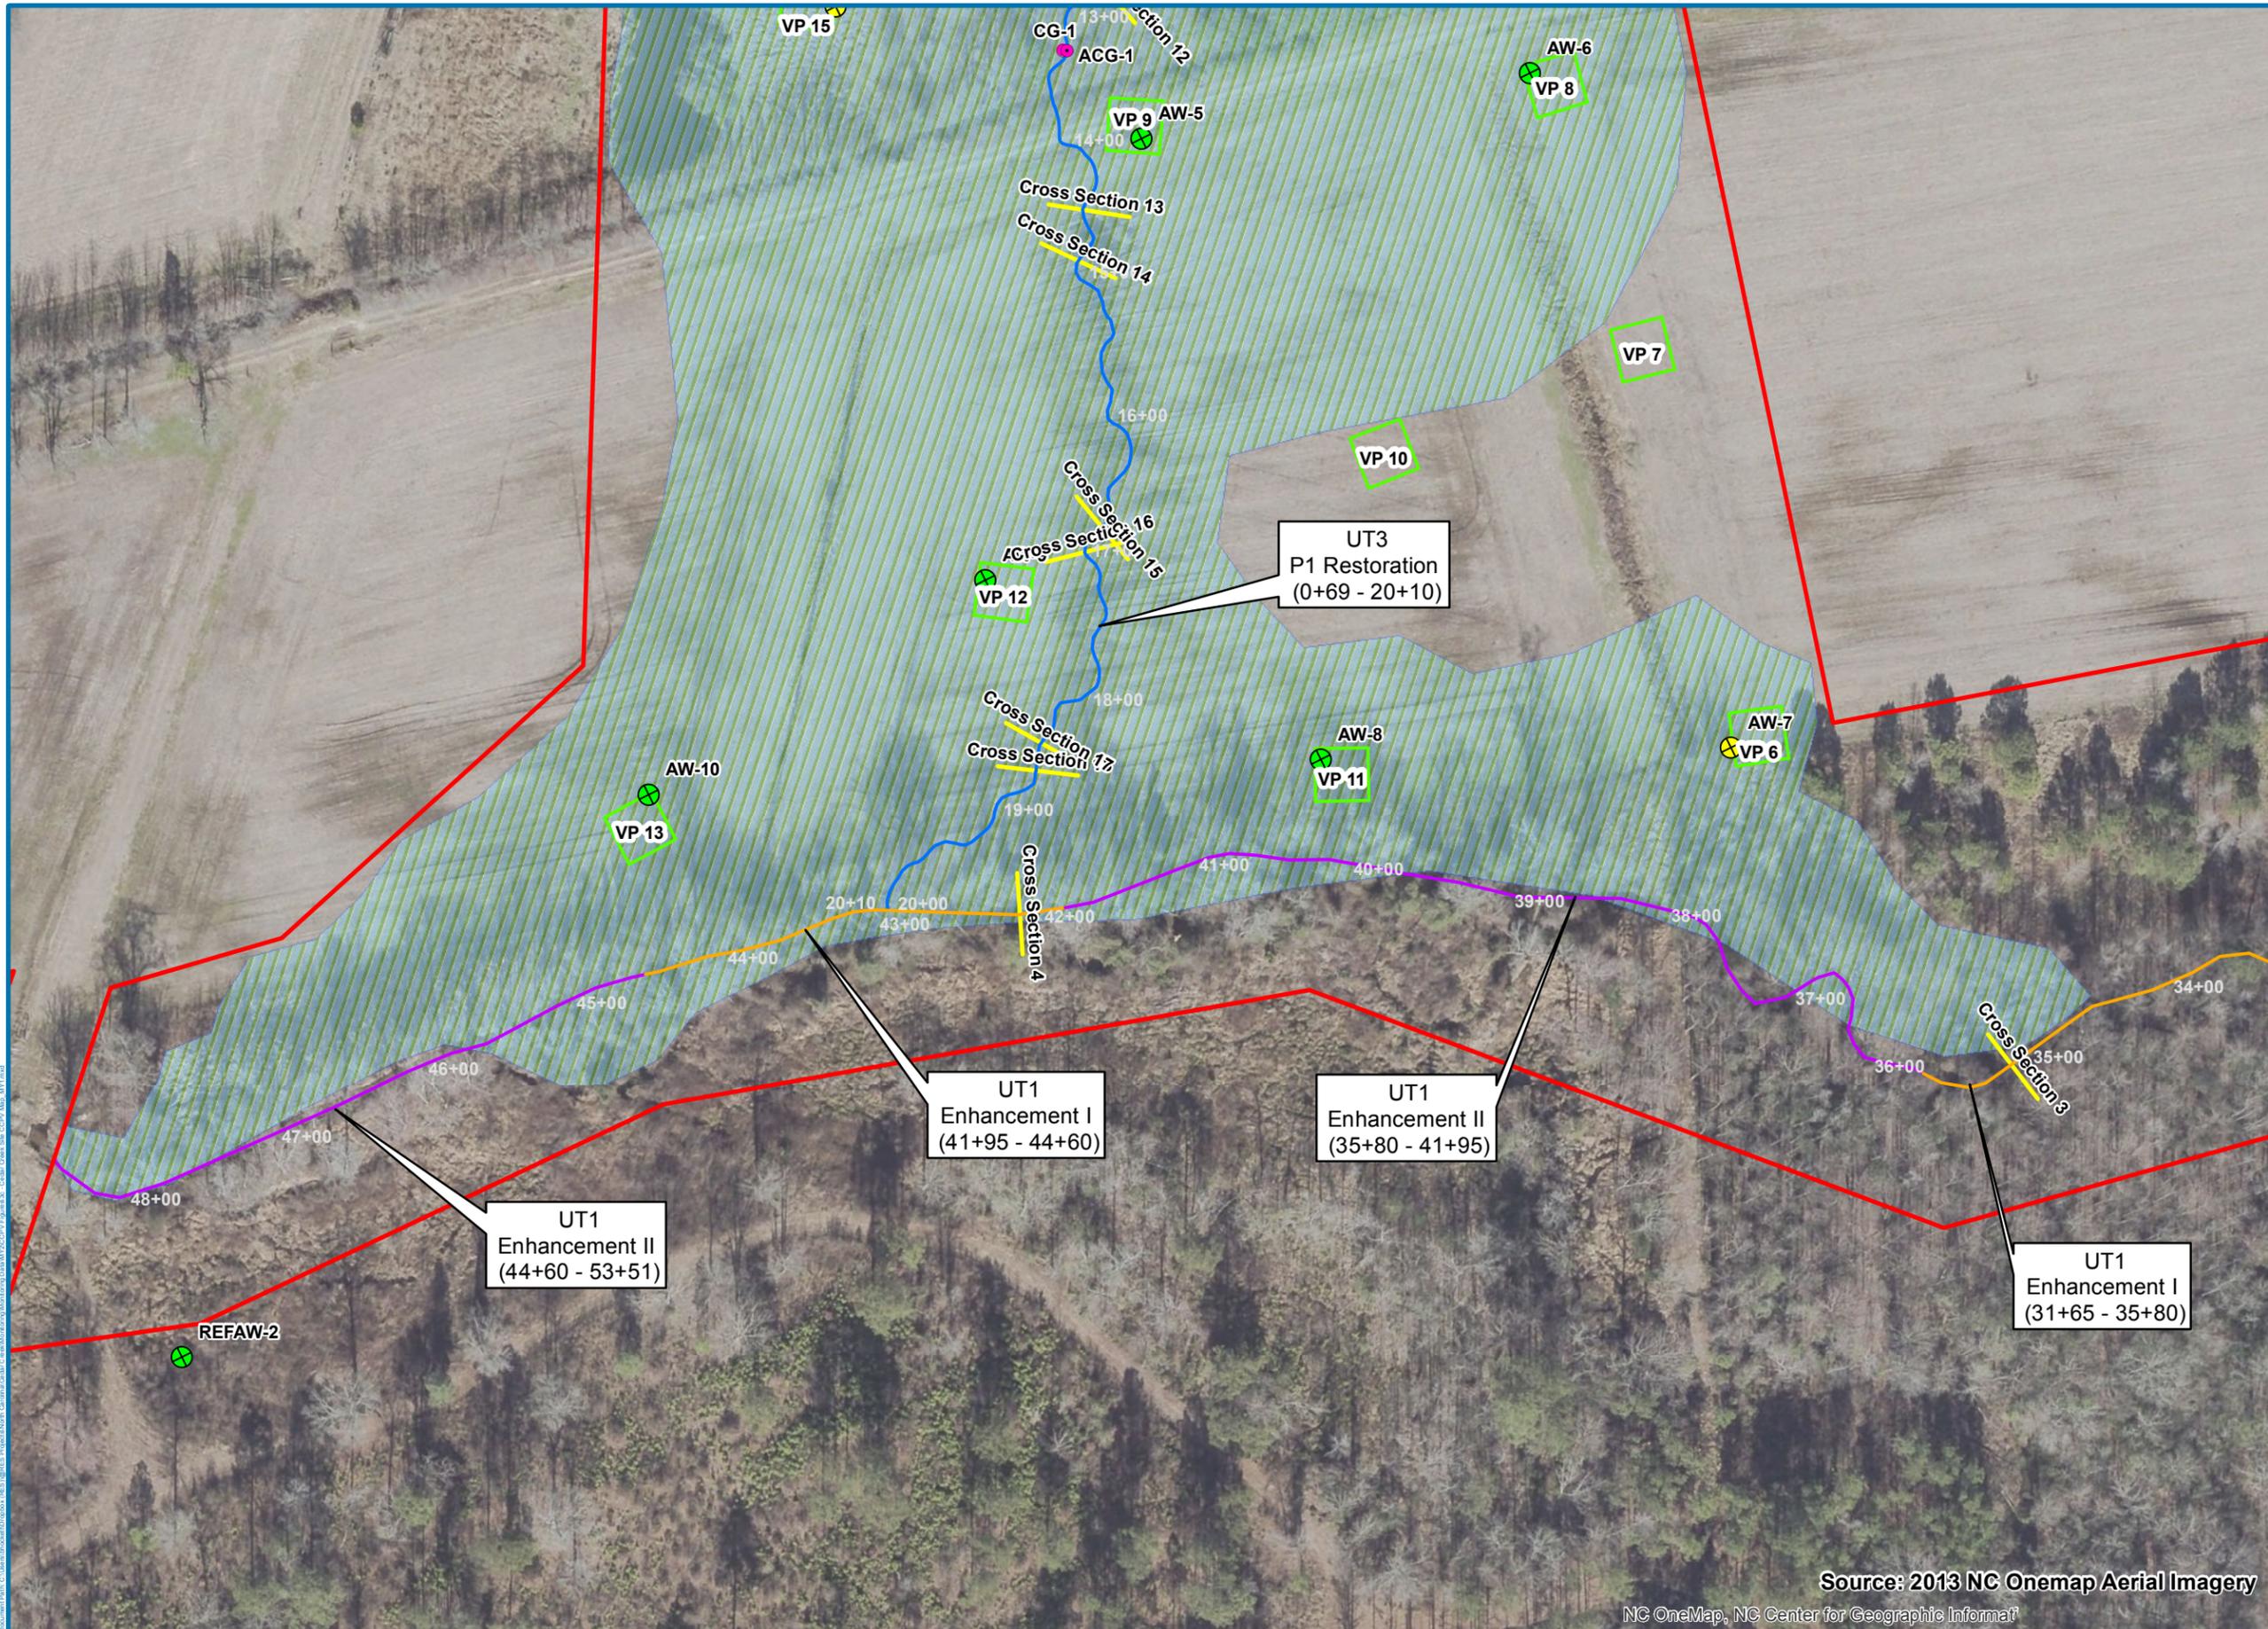

Source: 2013 NC Onemap Aerial Imagery

NC OneMap, NC Center for Geographic Informat

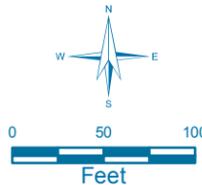

1 inch = 100 feet


Figure 3e.
Cedar Creek
Restoration Project
UT2/UT2C
Current Conditions
Plan View Map

Date: 11/29/2016 Drawn by: BSH

LEGEND

- ▭ Conservation Easement
- ▭ Vegetation Plots
- Crest Gauge Locations
- Bank Erosion
- State Roads
- Enhancement I
- Enhancement II
- Headwater Valley Restoration
- P1 Restoration
- Cross Sections
- ▨ Wetland Restoration Area

Riparian Buffer Conditions			
Invasive Species	Target Community		
	Present	Marginal	Absent
Absent	No Fill	▭	▭
Present	▭	▭	▭
Common	▭	▭	▭

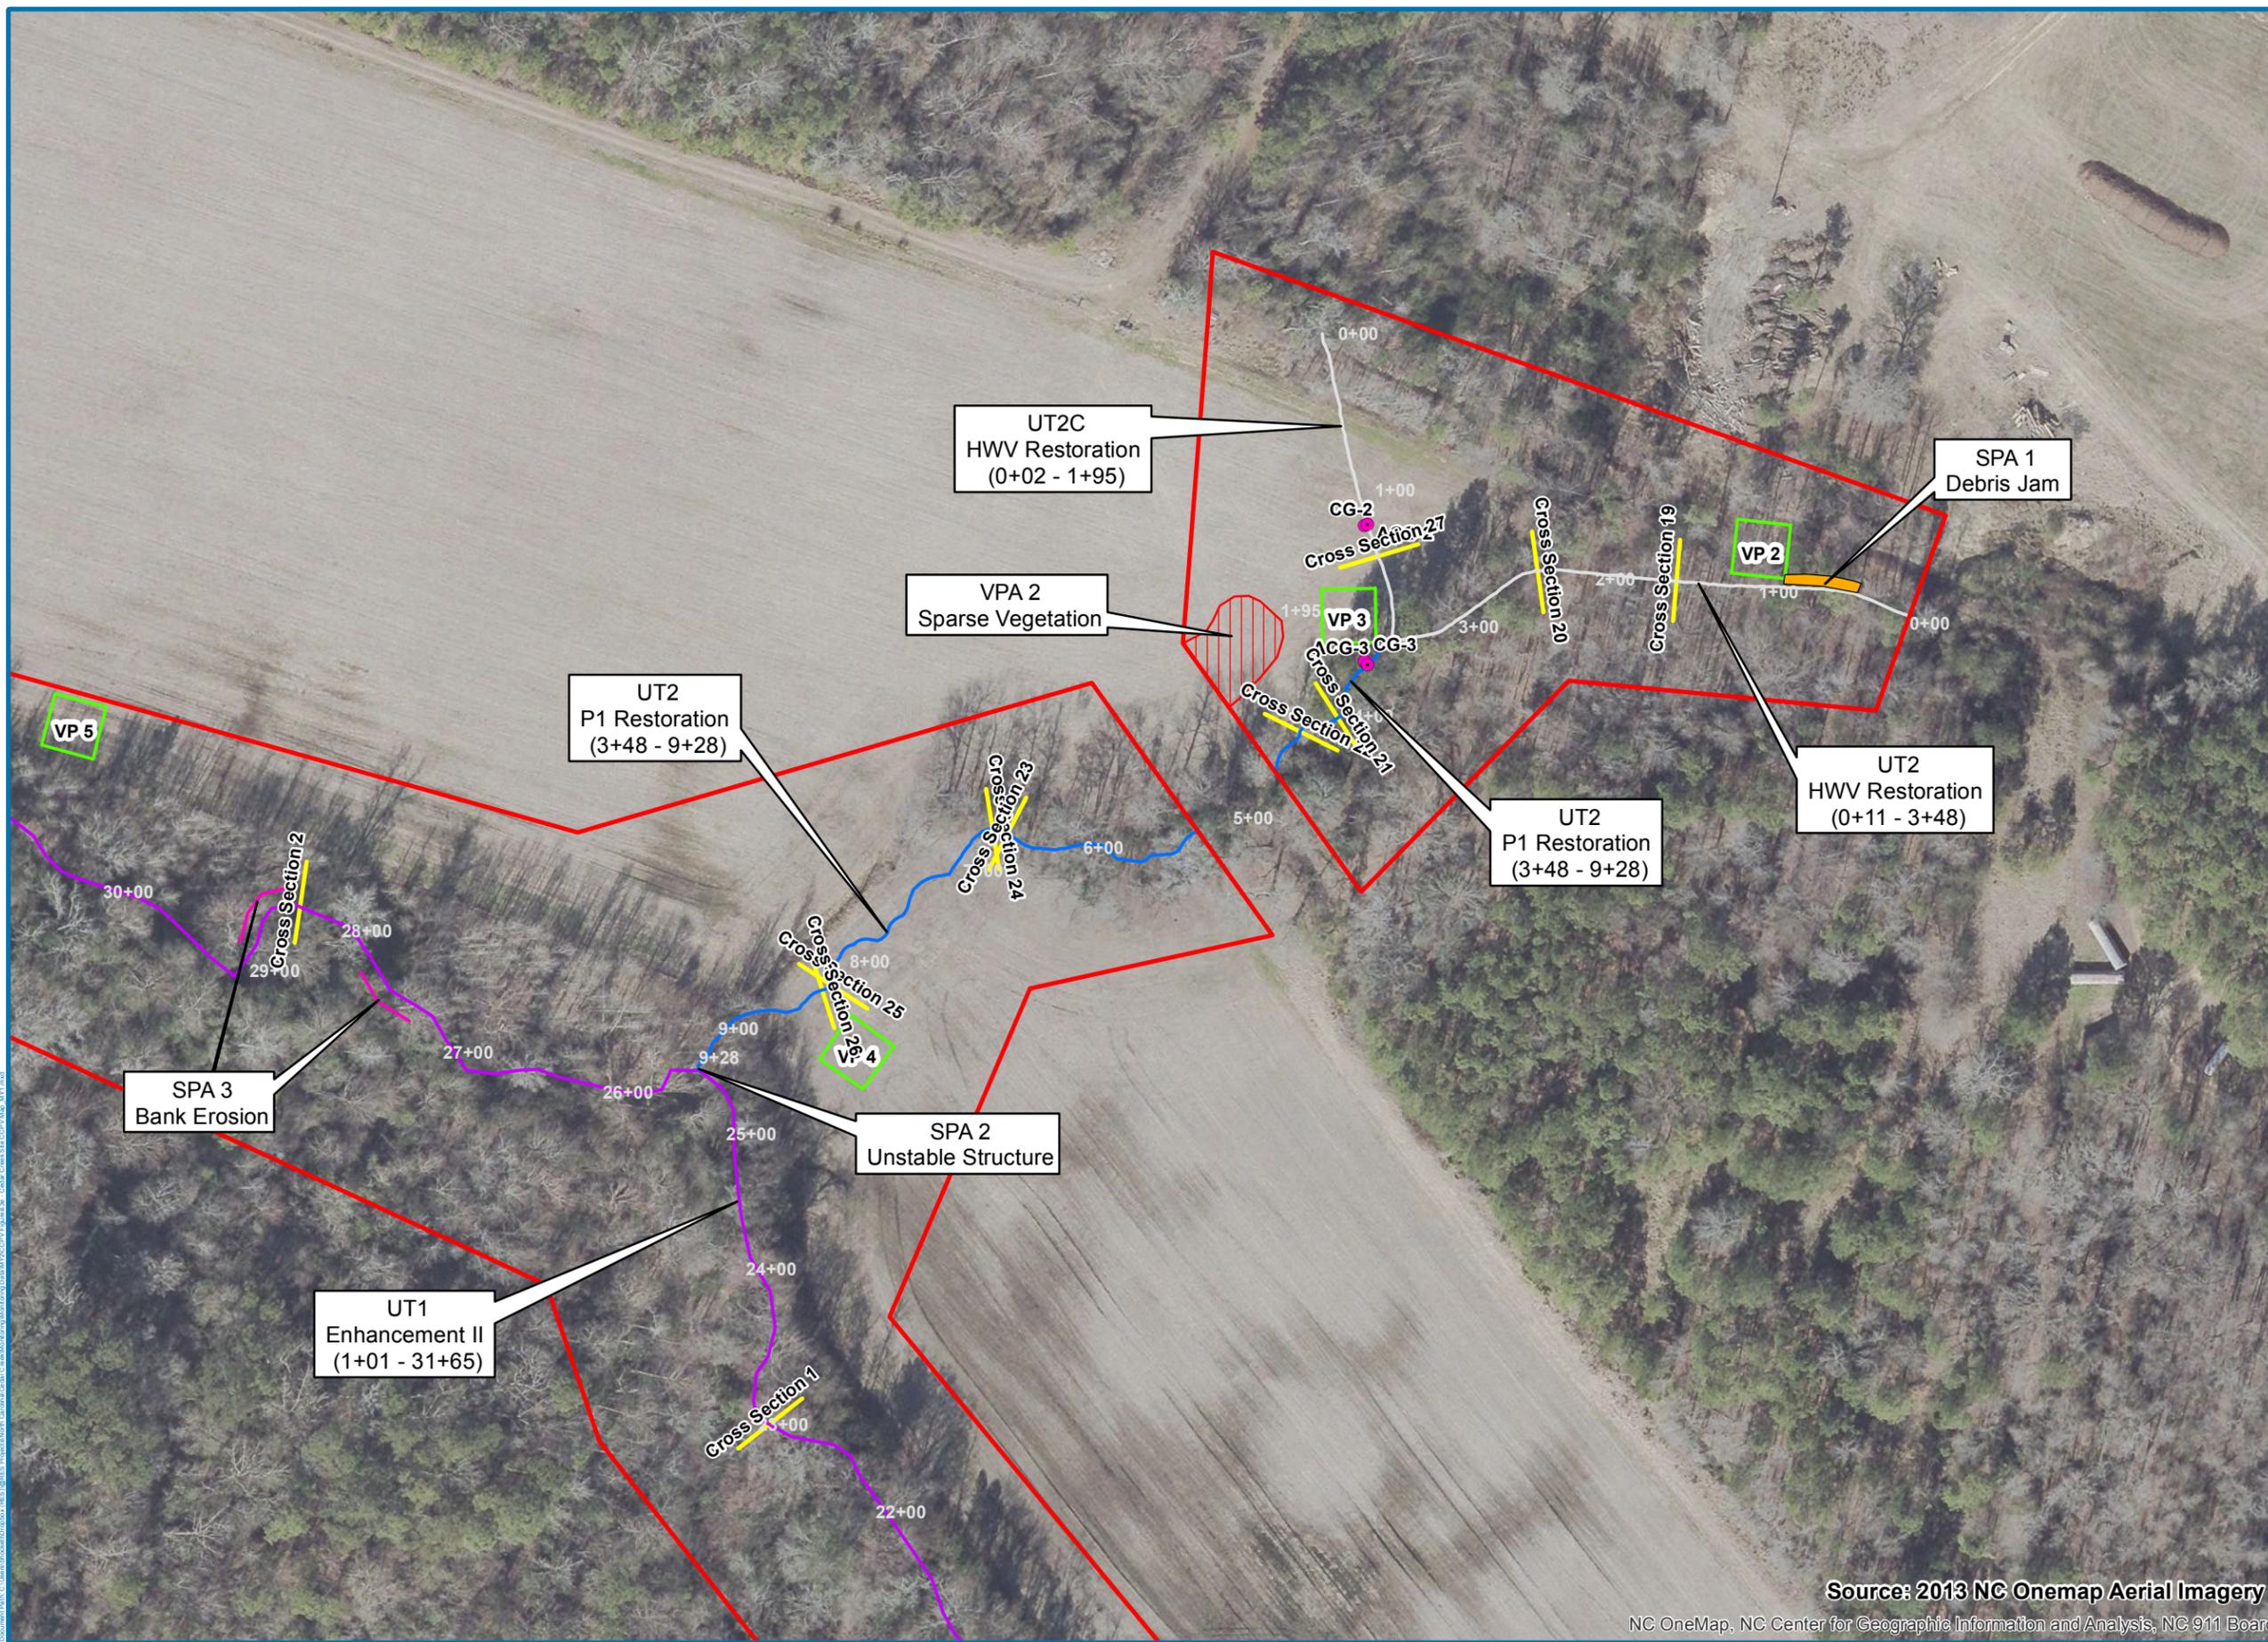

Source: 2013 NC Onemap Aerial Imagery

NC OneMap, NC Center for Geographic Information and Analysis, NC 911 Board

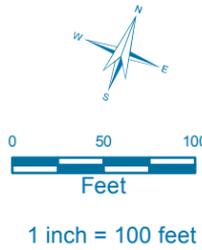



Figure 3f.
Cedar Creek
Restoration Project
UT3
Current Conditions
Plan View Map

Date: 11/29/2016 Drawn by: BSH

LEGEND

- Conservation Easement
- Crest Gauge Locations
- Vegetation Plots
- Wetland Well Hydroperiods**
- ⊕ >9% Successful
- ⊕ <9% Not Successful
- State Roads
- Enhancement I
- Enhancement II
- Headwater Valley Restoration
- P1 Restoration
- Cross Sections
- Wetland Restoration Area

Riparian Buffer Conditions			
		Target Community	
		Present	Marginal
Invasive Species	Absent	No Fill	No Fill
	Present	No Fill	No Fill
	Common	No Fill	No Fill

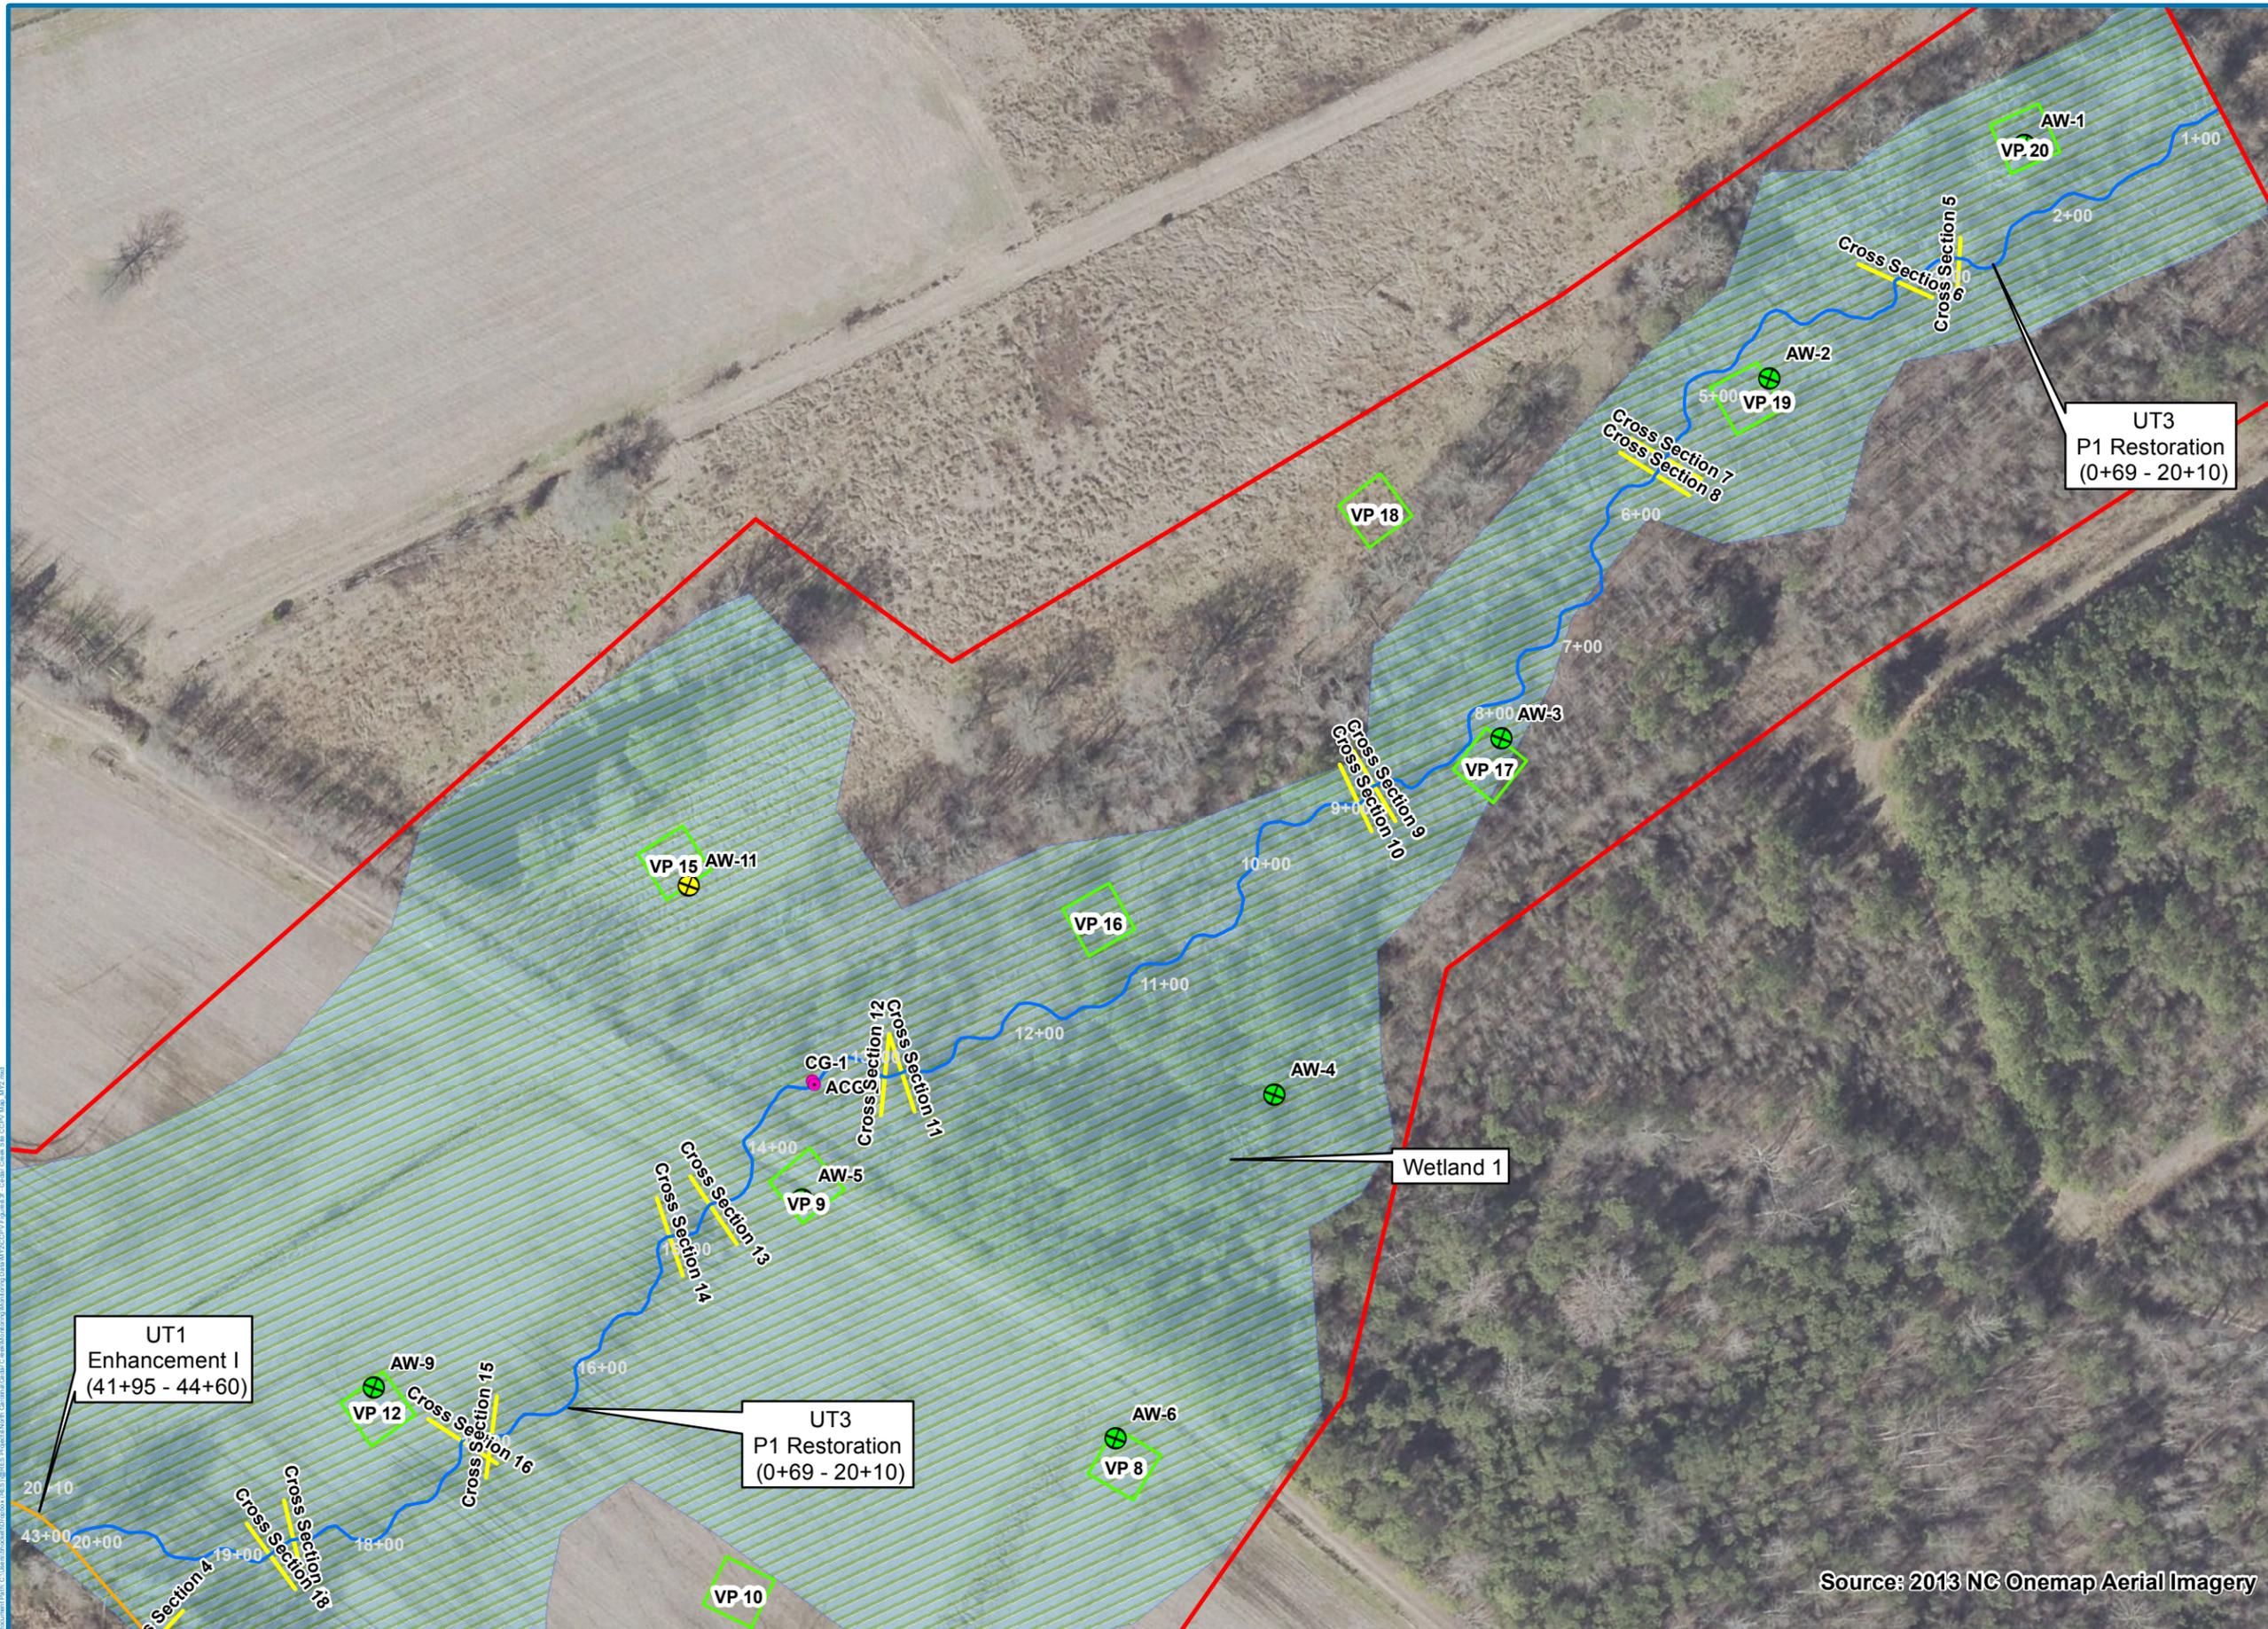

Source: 2013 NC Onemap Aerial Imagery

Table 5 Visual Stream Morphology Stability Assessment
 Reach ID UT1
 Assessed Length 5186

Major Channel Category	Channel Sub-Category	Metric	Number Stable, Performing as Intended	Total Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable, Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bank *	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does <u>NOT</u> include undercuts that are modest, appear sustainable and are providing habitat.			1	50	100%	1	50	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			3	75	99%	0	0	99%
	Totals				4	125	99%	1	50	99%
2. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	5	5			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	5	5			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	5	5			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	5	5			100%			
	4. Habitat	Pool forming structures maintaining - Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	5	5			100%			

Table 5 **Visual Stream Morphology Stability Assessment**
 Reach ID UT2
 Assessed Length 855

Major Channel Category	Channel Sub-Category	Metric	Number Stable, Performing as Intended	Total Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable, Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bank *	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			1	50	97%	0	0	97%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals					1	50	97%	0	0	97%
2. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	20	21			95%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	20	21			95%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	20	21			95%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	20	21			95%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio ≥ 1.6 Rootwads/logs providing some cover at base-flow.	21	21			100%			

Table 5 **Visual Stream Morphology Stability Assessment**
 Reach ID UT2C
 Assessed Length 193

Major Channel Category	Channel Sub-Category	Metric	Number Stable, Performing as Intended	Total Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable, Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bank *	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals					0	0	100%	0	0	100%
2. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	3	3			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	3	3			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	3	3			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	3	3			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	3	3			100%			

Table 5 **Visual Stream Morphology Stability Assessment**
 Reach ID UT3
 Assessed Length 1941

Major Channel Category	Channel Sub-Category	Metric	Number Stable, Performing as Intended	Total Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable, Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bank *	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%	0	0	100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%	0	0	100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%	0	0	100%
Totals					0	0	100%	0	0	100%
2. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	19	19			100%			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	19	19			100%			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	19	19			100%			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	19	19			100%			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio \geq 1.6 Rootwads/logs providing some cover at base-flow.	19	19			100%			

Table 5
 Reach ID
 Assessed Length

Visual Stream Morphology Stability Assessment
 UT4
 78

Major Channel Category	Channel Sub-Category	Metric	Number Stable, Performing as Intended	Total Number in As-built	Number of Unstable Segments	Amount of Unstable Footage	% Stable, Performing as Intended	Number with Stabilizing Woody Vegetation	Footage with Stabilizing Woody Vegetation	Adjusted % for Stabilizing Woody Vegetation
1. Bank *	1. Scoured/Eroding	Bank lacking vegetative cover resulting simply from poor growth and/or scour and erosion			0	0	100%			100%
	2. Undercut	Banks undercut/overhanging to the extent that mass wasting appears likely. Does NOT include undercuts that are modest, appear sustainable and are providing habitat.			0	0	100%			100%
	3. Mass Wasting	Bank slumping, calving, or collapse			0	0	100%			100%
	Totals				0	0	100%			100%
2. Engineered Structures	1. Overall Integrity	Structures physically intact with no dislodged boulders or logs.	0	0			N/A			
	2. Grade Control	Grade control structures exhibiting maintenance of grade across the sill.	0	0			N/A			
	2a. Piping	Structures lacking any substantial flow underneath sills or arms.	0	0			N/A			
	3. Bank Protection	Bank erosion within the structures extent of influence does <u>not</u> exceed 15%. (See guidance for this table in EEP monitoring guidance document)	0	0			N/A			
	4. Habitat	Pool forming structures maintaining ~ Max Pool Depth : Mean Bankfull Depth ratio ≥ 1.6 Rootwads/logs providing some cover at base-flow.	0	0			N/A			

Table 6

Vegetation Condition Assessment

Planted Acreage¹

20

Vegetation Category	Definitions	Mapping Threshold	CCPV Depiction	Number of Polygons	Combined Acreage	% of Planted Acreage
1. Bare Areas	Very limited cover of both woody and herbaceous material.	0.1 acres		1	0.05	0.3%
2. Low Stem Density Areas	Woody stem densities clearly below target levels based on MY3, 4, or 5 stem count criteria.	0.1 acres		0	0.00	0.0%
Total				1	0.05	0.3%
3. Areas of Poor Growth Rates or Vigor	Areas with woody stems of a size class that are obviously small given the monitoring year.	0.25 acres		0	0.00	0.0%
Cumulative Total				1	0.05	0.3%

Easement Acreage²

37.6

Vegetation Category	Definitions	Mapping Threshold	CCPV Depiction	Number of Polygons	Combined Acreage	% of Easement Acreage
4. Invasive Areas of Concern ⁴	Areas or points (if too small to render as polygons at map scale).	1000 SF		2	0.60	1.6%
5. Easement Encroachment Areas ³	Areas or points (if too small to render as polygons at map scale).	none		0	0.00	0.0%

¹ = Enter the planted acreage within the easement. This number is calculated as the easement acreage minus any existing mature tree stands that were not subject to supplemental planting of the understory, the channel acreage, crossings or any other elements not directly planted as part of the project effort.

² = The acreage within the easement boundaries.

³ = Encroachment may occur within or outside of planted areas and will therefore be calculated against the overall easement acreage. In the event a polygon is cataloged into items 1, 2 or 3 in the table and is the result of encroachment, the associated acreage should be tallied in the relevant item (i.e., item 1,2 or 3) as well as a parallel tally in item 5.

⁴ = Invasives may occur in or out of planted areas, but still within the easement and will therefore be calculated against the overall easement acreage. Invasives of concern/interest are listed below. The list of high concern species are those with the potential to directly outcompete native, young, woody stems in the short-term (e.g. monitoring period or shortly thereafter) or affect the community structure for existing, more established tree/shrub stands over timeframes that are slightly longer (e.g. 1-2 decades). The low/moderate concern group are those species that generally do not have this capacity over the timeframes discussed and therefore are not expected to be mapped with regularity, but can be mapped, if in the judgement of the observer their coverage, density or distribution is suppressing the viability, density, or growth of planted woody stems. Decisions as to whether remediation will be needed are based on the integration of risk factors by EEP such as species present, their coverage, distribution relative to native biomass, and the practicality of treatment. For example, even modest amounts of Kudzu or Japanese Knotweed early in the projects history will warrant control, but potentially large coverages of Microstegium in the herb layer will not likely trigger control because of the limited capacities to impact tree/shrub layers within the timeframes discussed and the potential impacts of treating extensive amounts of ground cover. Those species with the "watch list" designator in gray shade are of interest as well, but have yet to be observed across the state with any frequency. Those in *red italics* are of particular interest given their extreme risk/threat level for mapping as points where *isolated* specimens are found, particularly early in a projects monitoring history. However, areas of discrete, dense patches will of course be mapped as polygons. The symbology scheme below was one that was found to be helpful for symbolizing invasives polygons, particularly for situations where the condition for an area is somewhere between isolated specimens and dense, discrete patches. In any case, the point or polygon/area feature can be symbolized to describe things like high or low concern and species can be listed as a map inset, in legend items if the number of species are limited or in the narrative section of the executive summary.

Table 7. Stream Problem Areas			
Cedar Creek Stream and Wetland Restoration Project - Project # 95718			
Feature Issue	Station # / Range	Suspected Cause; Repair	Photo Number
Debris Jam/Fallen Tree	UT2 @ 0+50 to 1+00	Fallen tree is blocking flow within the stream channel and causing piping and overland flow; removal of tree is recommended.	SPA1
Log Ramp Structure	UT2 @ 9+28	Log ramp structure is dislodged and is unfunctional. Structure repair is recommended.	SPA2
Bank Erosion	UT1 @ 27+50 to 28+75	Localized bank erosion on left and right banks. Recommended minimal earthwork, re-matting and livestaking.	SPA3

Table 8. Vegetation Problem Areas			
Cedar Creek Stream and Wetland Restoration Project - Project # 95718			
Feature Category	Station Numbers	Suspected Cause; Repair	Photo Number
VPA1	UT1 @ 1+50 to 3+75	Invasives: Chinese Privet common along left and right stream banks. Recommend treatment.	VPA1
VPA2	UT2 @ 4+00 to 4+66	Bare Area: Sparse vegetation and ground cover. Recommend reseeding and mulching.	VPA2

Appendix B.
Cedar Creek Stream/Wetland Photos- MY2



UT1 - STA 35+25 - Looking Upstream
(7/13/2016)



UT1 - STA 25+50 - Looking Upstream
(10/31/2016)



UT2 - STA 6+00 - Looking Upstream
(10/31/2016)



UT2 - STA 6+00 - Looking Downstream
(10/31/2016)



UT3 - STA 1+50 - Looking Downstream
(10/31/2016)



UT3- STA 8+25 - Looking Upstream
(10/31/2016)



Wetland Restoration Area 1 and UT3 (5/18/2016)



Wetland Hydrology Gauge AW6 (7/13/2016)



Crest Gauge 1- UT3 (10/31/2016)



Crest Gauge 2 - UT2C (10/31/2016)



Crest Gauge 3 - UT2 (10/31/2016)



UT4 Looking Upstream - (10/31/2016)



Bank Pin Array at Cross Section 6 (7/13/2016)



Bank Pin Array at Cross Section 10 (7/13/2016)



Bank Pin Array at Cross Section 12 (7/12/2016)



Bank Pin Array at Cross Section 13 (7/12/2016)



Bank Pin Array at Cross Section 16 (7/13/2016)



Bank Pin Array at Cross Section 17 (7/13/2016)



Bank Pin Array at Cross Section 24 (7/12/2016)



Bank Pin Array at Cross Section 25 (7/12/2016)

Appendix B.
Cedar Creek MY2 Vegetation Plot Photos



Vegetation Plot 1 (7/12/2016)



Vegetation Plot 2 (7/12/2016)



Vegetation Plot 3 (7/12/2016)



Vegetation Plot 4 (7/12/2016)



Vegetation Plot 5 (7/12/2016)



Vegetation Plot 6 (7/12/2016)

Cedar Creek MY2 Vegetation Plot Photos



Vegetation Plot 7 (7/12/2016)



Vegetation Plot 8 (7/12/2016)



Vegetation Plot 9 (7/12/2016)



Vegetation Plot 10 (7/12/2016)



Vegetation Plot 11 (7/12/2016)



Vegetation Plot 12 (7/12/2016)

Cedar Creek MY2 Vegetation Plot Photos



Vegetation Plot 13 (7/12/2016)



Vegetation Plot 14 (7/12/2016)



Vegetation Plot 15 (7/12/2016)



Vegetation Plot 16 (7/12/2016)



Vegetation Plot 17 (7/12/2016)



Vegetation Plot 18 (7/12/2016)

Cedar Creek MY2 Vegetation Plot Photos



Vegetation Plot 19 (7/12/2016)



Vegetation Plot 20 (7/12/2016)

Appendix B - Stream Problem Area Photos



SPA1- Debris Jam/Fallen Tree- UT2 @ Sta. 0+50 to 1+00



SPA2-Unfunctional Log Ramp Structure - UT2 @ Sta. 9+28



SPA3- Bank Erosion on left and right banks- UT1 @ Sta. 27+50 to 28+75

Appendix B - Vegetation Problem Area Photos



VPA1- Invasive Species (Chinese Privet) - UT1 @
Sta. 1+50 to 3+75



VPA2- Sparse Vegetation - UT2 @ Sta 4+00 to
4+66

Appendix C

Vegetation Plot Data

Table 9a. Planted Stem Count Summary

Table 9b. Planted Species Totals

Table 9c. Planted and Total Stem Counts (Species by Plot)

Appendix C.
Cedar Creek MY2 Vegetation Tables

Table 9a. Vegetation Plot Criteria Attainment Cedar Creek Stream and Wetland Restoration Site		
Vegetation Plot ID	Vegetation Survival Threshold Met?	Tract Mean
1	Yes	100%
2	Yes	
3	Yes	
4	Yes	
5	Yes	
6	Yes	
7	Yes	
8	Yes	
9	Yes	
10	Yes	
11	Yes	
12	Yes	
13	Yes	
14	Yes	
15	Yes	
16	Yes	
17	Yes	
18	Yes	
19	Yes	
20	Yes	

Table 9b. CVS Vegetation Plot Metadata Cedar Creek Stream and Wetland Restoration Site	
Report Prepared By	Brian Hockett
Date Prepared	11/22/2016 11:26
database name	Cedar_Creek_MY2_2016.mdb
database location	C:\Users\bhockett\Dropbox (RES)\@RES Projects\North Carolina\Cedar Creek\Monitoring\Monitoring Data\MY2\Vegetation Data
computer name	RES_BHOCKETT
file size	76546048
DESCRIPTION OF WORKSHEETS IN THIS DOCUMENT	
Metadata	Description of database file, the report worksheets, and a summary of project(s) and project data.
Proj, planted	Each project is listed with its PLANTED stems per acre, for each year. This excludes live stakes.
Proj, total stems	Each project is listed with its TOTAL stems per acre, for each year. This includes live stakes, all planted stems, and all natural/volunteer stems.
Plots	List of plots surveyed with location and summary data (live stems, dead stems, missing, etc.).
Vigor	Frequency distribution of vigor classes for stems for all plots.
Vigor by Spp	Frequency distribution of vigor classes listed by species.
Damage	List of most frequent damage classes with number of occurrences and percent of total stems impacted by each.
Damage by Spp	Damage values tallied by type for each species.
Damage by Plot	Damage values tallied by type for each plot.
Planted Stems by Plot and Spp	A matrix of the count of PLANTED living stems of each species for each plot; dead and missing stems are excluded.
ALL Stems by Plot and spp	A matrix of the count of total living stems of each species (planted and natural volunteers combined) for each plot; dead and missing stems are excluded.
PROJECT SUMMARY	
Project Code	95718
project Name	Cedar Creek Restoration Site
Description	
River Basin	Cape Fear
length(ft)	
stream-to-edge width (ft)	
area (sq m)	
Required Plots (calculated)	
Sampled Plots	20

Appendix D

Stream Geomorphology Data

Table 10. Morphological Parameters Summary Data

Table 11. Dimensional Morphology Summary – Cross Sections Data

Table 12. Bank Pin Array Summary Data

Cross Section Plots

Table 10. Cedar Creek Morphological Parameters

Feature	Reference Reach			Existing ¹								Design				As-Built							
	Pool	Run	Shallow	UT1 (Upper)		UT1 (Lower)		UT2 Reach A		UT3 Reach A (Upper)	UT3 Reach A (Lower)		UT4	UT2		UT3		UT2		UT3			
	Shallow	Pool	Shallow	Pool	Shallow	Pool	Shallow	Run	Run	Shallow	Run	Shallow	Run	Shallow	Pool	Shallow	Pool	Shallow	Pool	Shallow	Pool		
Drainage Area (ac)	81			2514		2780		34		116		150		79		41		146		41		146	
Drainage Area (mi ²)	0.13			3.93		4.34		0.05		0.18		0.23		0.12		0.06		0.23		0.06		0.23	
NC Regional Curve Discharge (cfs) ²	---	---	3.7	44.3		47.7		2.0		4.8		5.8		3.7		2.3		5.7		2.3		5.7	
NC Regional Curve Discharge (cfs) ³	---	---	1.8	24.9		26.8		0.9		2.4		2.9		1.8		1.1		2.9		1.1		2.9	
Design/Calculated Discharge (cfs)	---	---	5	---		---		---		---		---		4.0		6.0		4.0		6.0			
Dimension																							
BF Width (ft)	6.3	14.0	6.2	18.2	14.1	11.0	10.9	4.8	5.2	4.0	10.4	7.7	6.2	4.6	5.4	6.0	7.0	7.5	7.1	7.9	7.2		
Floodprone Width (ft)	100.0	100.0	100.0	100	100	100	100	100	100	100	100	100	100	>50	>50	>50	>50	>50	>50	>50	>50		
BF Cross Sectional Area (ft ²)	4.0	5.9	2.9	42.1	46.4	32.2	29.2	2.4	3.0	3.4	5.5	4.8	5.6	2.2	3.1	3.6	4.8	2.9	2.9	4.1	4.2		
BF Mean Depth (ft)	0.6	0.4	0.5	2.3	3.3	2.9	2.7	0.5	0.6	0.9	0.5	0.6	0.9	0.5	0.6	0.6	0.7	0.4	0.4	0.5	0.6		
BF Max Depth (ft)	1.0	0.5	0.8	3.2	4.4	3.7	3.3	0.7	0.9	1.0	0.8	1.1	1.3	0.7	1.0	0.8	1.2	0.9	0.9	1.0	1.2		
Width/Depth Ratio	10.2	33.3	13.4	7.9	4.3	3.8	4.1	9.6	10.5	4.7	19.7	12.2	6.9	10.2	9.4	10.2	10.1	20.1	18.1	15.6	13.2		
Entrenchment Ratio	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	1.2	1.3	1.6	2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2	>2.2		
Wetted Perimeter (ft)	7.1	14.2	6.7	20.4	18.8	15.8	16.2	5.2	5.9	5.8	10.7	8.2	7.1	4.9	5.9	6.4	7.6	7.7	7.5	8.3	7.7		
Hydraulic Radius (ft)	0.6	0.4	0.4	2.1	2.5	2.0	1.8	0.5	0.5	0.6	0.5	0.6	0.8	0.4	0.5	0.6	0.6	0.4	0.4	0.5	0.5		
Substrate																							
	Medium/Coarse Sand			Medium/Coarse Sand								Medium/Coarse Sand				Medium/Coarse Sand							
Pattern																							
	Min	Max	Med	---	---	---	---	---	---	---	---	---	---	Min	Max	Min	Max	Min	Max	Min	Max		
Channel Beltwidth (ft)	13.0	19.3	13.9	---	---	---	---	---	---	---	---	---	---	10.5	15.7	12.6	18.8	10.3	23.9	14.3	23.3		
Radius of Curvature (ft)	5.2	11.7	9.9	---	---	---	---	---	---	---	---	---	---	4.2	9.4	5.1	11.3	8.6	22.0	6.4	20.8		
Radius of Curvature Ratio	0.7	1.6	1.3	---	---	---	---	---	---	---	---	---	---	1.0	3.0	1.0	3.0	1.1	2.9	0.8	2.6		
Meander Wavelength (ft)	13.3	22.5	21.1	---	---	---	---	---	---	---	---	---	---	4.6	13.8	6.0	18.0	5.0	18.3	6.5	19.5		
Meander Width Ratio	2.1	3.1	2.2	---	---	---	---	---	---	---	---	---	---	2.1	3.1	2.1	3.1	1.4	3.2	1.8	2.9		
Profile																							
Shallow Length (ft)	2.0	30.9	10.9	---	---	---	---	---	---	---	---	---	---	1.6	24.5	1.9	29.4	2.5	26.2	2.3	33.2		
Run Length (ft)	1.0	20.1	6.9	---	---	---	---	---	---	---	---	---	---	0.8	15.9	0.9	19.1	2.1	18.5	2.3	23.2		
Pool Length (ft)	2.6	12.1	5.8	---	---	---	---	---	---	---	---	---	---	2.1	9.6	2.5	11.5	3.2	10.2	3.7	12.2		
Pool -to-Pool Spacing (ft)	10.1	61.0	28.6	---	---	---	---	---	---	---	---	---	---	8.0	48.3	9.6	57.9	12.5	55.6	10.1	60.7		
Additional Reach Parameters																							
Valley Length (ft)	164			3376		1515		255		486		731		78		643		1600		643		1600	
Channel Length (ft)	203			3694		1574		275		496		739		78		724		1912		740		1941	
Sinuosity	1.24			1.09		1.04		1.08		1.02		1.01		1.00		1.13		1.20		1.15		1.21	
Water Surface Slope (ft/ft)	0.009			---		---		---		---		---		---		---		---		---		---	
Channel Slope (ft/ft)	0.009			0.0022		0.0016		0.012		0.0164		0.007		0.010		0.0170		0.0095		0.0202		0.0130	
Rosgen Classification	E/C5			E5		E5		E5		E5		E5		E5		E5		E5		E5		E5	

¹ Bankfull stage was estimated using NC Regional Curve equations and existing conditions data

² NC Regional Curve equations source: Doll et al. (2003)

³ NC Regional Curve equations source: Sweet and Geratz (2003)

Appendix D. Table 11. - Monitoring Data - Dimensional Morphology Summary (Dimensional Parameters – Cross Sections)

Project Name/Number: Cedar Creek Site/ NCDMS Project # 95718

	Cross Section 1 (Run)							Cross Section 2 (Run)							Cross Section 3 (Riffle)							Cross Section 4 (Run)							Cross Section 5 (Riffle)						
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	89.8	89.8	89.8					89.2	89.2	89.2					88.1	88.1	88.1					85.8	85.8	85.8					106.1	106.1	106.1				
Bankfull Width (ft)	19.0	18.5	19.0					14.3	14.2	14.4					23.8	26.1	23.5					14.4	14.5	15.0					6.9	6.3	6.9				
Floodprone Width (ft)	50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0				
Bankfull Mean Depth (ft)	2.2	2.1	2.3					2.7	2.8	3.0					1.9	1.7	2.0					1.7	1.8	2.0					0.5	0.5	0.5				
Bankfull Max Depth (ft)	3.8	3.8	4.0					3.9	4.1	4.0					3.3	3.1	3.6					2.5	2.6	2.8					1.0	0.8	0.9				
Bankfull Cross Sectional Area (ft ²)	41.6	38.9	43.6					38.0	40.1	43.1					45.5	43.7	46.8					24.7	26.3	29.8					3.7	3.2	3.2				
Bankfull Width/Depth Ratio	8.6	8.8	8.2					5.4	5.1	4.8					12.4	15.6	11.8					8.4	8.0	7.5					12.8	12.2	14.5				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					2.1	1.9	2.1					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0				
	Cross Section 6 (Pool)							Cross Section 7 (Riffle)							Cross Section 8 (Pool)							Cross Section 9 (Riffle)							Cross Section 10 (Pool)						
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	105.3	105.3	105.3					103.5	103.5	103.5					103.5	103.5	103.5					97.9	97.9	97.9					97.4	97.4	97.4				
Bankfull Width (ft)	5.9	4.6	5.3					7.3	6.5	7.7					7.1	8.1	7.6					7.5	5.7	6.6					5.7	5.3	4.9				
Floodprone Width (ft)	50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.4	0.4					0.6	0.6	0.6					0.7	0.6	0.7					0.5	0.4	0.5					0.6	0.5	0.7				
Bankfull Max Depth (ft)	0.7	0.6	0.9					1.1	1.0	1.0					1.2	1.4	1.5					1.0	0.8	0.9					1.1	1.0	1.0				
Bankfull Cross Sectional Area (ft ²)	2.1	1.6	2.0					4.5	3.9	4.6					5.0	5.1	5.6					4.0	2.4	3.0					3.5	2.4	3.3				
Bankfull Width/Depth Ratio	16.0	12.8	13.7					11.8	10.9	12.9					9.9	13.0	10.3					14.2	13.5	14.4					9.1	11.7	7.2				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0				
	Cross Section 11 (Riffle)							Cross Section 12 (Pool)							Cross Section 13 (Pool)							Cross Section 14 (Riffle)							Cross Section 15 (Riffle)						
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	93.5	93.5	93.5					93.1	93.1	93.1					90.9	90.9	90.9					90.9	90.9	90.9					89.0	89.0	89.0				
Bankfull Width (ft)	10.4	6.9	9.3					8.1	6.6	6.5					9.3	5.4	7.0					9.6	6.2	6.4					6.8	6.4	6.9				
Floodprone Width (ft)	50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.6	0.4					0.8	0.7	0.8					0.4	0.2	0.4					0.4	0.5	0.4					0.6	0.5	0.6				
Bankfull Max Depth (ft)	1.1	0.9	1.0					1.8	1.7	1.8					0.9	0.4	0.8					1.0	1.0	0.8					1.0	1.1	1.3				
Bankfull Cross Sectional Area (ft ²)	4.8	4.2	3.6					6.6	4.7	5.1					3.9	1.2	2.6					3.7	2.9	2.7					4.3	3.5	4.1				
Bankfull Width/Depth Ratio	22.2	11.1	24.0					10.0	9.3	8.3					22.2	23.2	19.0					25.0	13.4	15.2					10.8	11.9	11.7				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0				
	Cross Section 16 (Pool)							Cross Section 17 (Pool)							Cross Section 18 (Riffle)							Cross Section 19 (Run)							Cross Section 20 (Run)						
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	88.8	88.8	88.8					87.4	87.4	87.4					87.1	87.1	87.1					108.8	108.8	108.8					105.4	105.4	105.4				
Bankfull Width (ft)	7.1	7.1	8.5					7.1	7.2	7.1					7.0	6.9	7.7					7.5	6.3	6.8					8.8	5.9	5.9				
Floodprone Width (ft)	50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.5	0.5					0.6	0.6	0.6					0.6	0.5	0.5					0.4	0.3	0.3					0.3	0.4	0.3				
Bankfull Max Depth (ft)	1.1	1.0	1.1					1.3	1.3	1.4					1.1	1.0	1.0					0.8	0.6	0.5					0.6	0.7	0.6				
Bankfull Cross Sectional Area (ft ²)	3.8	3.5	3.8					4.2	4.0	4.2					4.0	3.5	3.7					2.9	2.1	2.0					2.7	2.2	2.0				
Bankfull Width/Depth Ratio	13.1	14.4	18.8					12.0	13.0	12.0					12.3	13.7	16.0					19.6	19.4	23.4					29.1	15.7	17.4				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0				

¹ = Widths and depths for annual measurements will be based on the baseline bankfull datum regardless of dimensional/depositional development. Input the elevation used as the datum, which should be consistent and based on the baseline datum established. If the performer has inherited the project and cannot acquire the datum used for prior years this must be discussed with EEP. If this cannot be resolved in time for a given years report submission a footnote in this should be included that states: "It is uncertain if the monitoring datum has been consistent over the monitoring history, which may influence calculated values. Additional data from a prior performer is being acquired to provide confirmation. Values will be recalculated in a future submission based on a consistent datum if determined to be necessary."

Appendix D. Table 11. - Monitoring Data - Dimensional Morphology Summary (Dimensional Parameters – Cross Sections)

Project Name/Number: Cedar Creek Site/ NCDMS Project # 95718

	Cross Section 21 (Pool)							Cross Section 22 (Riffle)							Cross Section 23 (Riffle)							Cross Section 24 (Pool)							Cross Section 25 (Pool)								
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+		
Record elevation (datum) used	101.8	101.8	101.8					101.3	101.3	101.3					95.6	95.6	95.6					95.4	95.4	95.4					91.5	91.5	91.5						
Bankfull Width (ft)	8.9	11.1	10.0					6.0	5.9	6.7					8.3	8.7	7.0					5.9	5.7	6.4					6.6	6.6	6.8						
Floodprone Width (ft)	50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0					50.0	50.0	50.0						
Bankfull Mean Depth (ft)	0.3	0.4	0.3					0.5	0.6	0.4					0.4	0.3	0.5					0.5	0.4	0.5					0.4	0.4	0.4						
Bankfull Max Depth (ft)	0.9	0.9	0.7					0.9	1.0	0.8					1.3	1.0	1.4					1.1	1.0	1.1					0.8	8.0	0.8						
Bankfull Cross Sectional Area (ft ²)	3.1	4.0	3.3					3.1	3.3	2.7					3.1	2.9	3.3					3.0	2.2	2.9					2.6	2.9	2.5						
Bankfull Width/Depth Ratio	25.6	30.8	30.6					11.6	10.7	16.8					21.9	26.1	15.0					11.8	14.7	14.1					17.0	15.3	18.8						
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2					>2.2	>2.2	>2.2						
Bankfull Bank Height Ratio	1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0					1.0	1.0	1.0						
	Cross Section 26 (Riffle)							Cross Section 27 (Run)																													
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+		
Record elevation (datum) used	91.3	91.3	91.3					105.3	105.3	105.3																											
Bankfull Width (ft)	6.8	8.2	6.0					6.4	5.7	5.7																											
Floodprone Width (ft)	50.0	50.0	50.0					50.0	50.0	50.0																											
Bankfull Mean Depth (ft)	0.4	0.3	0.3					0.4	0.4	0.4																											
Bankfull Max Depth (ft)	0.7	0.7	0.6					0.9	0.8	0.8																											
Bankfull Cross Sectional Area (ft ²)	2.5	2.4	1.9					2.8	2.1	2.1																											
Bankfull Width/Depth Ratio	18.1	27.3	18.9					14.8	15.2	15.5																											
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2					>2.2	>2.2	>2.2																											
Bankfull Bank Height Ratio	1.0	1.0	1.0					1.0	1.0	1.0																											
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+		
Record elevation (datum) used																																					
Bankfull Width (ft)																																					
Floodprone Width (ft)																																					
Bankfull Mean Depth (ft)																																					
Bankfull Max Depth (ft)																																					
Bankfull Cross Sectional Area (ft ²)																																					
Bankfull Width/Depth Ratio																																					
Bankfull Entrenchment Ratio																																					
Bankfull Bank Height Ratio																																					
Based on fixed baseline bankfull elevation ¹	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+	Base	MY1	MY2	MY3	MY5	MY7	MY+		
Record elevation (datum) used																																					
Bankfull Width (ft)																																					
Floodprone Width (ft)																																					
Bankfull Mean Depth (ft)																																					
Bankfull Max Depth (ft)																																					
Bankfull Cross Sectional Area (ft ²)																																					
Bankfull Width/Depth Ratio																																					
Bankfull Entrenchment Ratio																																					
Bankfull Bank Height Ratio																																					

¹ = Widths and depths for annual measurements will be based on the baseline bankfull datum regardless of dimensional/depositional development. Input the elevation used as the datum, which should be consistent and based on the baseline datum established. If the performer has inherited the project and cannot acquire the datum used for prior years this must be discussed with EEP. If this cannot be resolved in time for a given years report submission a footnote in this should be included that states: "It is uncertain if the monitoring datum has been consistent over the monitoring history, which may influence calculated values. Additional data from a prior performer is being acquired to provide confirmation. Values will be recalculated in a future submission based on a consistent datum if determined to be necessary."

Table 12.Cedar Creek Bank Pin Array Summary

Cross Section	Location	Position	Year 1 Reading	Year 2 Reading
XS 6 @ Sta. 3+25 Reach UT3	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 10 @ Sta. 8+80 Reach UT3	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 12 @ Sta. 12+90 Reach UT3	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 13 @ Sta. 14+50 Reach UT3	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 16 @ Sta. 16+95 Reach UT3	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 17 @ Sta. 18+50 Reach UT3	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 24 @ Sta. 6+60 Reach UT2	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0
XS 25 @ Sta. 8+25 Reach UT2	US	Top	0.0	0.0
		Bottom	0.0	0.0
	DS	Top	0.0	0.0
		Bottom	0.0	0.0

Notes:

US - Upstream from cross section


DS - Downstream from cross section



Upstream



Downstream

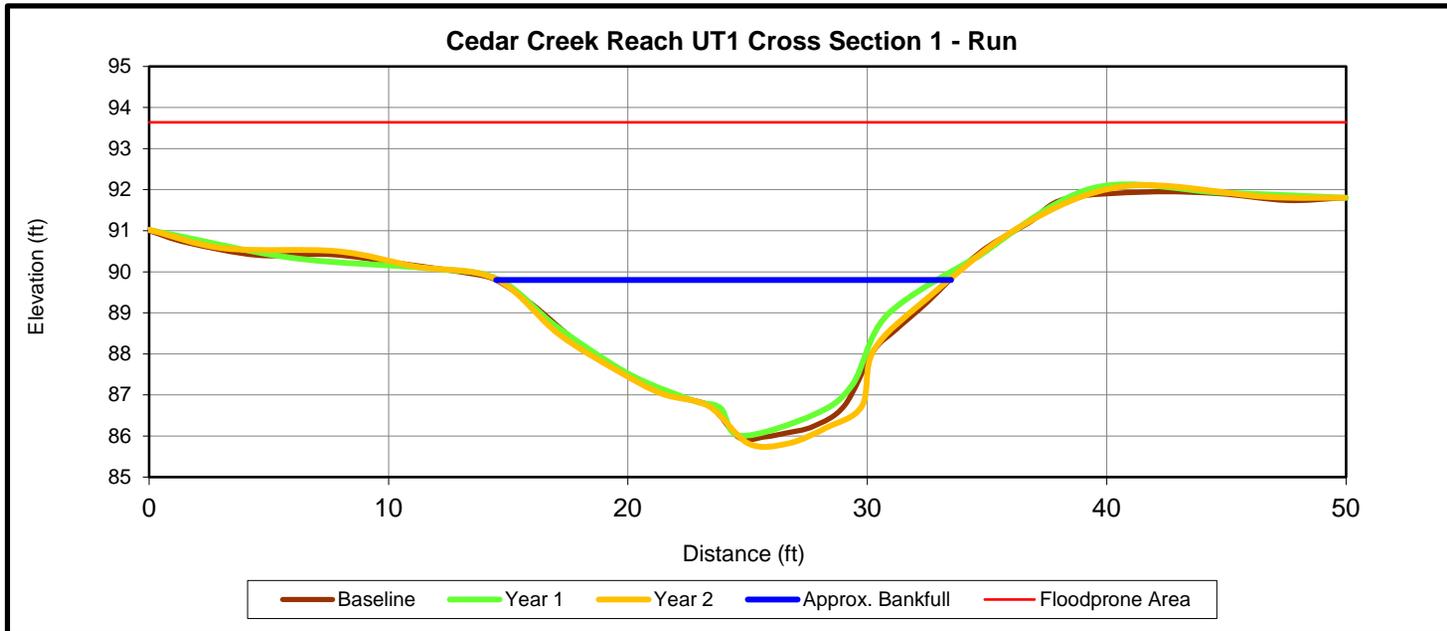


Based on fixed baseline bankfull elevation	Cross Section 1 (Run)						
	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	89.8	89.8	89.8				
Bankfull Width (ft)	19.0	18.5	19.0				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	2.2	2.1	2.3				
Bankfull Max Depth (ft)	3.8	3.8	4.0				
Bankfull Cross Sectional Area (ft ²)	41.6	38.9	43.6				
Bankfull Width/Depth Ratio	8.6	8.8	8.2				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

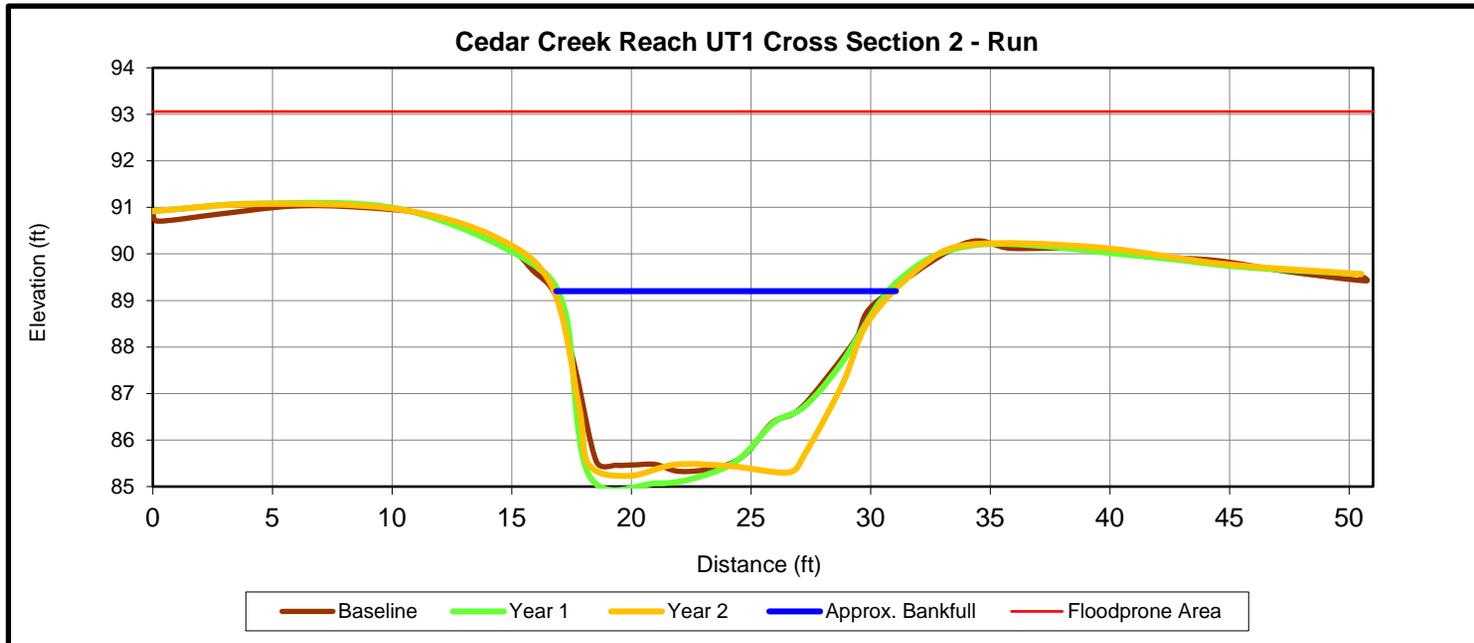


	Cross Section 2 (Run)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	89.2	89.2	89.2				
Bankfull Width (ft)	14.3	14.2	14.4				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	2.7	2.8	3.0				
Bankfull Max Depth (ft)	3.9	4.1	4.0				
Bankfull Cross Sectional Area (ft ²)	38.0	40.1	43.1				
Bankfull Width/Depth Ratio	5.4	5.1	4.8				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

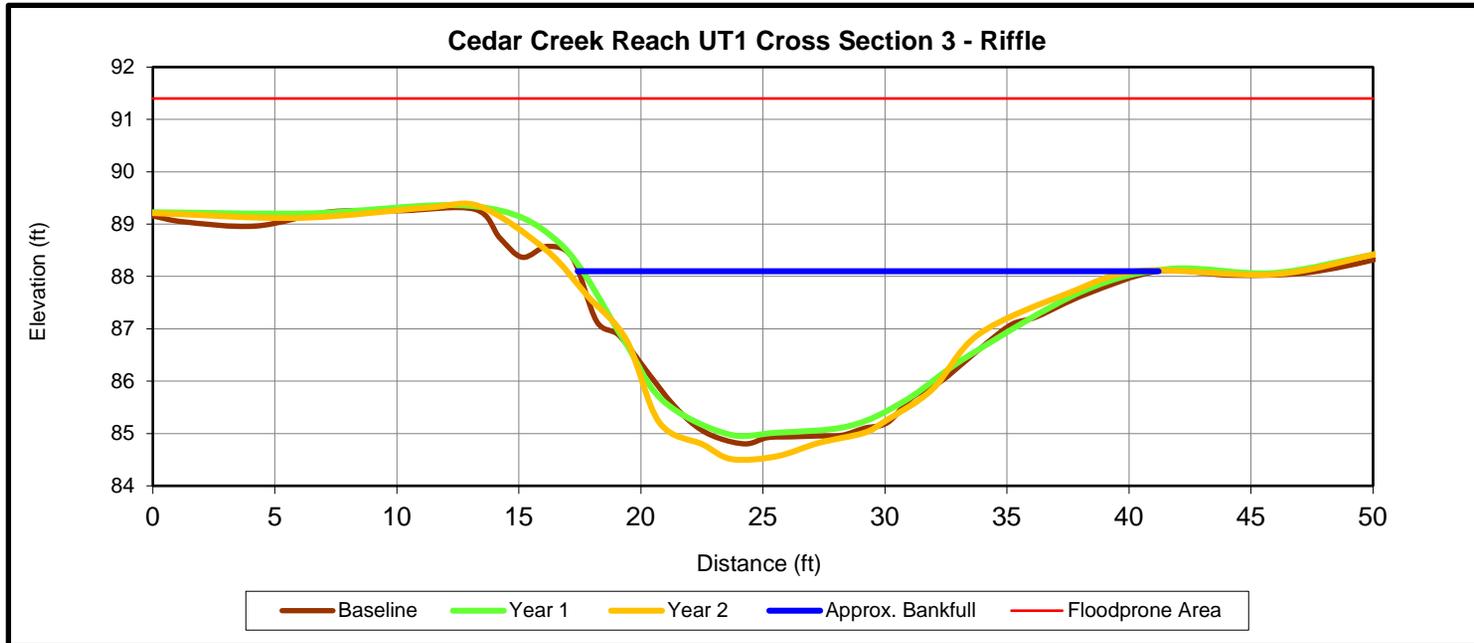


	Cross Section 3 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	88.1	88.1	88.1				
Bankfull Width (ft)	23.8	26.1	23.5				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	1.9	1.7	2.0				
Bankfull Max Depth (ft)	3.3	3.1	3.6				
Bankfull Cross Sectional Area (ft ²)	45.5	43.7	46.8				
Bankfull Width/Depth Ratio	12.4	15.6	11.8				
Bankfull Entrenchment Ratio	2.1	1.9	2.1				
Bankfull Bank Height Ratio	1.0	1.0	1.0				




Upstream



Downstream

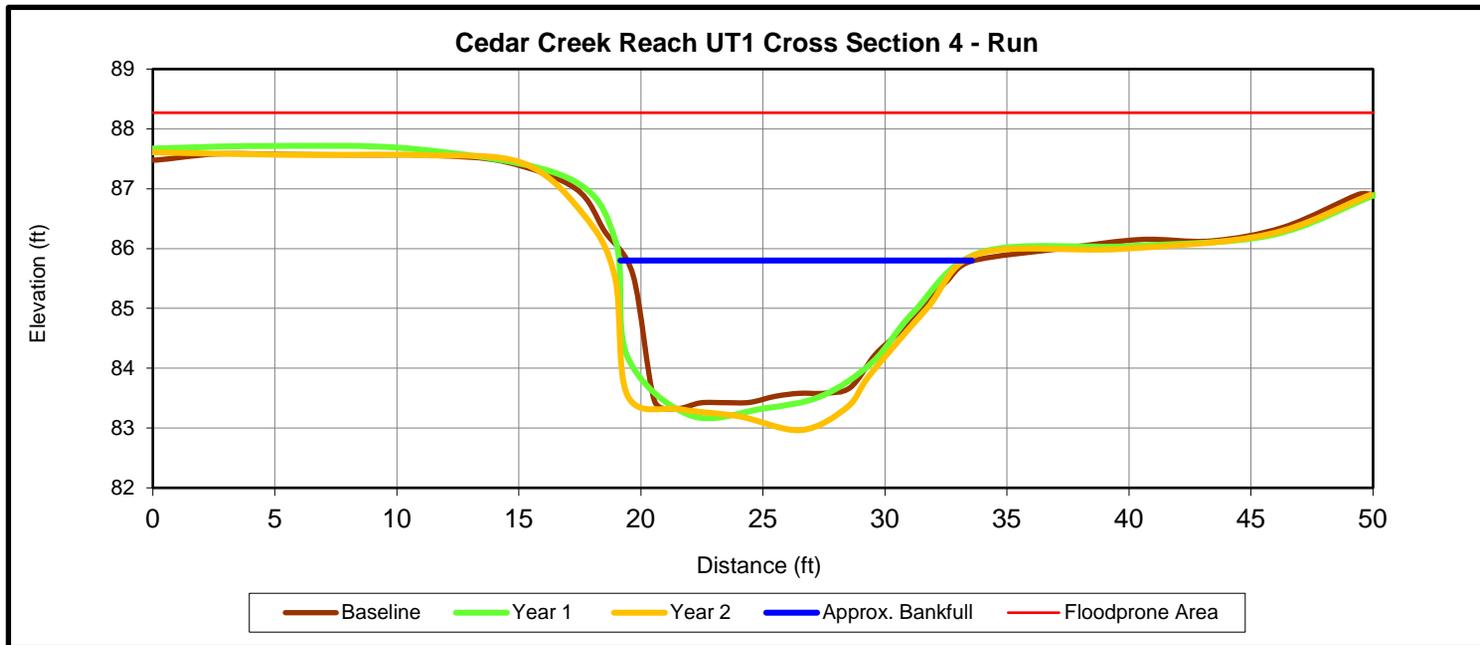


	Cross Section 4 (Run)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	85.8	85.8	85.8				
Bankfull Width (ft)	14.4	14.5	15.0				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	1.7	1.8	2.0				
Bankfull Max Depth (ft)	2.5	2.6	2.8				
Bankfull Cross Sectional Area (ft ²)	24.7	26.3	29.8				
Bankfull Width/Depth Ratio	8.4	8.0	7.5				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				

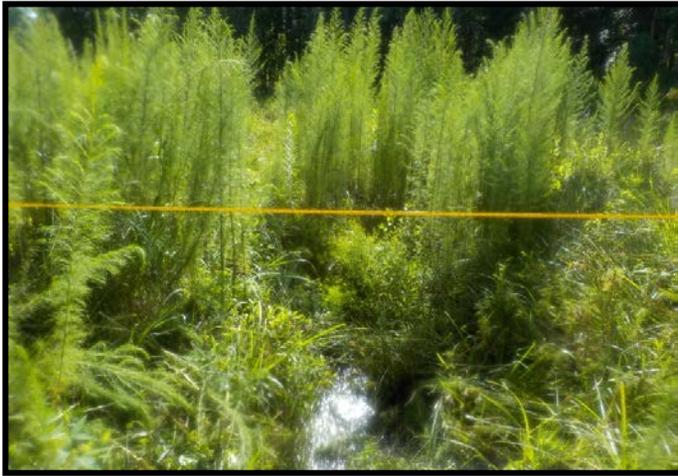

Upstream



Downstream

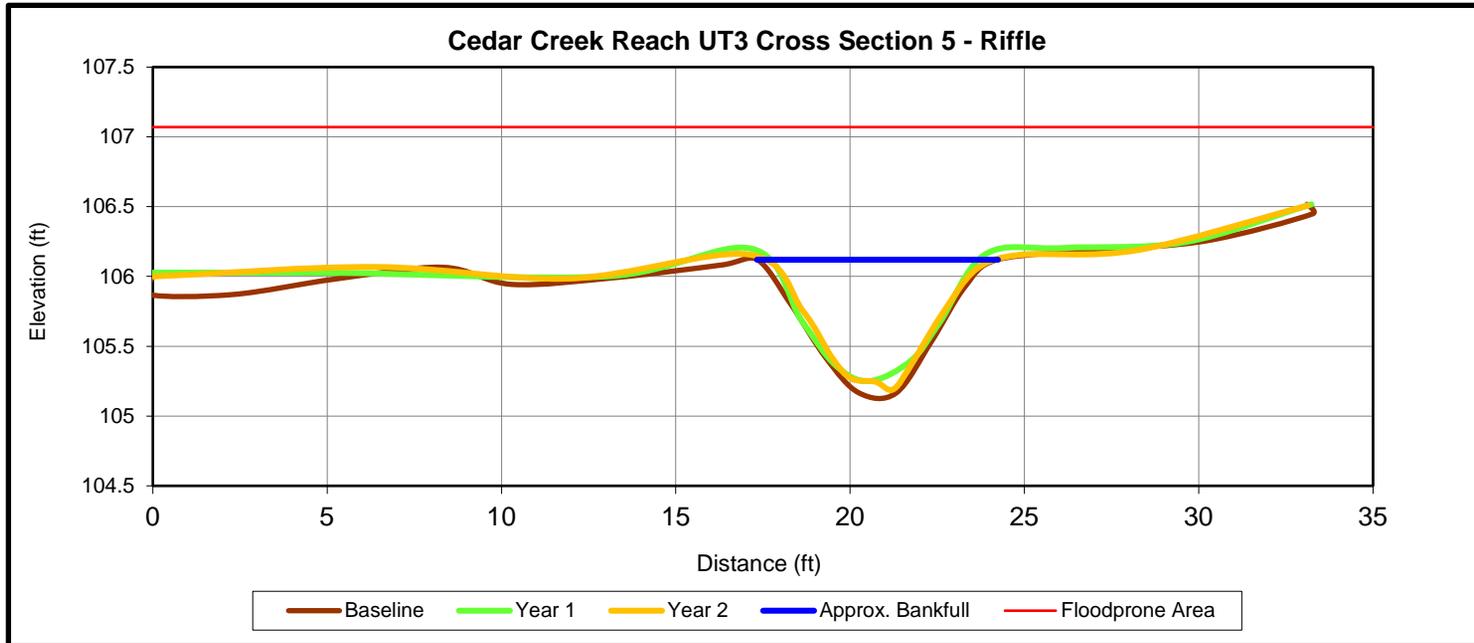


	Cross Section 5 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	106.1	106.1	106.1				
Bankfull Width (ft)	6.9	6.3	6.9				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.5	0.5				
Bankfull Max Depth (ft)	1.0	0.8	0.9				
Bankfull Cross Sectional Area (ft ²)	3.7	3.2	3.2				
Bankfull Width/Depth Ratio	12.8	12.2	14.5				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

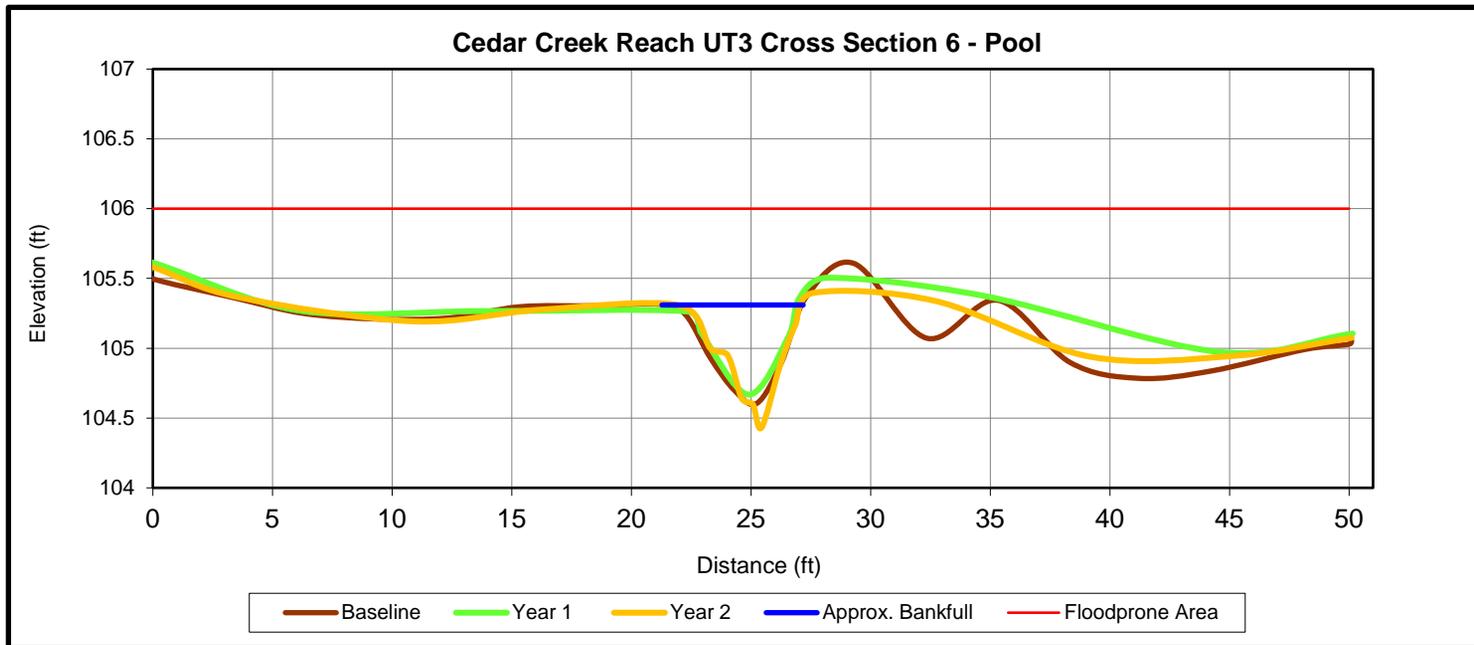


	Cross Section 6 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	105.3	105.3	105.3				
Bankfull Width (ft)	5.9	4.6	5.3				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.4	0.4				
Bankfull Max Depth (ft)	0.7	0.6	0.9				
Bankfull Cross Sectional Area (ft ²)	2.1	1.6	2.0				
Bankfull Width/Depth Ratio	16.0	12.8	13.7				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

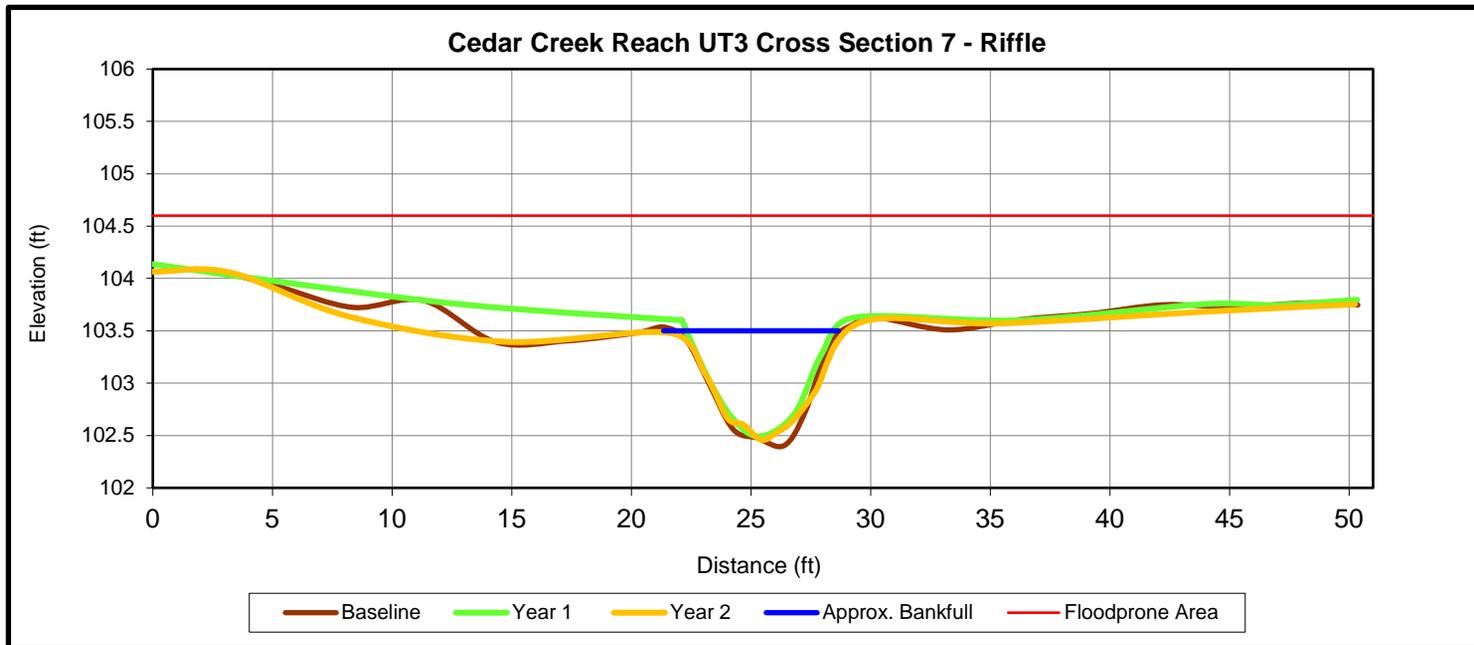


	Cross Section 7 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	103.5	103.5	103.5				
Bankfull Width (ft)	7.3	6.5	7.7				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.6	0.6	0.6				
Bankfull Max Depth (ft)	1.1	1.0	1.0				
Bankfull Cross Sectional Area (ft ²)	4.5	3.9	4.6				
Bankfull Width/Depth Ratio	11.8	10.9	12.9				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

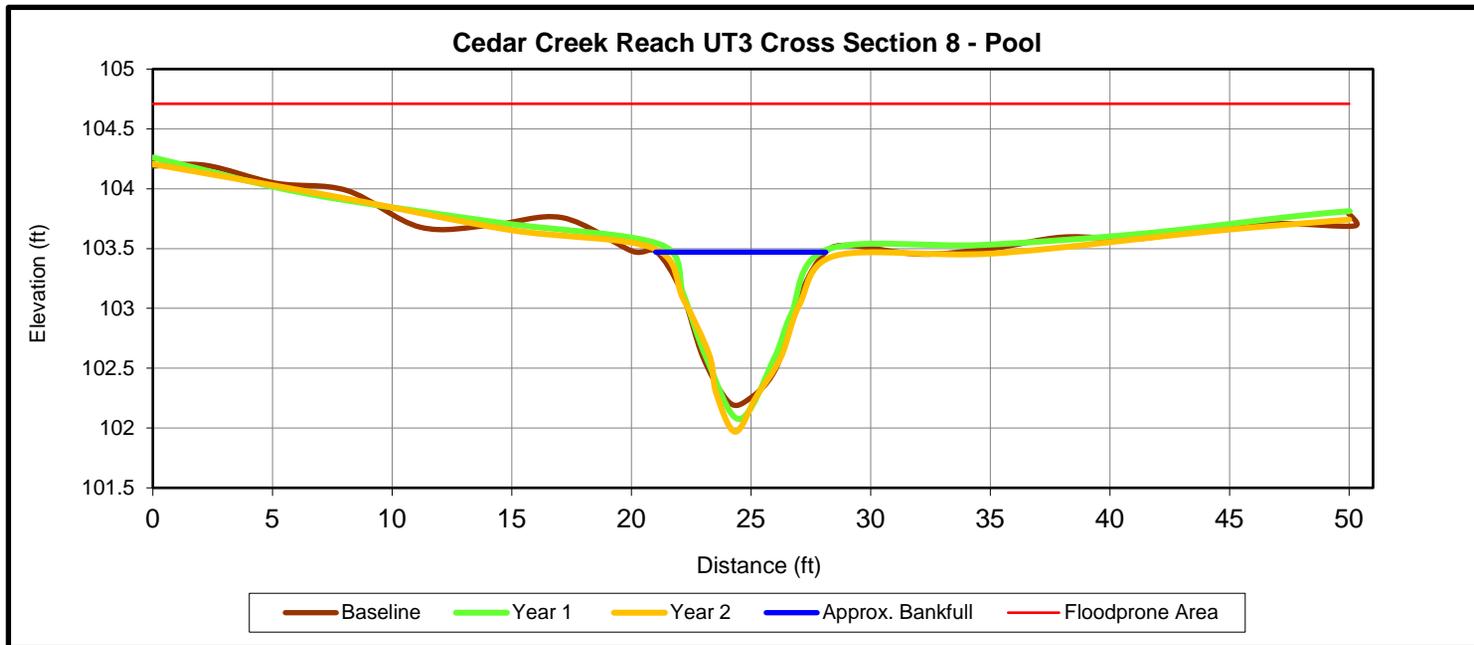


	Cross Section 8 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	103.5	103.5	103.5				
Bankfull Width (ft)	7.1	8.1	7.6				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.7	0.6	0.7				
Bankfull Max Depth (ft)	1.2	1.4	1.5				
Bankfull Cross Sectional Area (ft ²)	5.0	5.1	5.6				
Bankfull Width/Depth Ratio	9.9	13.0	10.3				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

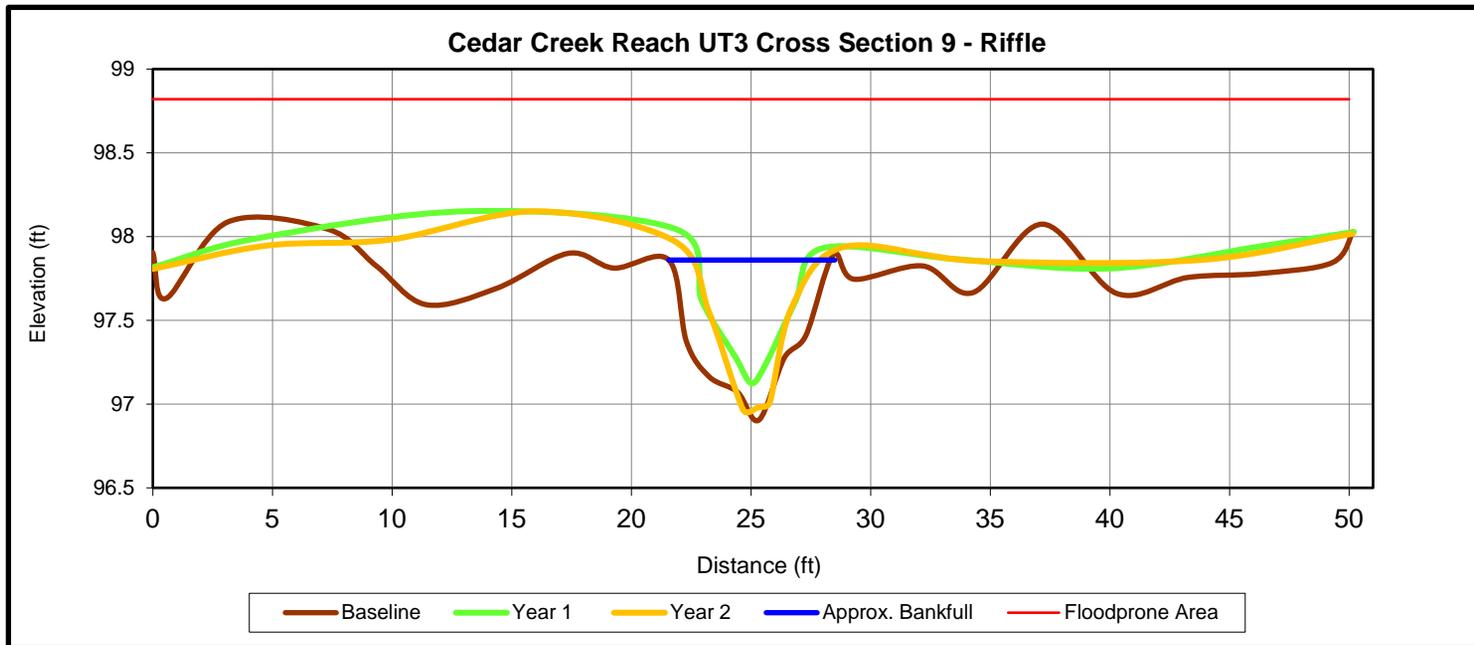


	Cross Section 9 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	97.9	97.9	97.9				
Bankfull Width (ft)	7.5	5.7	6.6				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.4	0.5				
Bankfull Max Depth (ft)	1.0	0.8	0.9				
Bankfull Cross Sectional Area (ft ²)	4.0	2.4	3.0				
Bankfull Width/Depth Ratio	14.2	13.5	14.4				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

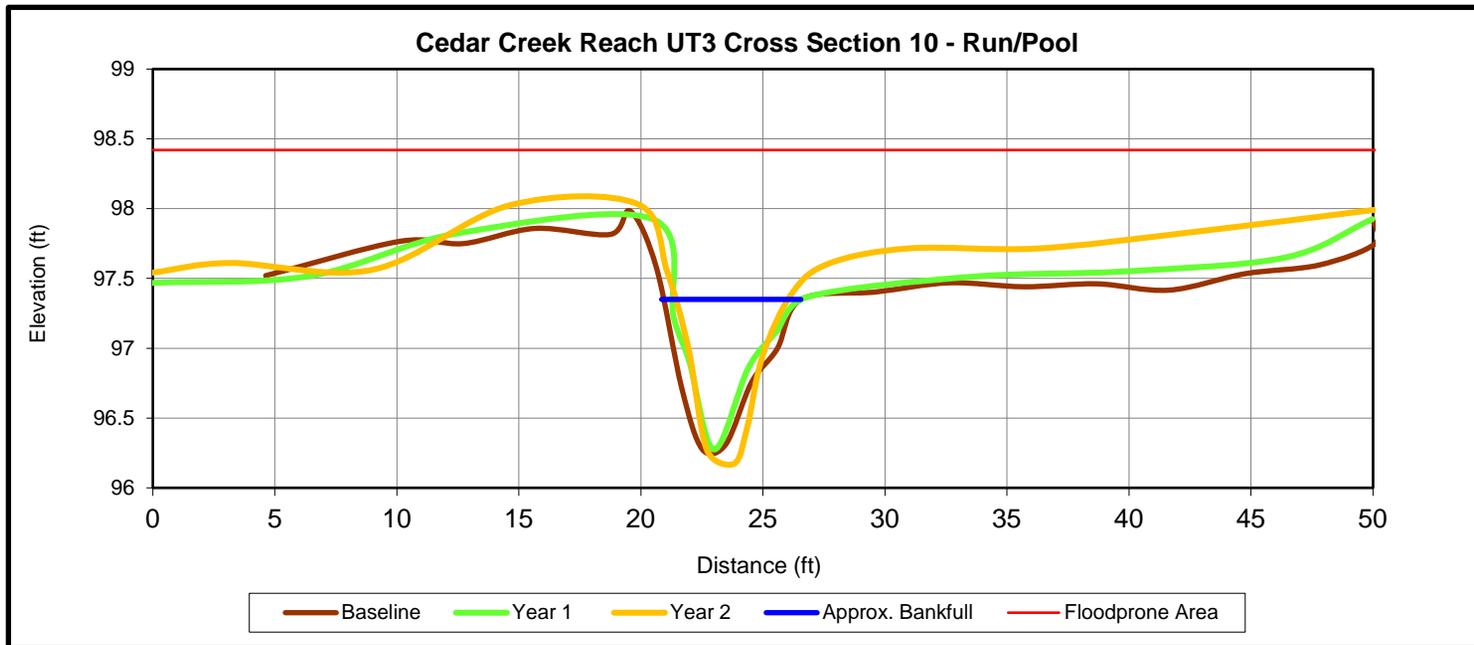


	Cross Section 10 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	97.4	97.4	97.4				
Bankfull Width (ft)	5.7	5.3	4.9				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.6	0.5	0.7				
Bankfull Max Depth (ft)	1.1	1.0	1.0				
Bankfull Cross Sectional Area (ft ²)	3.5	2.4	3.3				
Bankfull Width/Depth Ratio	9.1	11.7	7.2				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

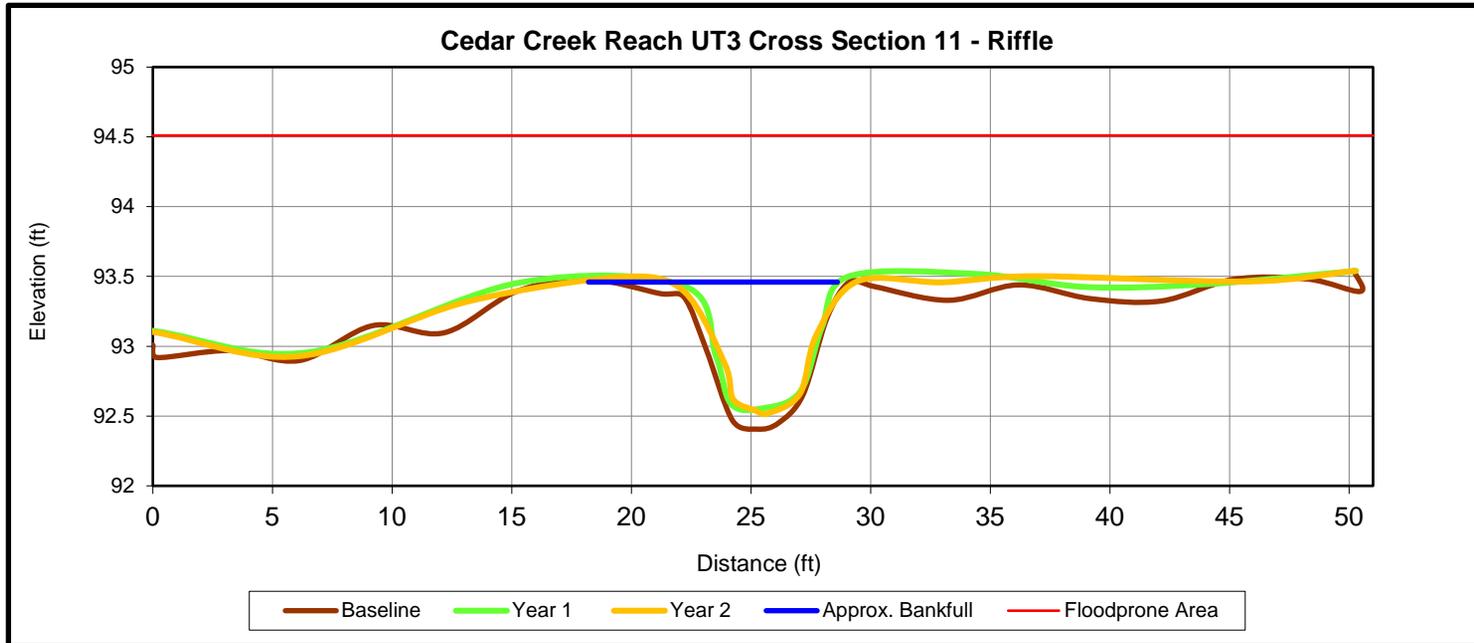


	Cross Section 11 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	93.5	93.5	93.5				
Bankfull Width (ft)	10.4	6.9	9.3				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.6	0.4				
Bankfull Max Depth (ft)	1.1	0.9	1.0				
Bankfull Cross Sectional Area (ft ²)	4.8	4.2	3.6				
Bankfull Width/Depth Ratio	22.2	11.1	24.0				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

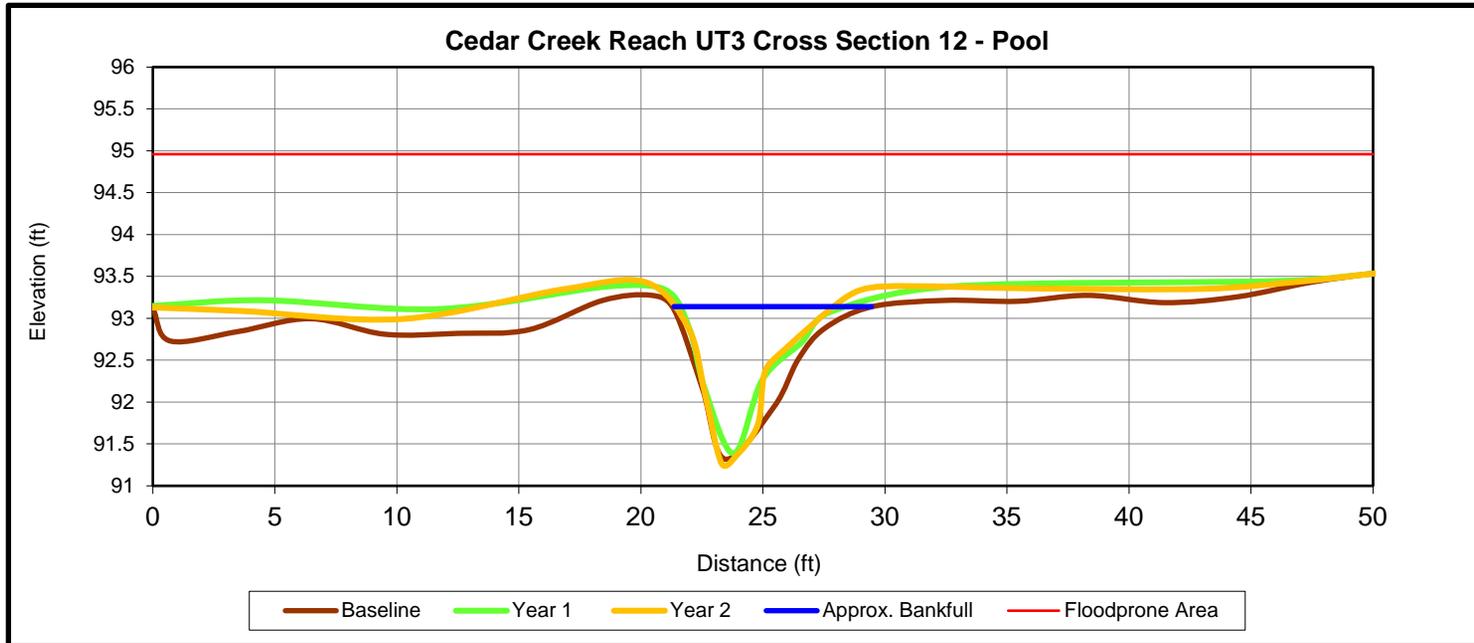


	Cross Section 12 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	93.1	93.1	93.1				
Bankfull Width (ft)	8.1	6.6	6.5				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.8	0.7	0.8				
Bankfull Max Depth (ft)	1.8	1.7	1.8				
Bankfull Cross Sectional Area (ft ²)	6.6	4.7	5.1				
Bankfull Width/Depth Ratio	10.0	9.3	8.3				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

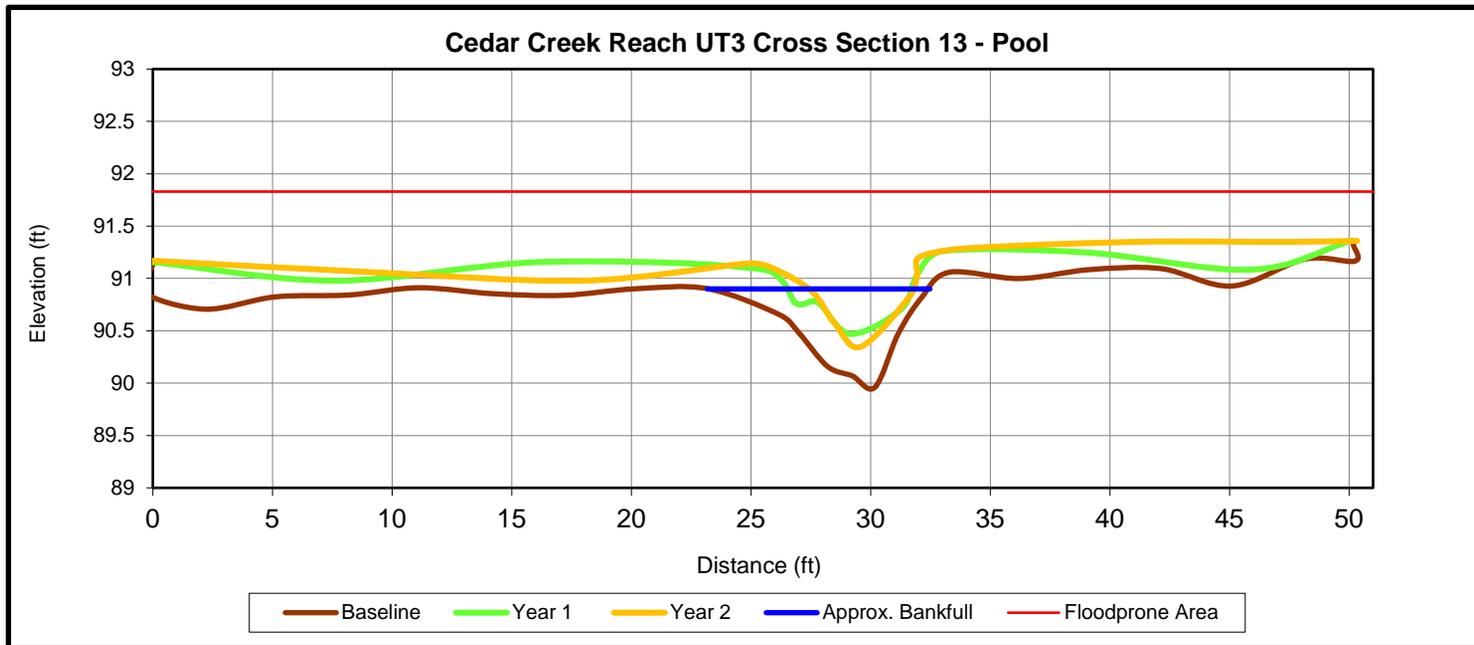


	Cross Section 13 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	90.9	90.9	90.9				
Bankfull Width (ft)	9.3	5.4	7.0				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.2	0.4				
Bankfull Max Depth (ft)	0.9	0.4	0.8				
Bankfull Cross Sectional Area (ft ²)	3.9	1.2	2.6				
Bankfull Width/Depth Ratio	22.2	23.2	19.0				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

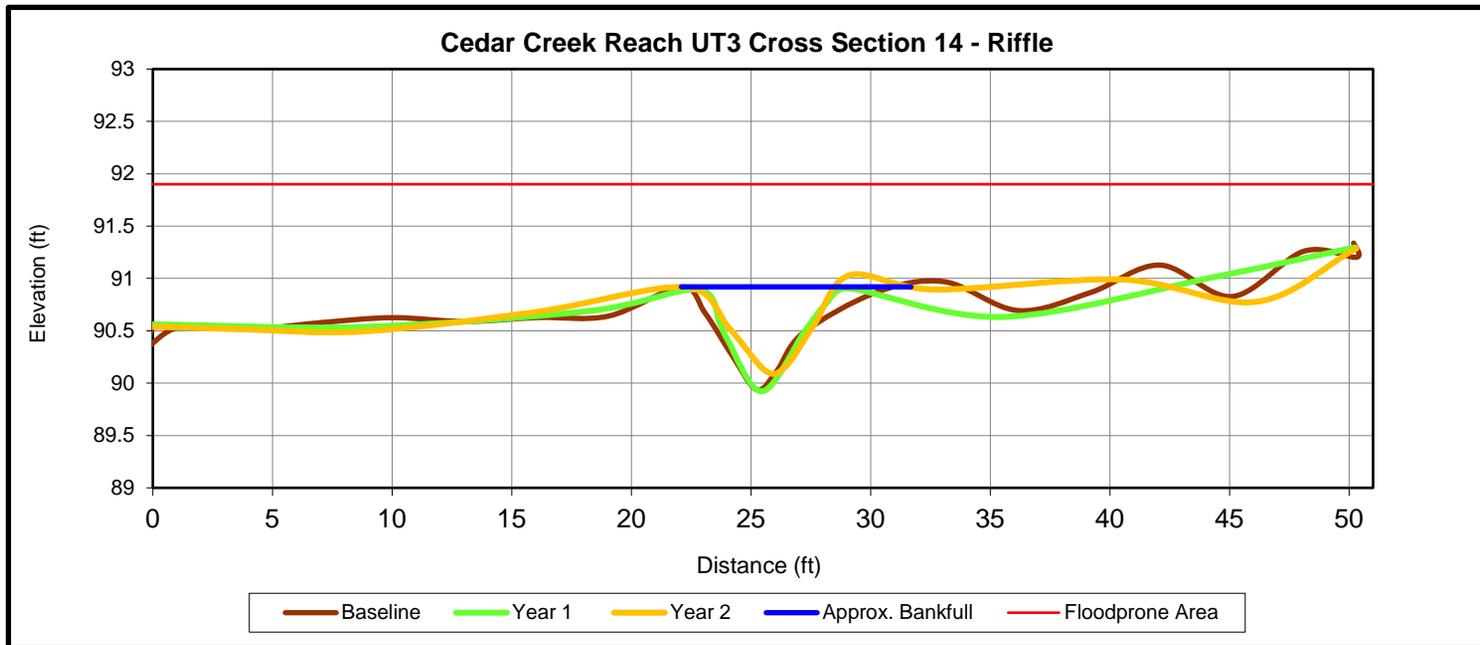


	Cross Section 14 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	90.9	90.9	90.9				
Bankfull Width (ft)	9.6	6.2	6.4				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.5	0.4				
Bankfull Max Depth (ft)	1.0	1.0	0.8				
Bankfull Cross Sectional Area (ft ²)	3.7	2.9	2.7				
Bankfull Width/Depth Ratio	25.0	13.4	15.2				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

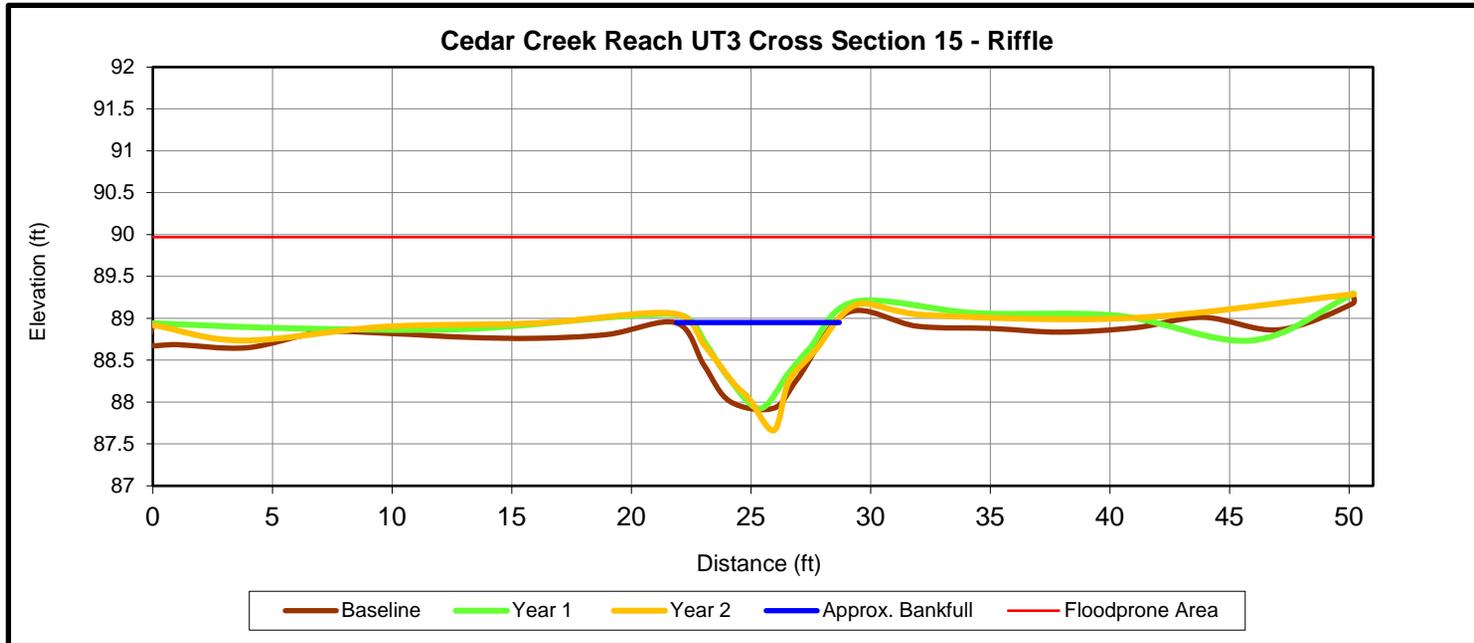


	Cross Section 15 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	89.0	89.0	89.0				
Bankfull Width (ft)	6.8	6.4	6.9				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.6	0.5	0.6				
Bankfull Max Depth (ft)	1.0	1.1	1.3				
Bankfull Cross Sectional Area (ft ²)	4.3	3.5	4.1				
Bankfull Width/Depth Ratio	10.8	11.9	11.7				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

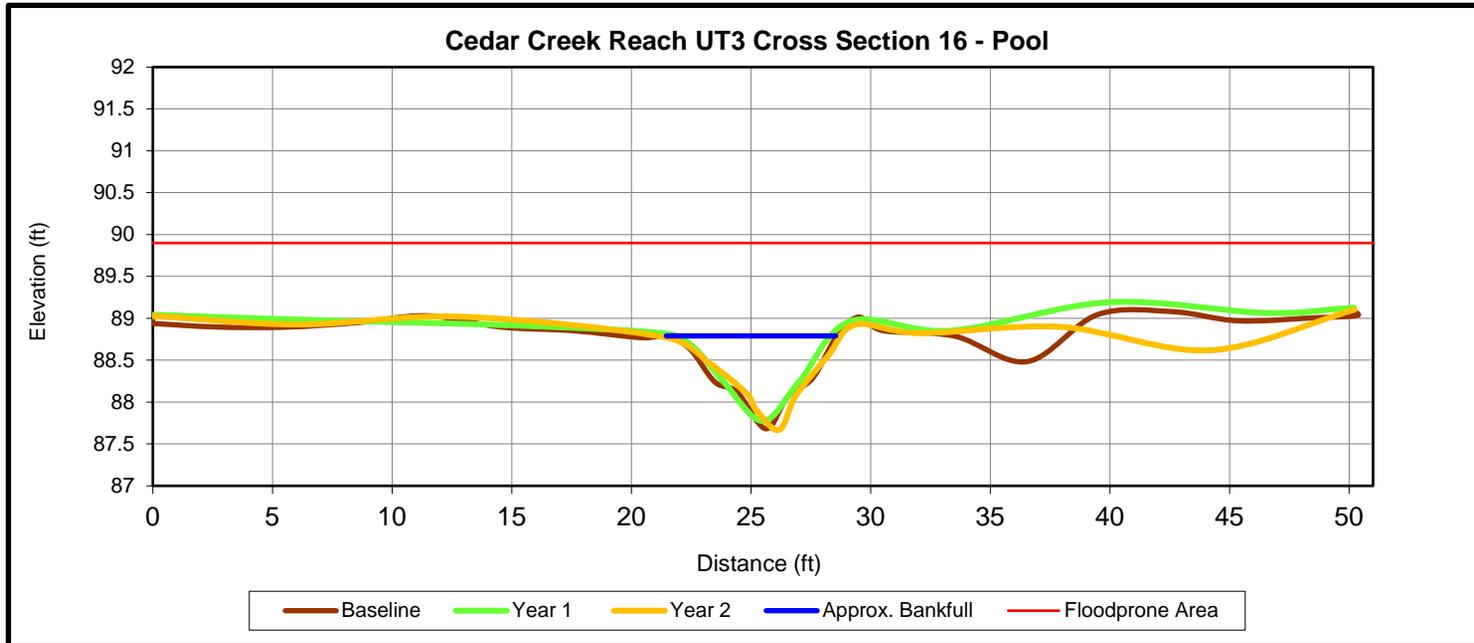


	Cross Section 16 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	88.8	88.8	88.8				
Bankfull Width (ft)	7.1	7.1	8.5				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.5	0.5				
Bankfull Max Depth (ft)	1.1	1.0	1.1				
Bankfull Cross Sectional Area (ft ²)	3.8	3.5	3.8				
Bankfull Width/Depth Ratio	13.1	14.4	18.8				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

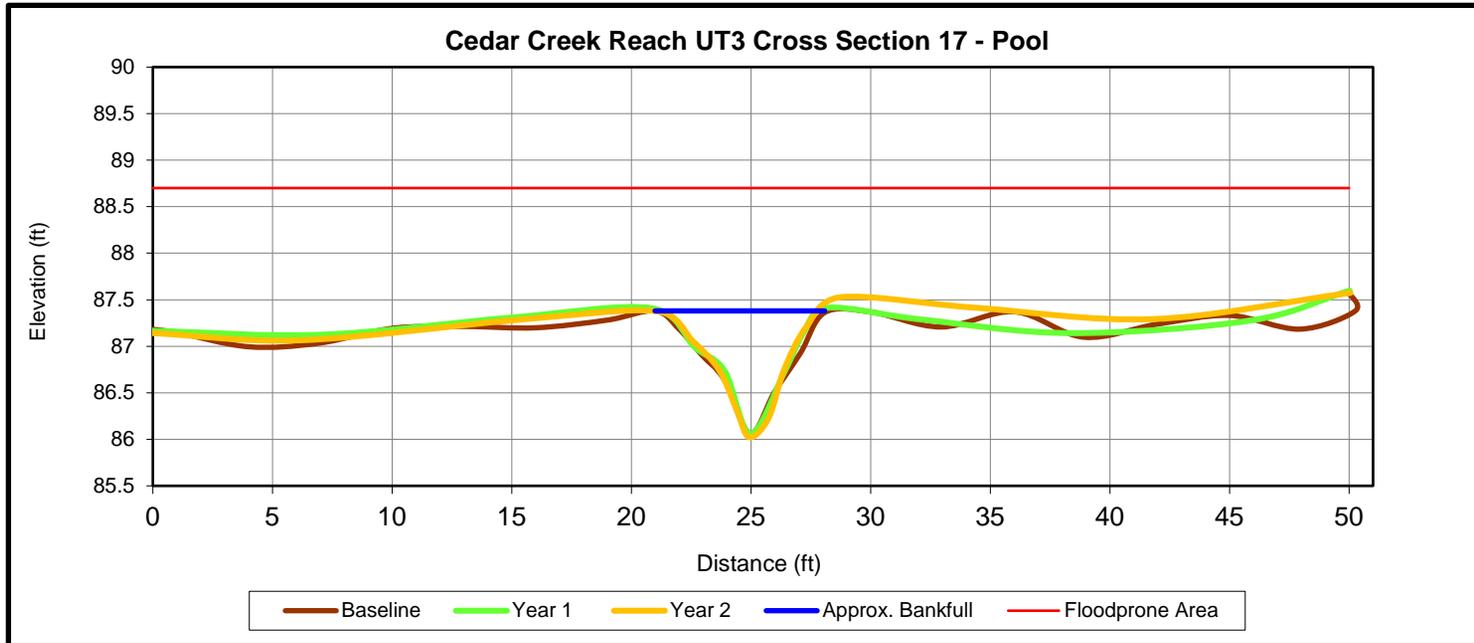


	Cross Section 17 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	87.4	87.4	87.4				
Bankfull Width (ft)	7.1	7.2	7.1				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.6	0.6	0.6				
Bankfull Max Depth (ft)	1.3	1.3	1.4				
Bankfull Cross Sectional Area (ft ²)	4.2	4.0	4.2				
Bankfull Width/Depth Ratio	12.0	13.0	12.0				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

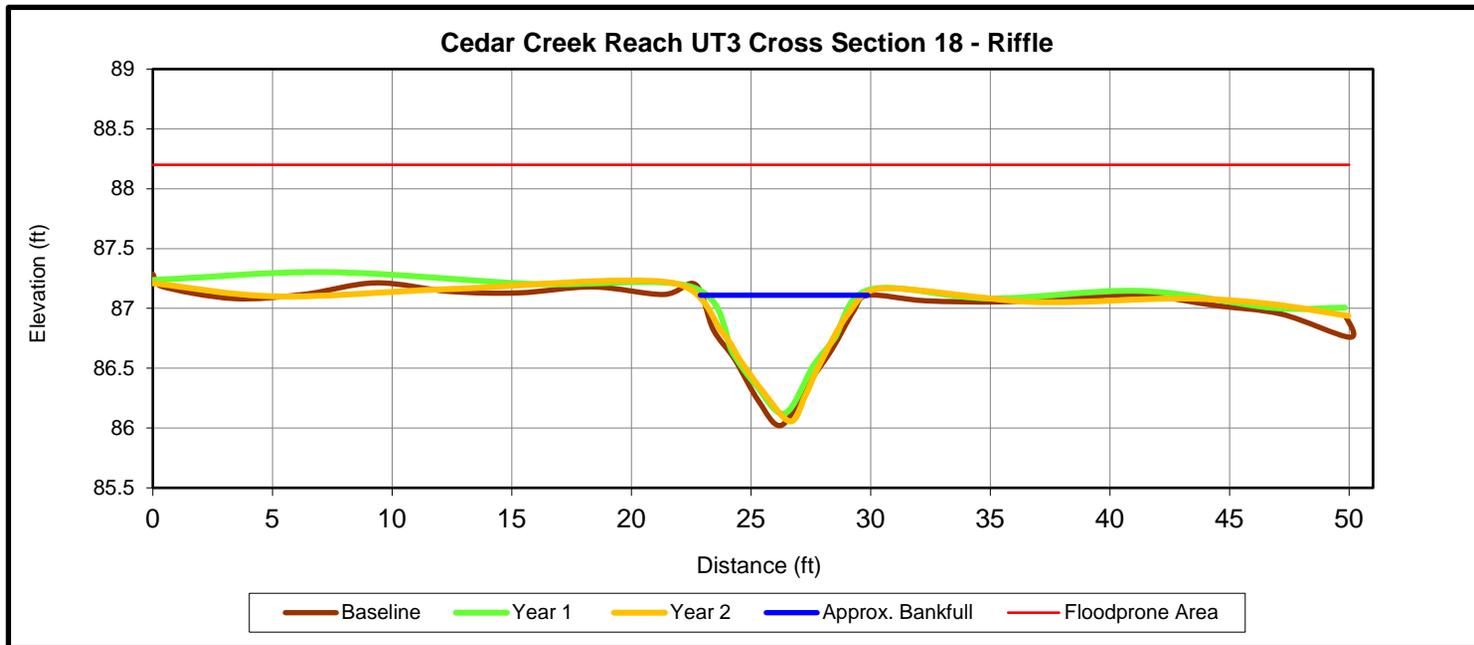


	Cross Section 18 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	87.1	87.1	87.1				
Bankfull Width (ft)	7.0	6.9	7.7				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.6	0.5	0.5				
Bankfull Max Depth (ft)	1.1	1.0	1.0				
Bankfull Cross Sectional Area (ft ²)	4.0	3.5	3.7				
Bankfull Width/Depth Ratio	12.3	13.7	16.0				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

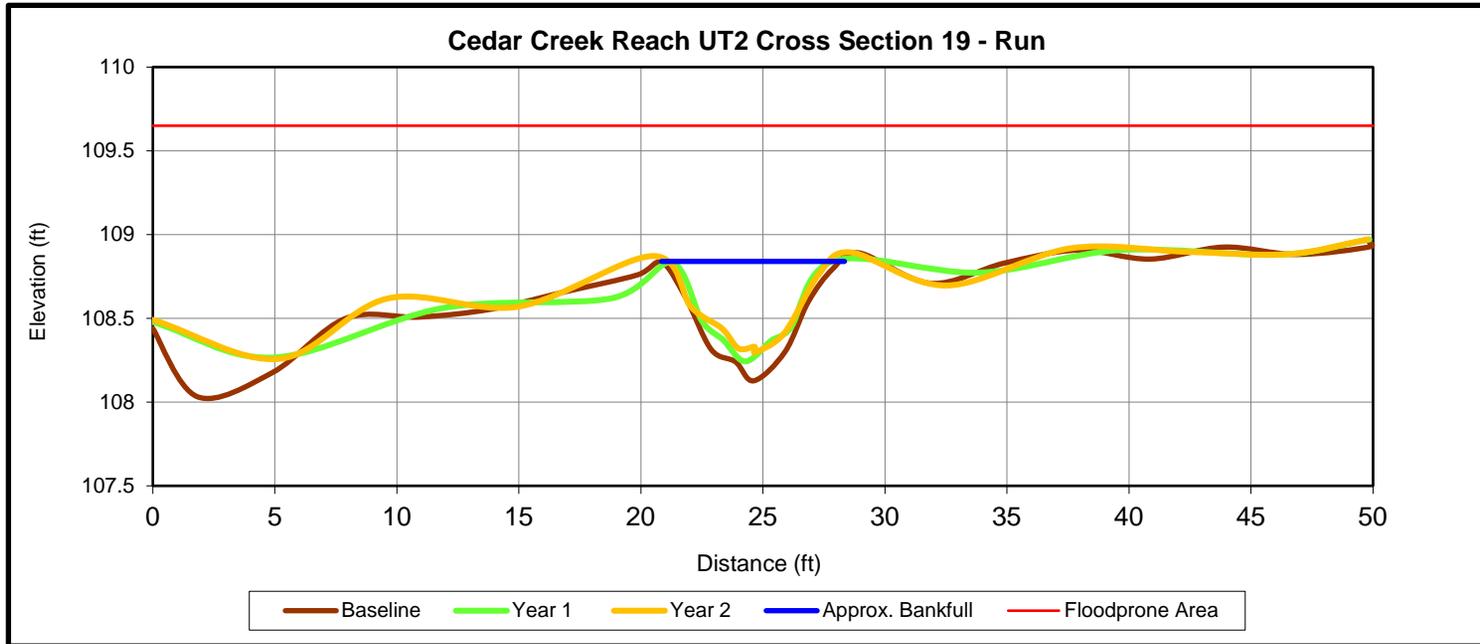


	Cross Section 19 (Run)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	108.8	108.8	108.8				
Bankfull Width (ft)	7.5	6.3	6.8				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.3	0.3				
Bankfull Max Depth (ft)	0.8	0.6	0.5				
Bankfull Cross Sectional Area (ft ²)	2.9	2.1	2.0				
Bankfull Width/Depth Ratio	19.6	19.4	23.4				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

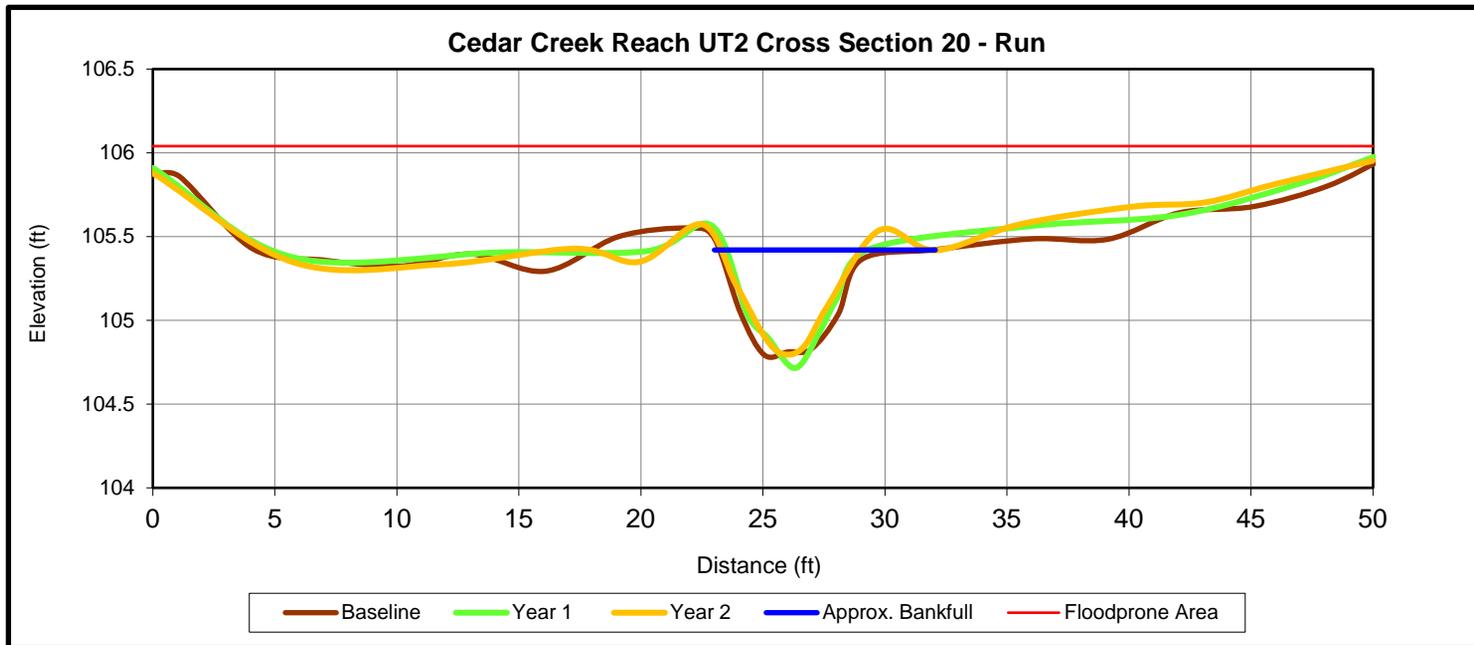


	Cross Section 20 (Run)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	105.4	105.4	105.4				
Bankfull Width (ft)	8.8	5.9	5.9				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.3	0.4	0.3				
Bankfull Max Depth (ft)	0.6	0.7	0.6				
Bankfull Cross Sectional Area (ft ²)	2.7	2.2	2.0				
Bankfull Width/Depth Ratio	29.1	15.7	17.4				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

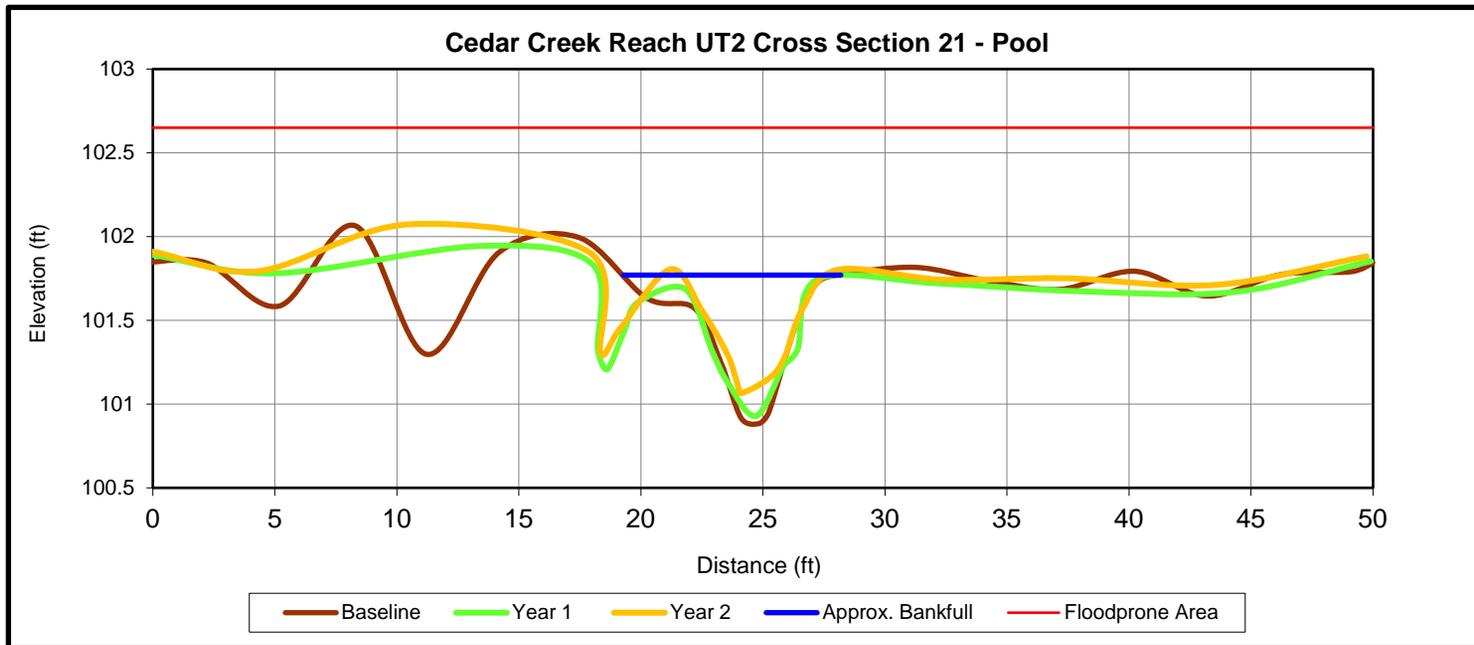


	Cross Section 21 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	101.8	101.8	101.8				
Bankfull Width (ft)	8.9	11.1	10.0				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.3	0.4	0.3				
Bankfull Max Depth (ft)	0.9	0.9	0.7				
Bankfull Cross Sectional Area (ft ²)	3.1	4.0	3.3				
Bankfull Width/Depth Ratio	25.6	30.8	30.6				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

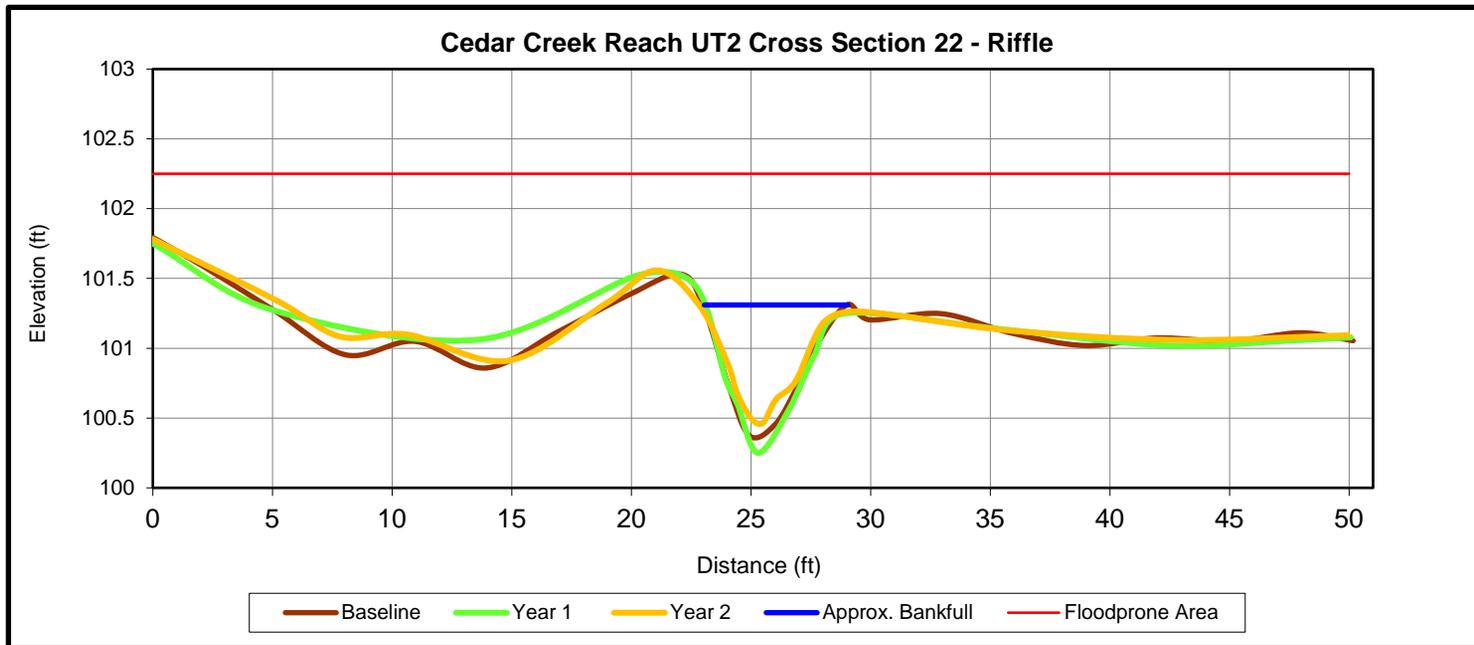


	Cross Section 22 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	101.3	101.3	101.3				
Bankfull Width (ft)	6.0	5.9	6.7				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.6	0.4				
Bankfull Max Depth (ft)	0.9	1.0	0.8				
Bankfull Cross Sectional Area (ft ²)	3.1	3.3	2.7				
Bankfull Width/Depth Ratio	11.6	10.7	16.8				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

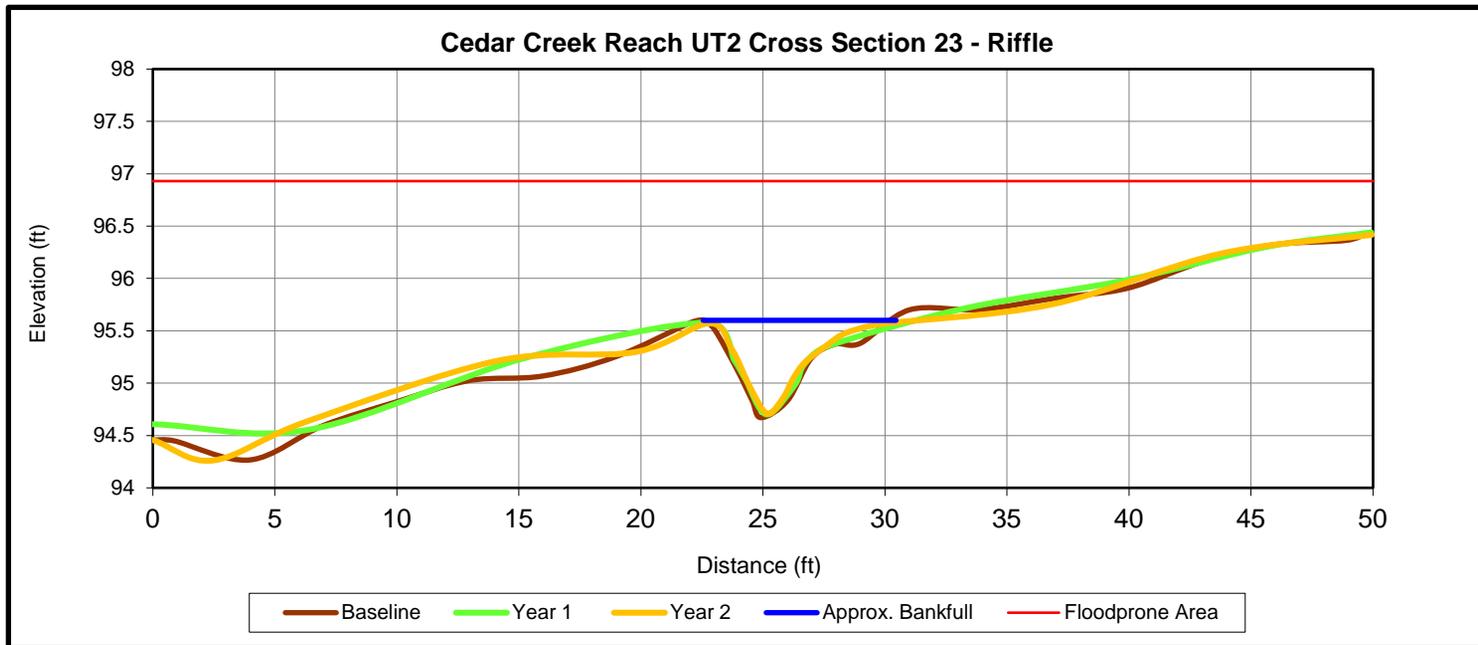


	Cross Section 23 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	95.6	95.6	95.6				
Bankfull Width (ft)	8.3	8.7	7.0				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.3	0.5				
Bankfull Max Depth (ft)	1.3	1.0	1.4				
Bankfull Cross Sectional Area (ft ²)	3.1	2.9	3.3				
Bankfull Width/Depth Ratio	21.9	26.1	15.0				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

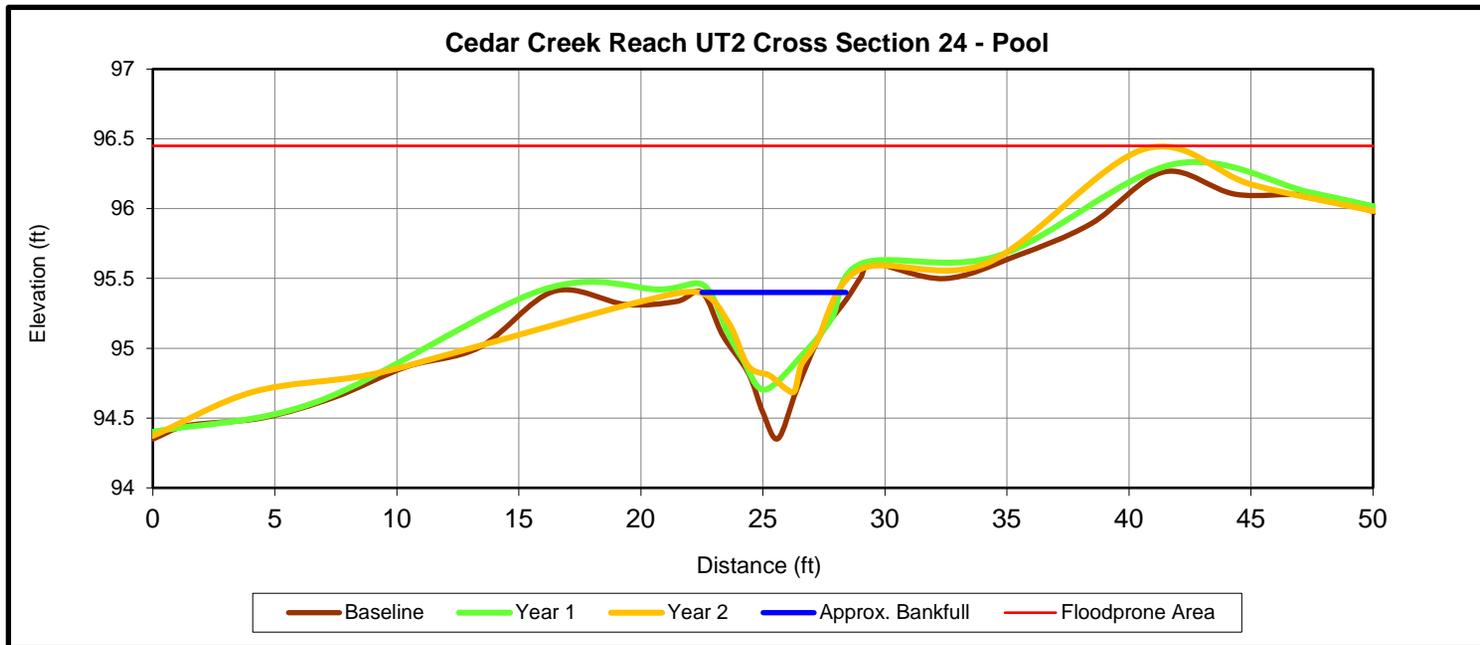


	Cross Section 24 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	95.4	95.4	95.4				
Bankfull Width (ft)	5.9	5.7	6.4				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.5	0.4	0.5				
Bankfull Max Depth (ft)	1.1	1.0	1.1				
Bankfull Cross Sectional Area (ft ²)	3.0	2.2	2.9				
Bankfull Width/Depth Ratio	11.8	14.7	14.1				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

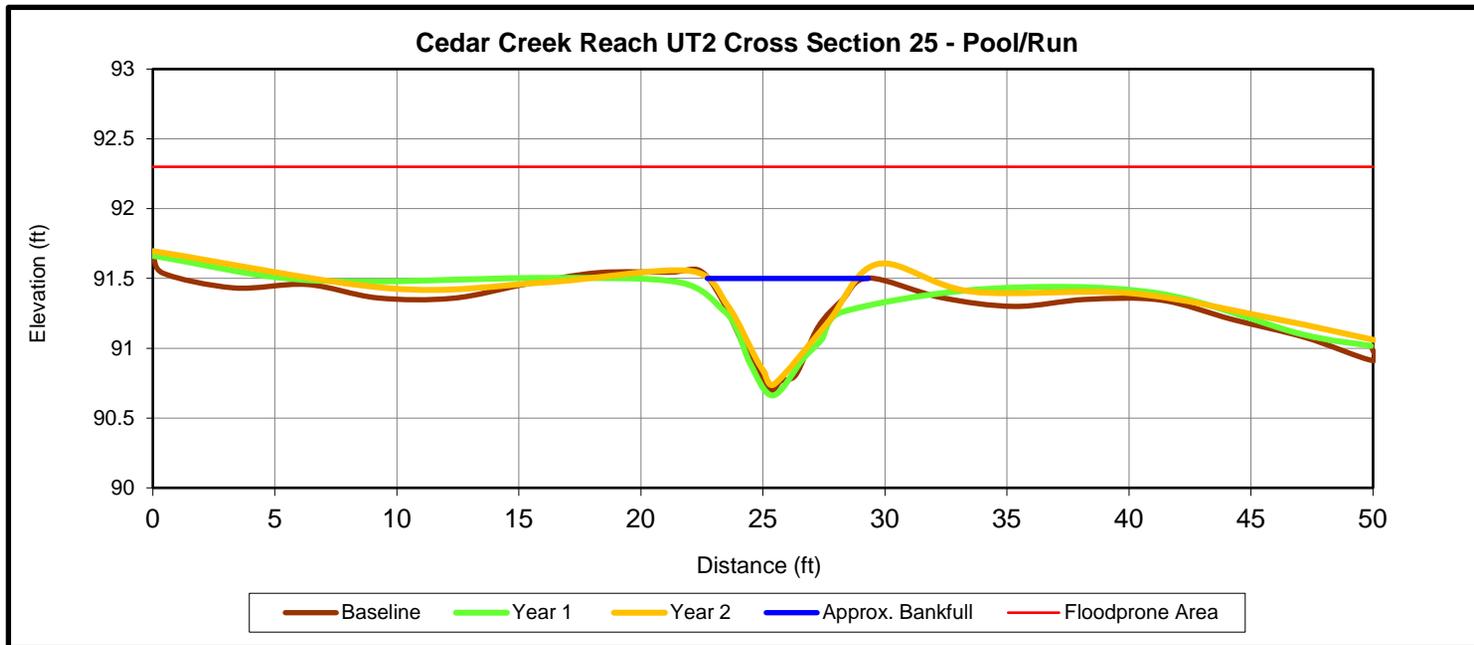


	Cross Section 25 (Pool)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	91.5	91.5	91.5				
Bankfull Width (ft)	6.6	6.6	6.8				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.4	0.4				
Bankfull Max Depth (ft)	0.8	8.0	0.8				
Bankfull Cross Sectional Area (ft ²)	2.6	2.9	2.5				
Bankfull Width/Depth Ratio	17.0	15.3	18.8				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

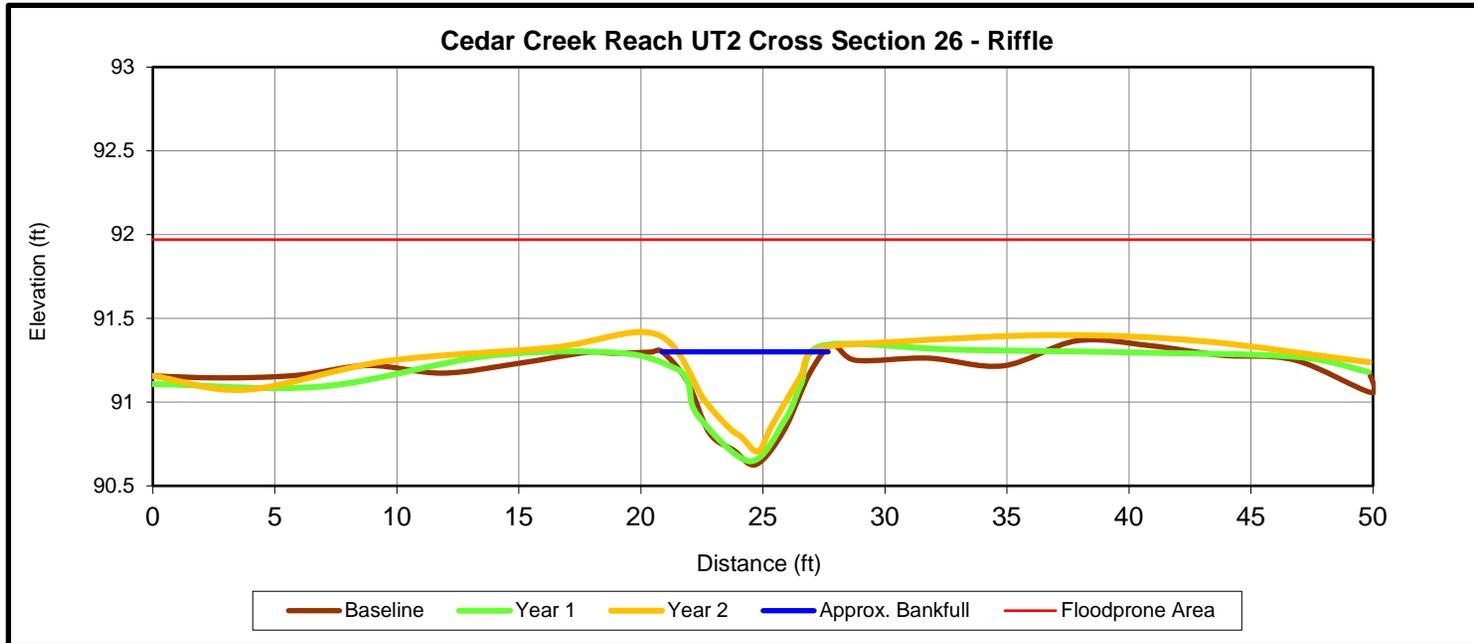


	Cross Section 26 (Riffle)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	91.3	91.3	91.3				
Bankfull Width (ft)	6.8	8.2	6.0				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.3	0.3				
Bankfull Max Depth (ft)	0.7	0.7	0.6				
Bankfull Cross Sectional Area (ft ²)	2.5	2.4	1.9				
Bankfull Width/Depth Ratio	18.1	27.3	18.9				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				



Upstream



Downstream

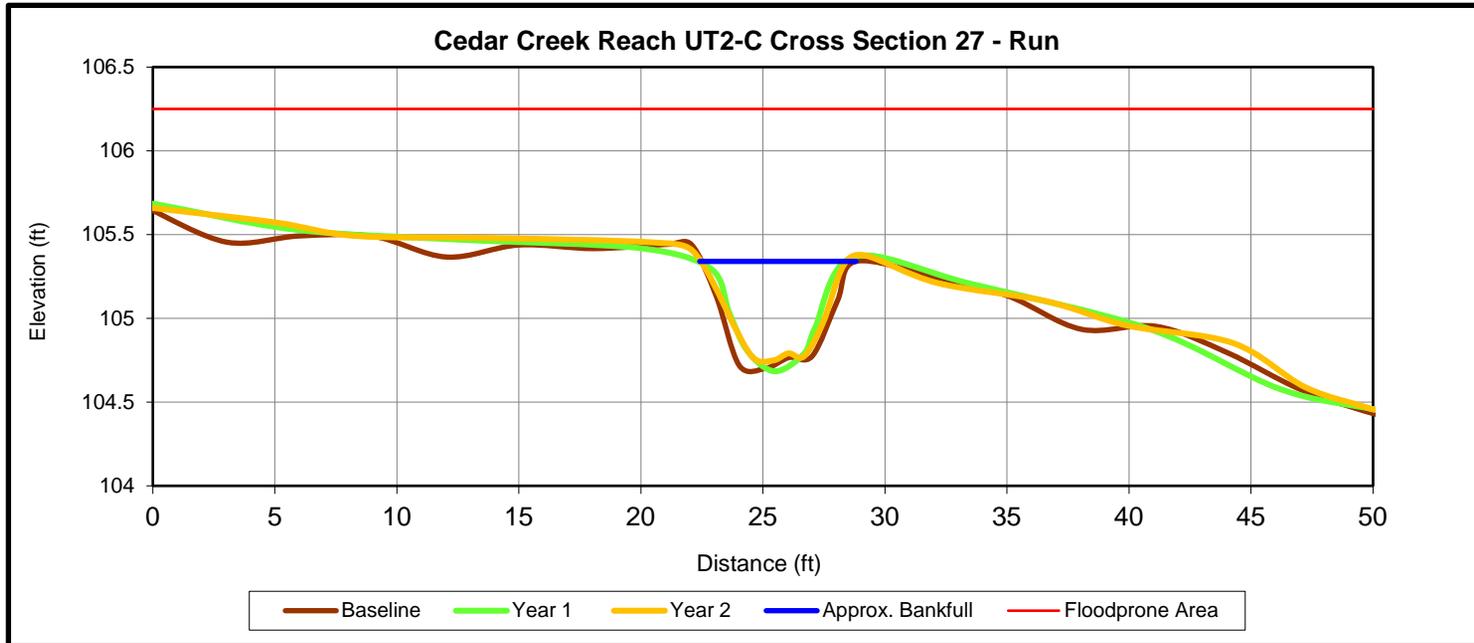

	Cross Section 27 (Run)						
Based on fixed baseline bankfull elevation	Base	MY1	MY2	MY3	MY5	MY7	MY+
Record elevation (datum) used	105.3	105.3	105.3				
Bankfull Width (ft)	6.4	5.7	5.7				
Floodprone Width (ft)	50.0	50.0	50.0				
Bankfull Mean Depth (ft)	0.4	0.4	0.4				
Bankfull Max Depth (ft)	0.9	0.8	0.8				
Bankfull Cross Sectional Area (ft ²)	2.8	2.1	2.1				
Bankfull Width/Depth Ratio	14.8	15.2	15.5				
Bankfull Entrenchment Ratio	>2.2	>2.2	>2.2				
Bankfull Bank Height Ratio	1.0	1.0	1.0				

Appendix E

Hydrology Data

Table 13. Documentation of Geomorphologically Significant Flow Events

Table 14. Rainfall Summary

Table 15a. Wetland Hydrology Criteria Attainment

Table 15b. Wetland Hydrology Gauge Summary

Chart 1. 2016 Precipitation Data for Cedar Creek Site

Chart 2. 2016 Groundwater Monitoring Gauge Hydrographs

Crest Gauge Verification Photos

Table 13. Documentation of Geomorphological Significant Flow Events

Crest Gauge	Stream Reach	Headwater Valley Flow Events	Maximum Consecutive Flow Days	Cumulative Flow Days	Photo Number
Crest Gauge 2 (HWV)	UT-2C	36	117.7	186.3	NA
Crest Gauge	Stream Reach	Number of Bankfull Events	Maximum Bankfull Height (ft.)		
Crest Gauge 1	UT-3	4	1.15		1
Crest Gauge 3	UT-2	1	0.4		2

Table 14. Rainfall Summary

Month	Average	Normal Limits		Clinton Station	On-Site Auto Rain Gauge
		Percent	70 Percent		
January	4.33	3.32	5.03	2.75	4.21
February	3.23	2.14	3.87	8.27	12.07
March	4.50	3.23	5.32	1.36	2.72
April	3.16	1.70	3.85	2.79	3.47
May	3.68	2.69	4.34	4.87	4.21
June	4.49	3.11	5.34	3.62	4.44
July	6.06	4.16	7.22	5.15	5.79
August	5.40	3.12	6.56	4.09	4.89
September	5.00	2.04	6.07	10.89	10.62
October	3.21	1.62	3.92	7.53*	11.04
November	2.89	1.83	3.49	---	---
December	3.24	2.14	3.88	---	---
Total	49.19	31.10	58.89	51.32	63.46

Notes:

* Sampson County Airport KCTZ gauge data was substituted for Clinton 311881 2NE. Clinton 311881 2 NE has been offline since Hurricane Matthew .

Table 15a. Wetland Hydrology Criteria Attainment

2016 Max Hydroperiod (Growing Season 17-Mar through 14-Nov, 242 days)					
Well Data for March 17 through October 31					
Success Criterion 9% = 22 Consecutive Days					
Gauge	Consecutive		Cumulative		Occurrences
	Days	Percent of growing Season	Days	Percent of growing Season	
AW1	229	94	229	94	1
AW2	229	94	229	94	1
AW3	134	55	227	94	5
AW4	229	94	229	94	1
AW5	60	25	130	54	17
AW6	96	39	192	79	17
AW7	4	2	17	7	10
AW8	34	14	96	39	9
AW9	33	13	119	49	21
AW10	35	14	141	58	15
AW11	6	2	38	15	17
RAW1	56	23	156	64	18
RAW2	99	41	229	94	13
RAW3	88	36	167	69	16

* Well data represents 229 days (~94%) during the total growing season from March 17th to October 31th.

Table 15b. MY1-MY2 Wetland Hydrology Gauge Summary

Gauge	MY1 - 2015		MY2 - 2016	
	Consecutive		Consecutive	
	Days	Percent of growing Season	Days	Percent of growing Season
AW1	162	67	229	94
AW2	162	67	229	94
AW3	71	29	134	55
AW4	100	41	229	94
AW5	51	21	60	25
AW6	51	21	96	39
AW7	5	2	4	2
AW8	21	9	34	14
AW9	51	21	33	13
AW10	50	21	35	14
AW11	13	5	6	2
RAW1	23	10	56	23
RAW2	52	21	99	41
RAW3	51	21	88	36

Chart 1. 2016 Precipitation Data for Cedar Creek Site






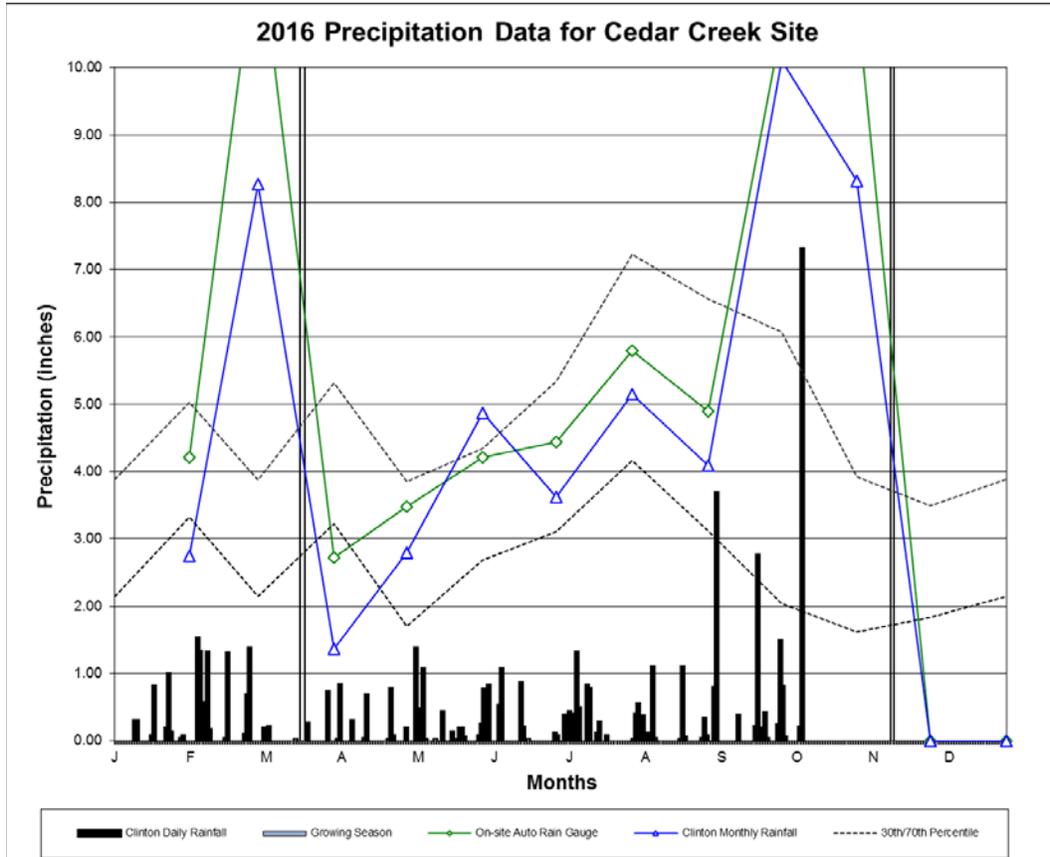


Chart 2. 2016 Cedar Creek Site Groundwater Monitoring Gauge Hydrographs

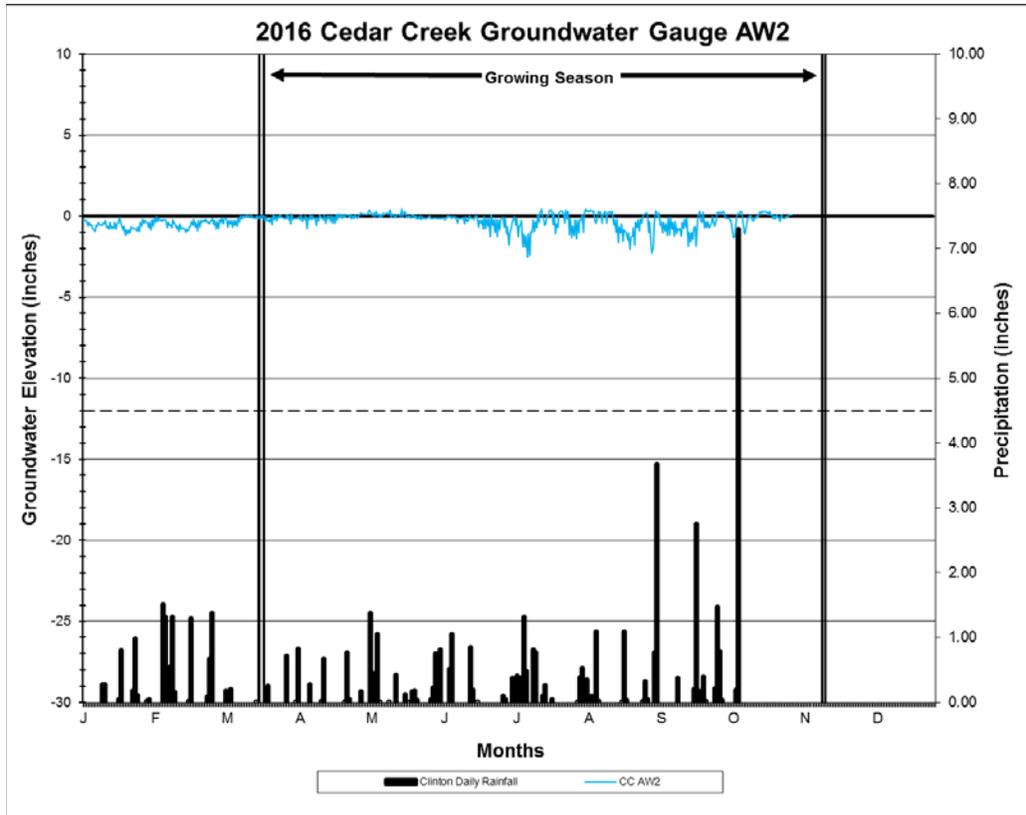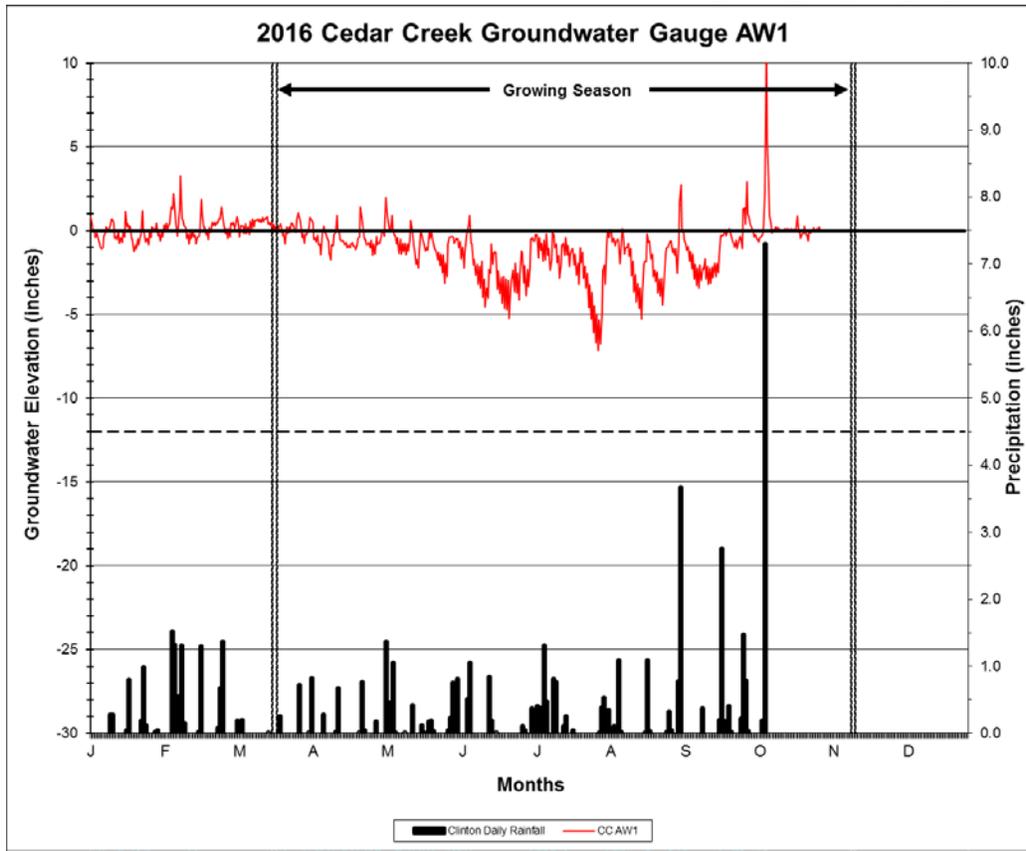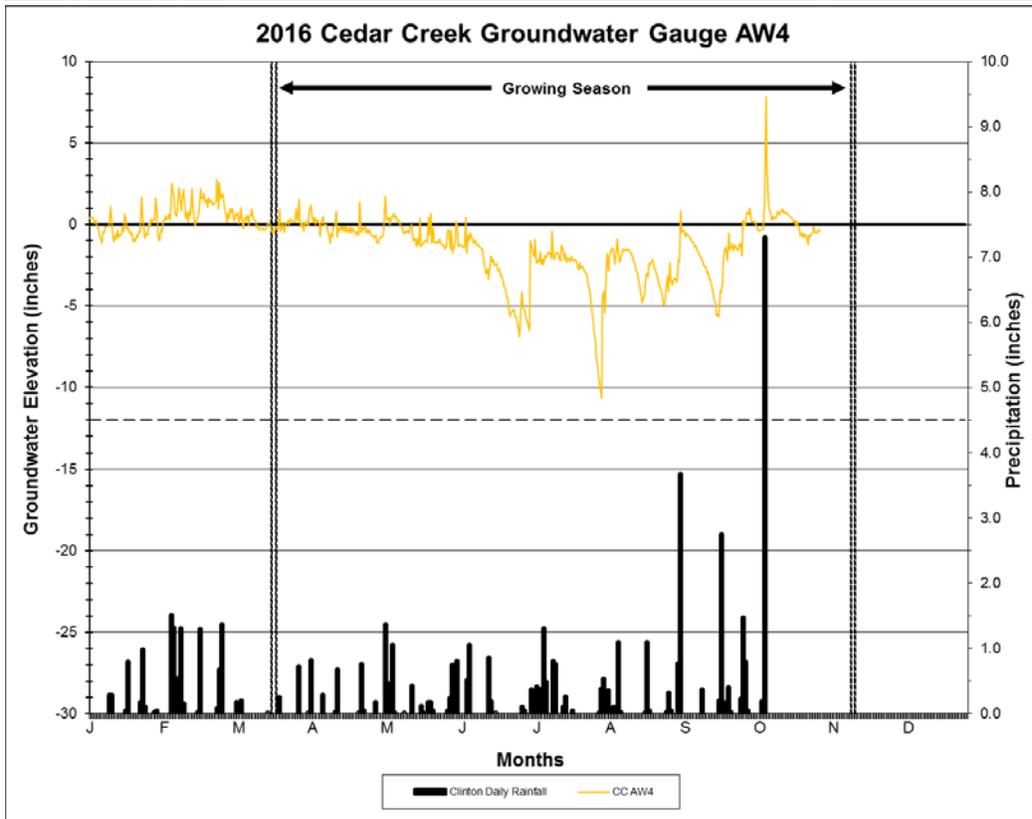



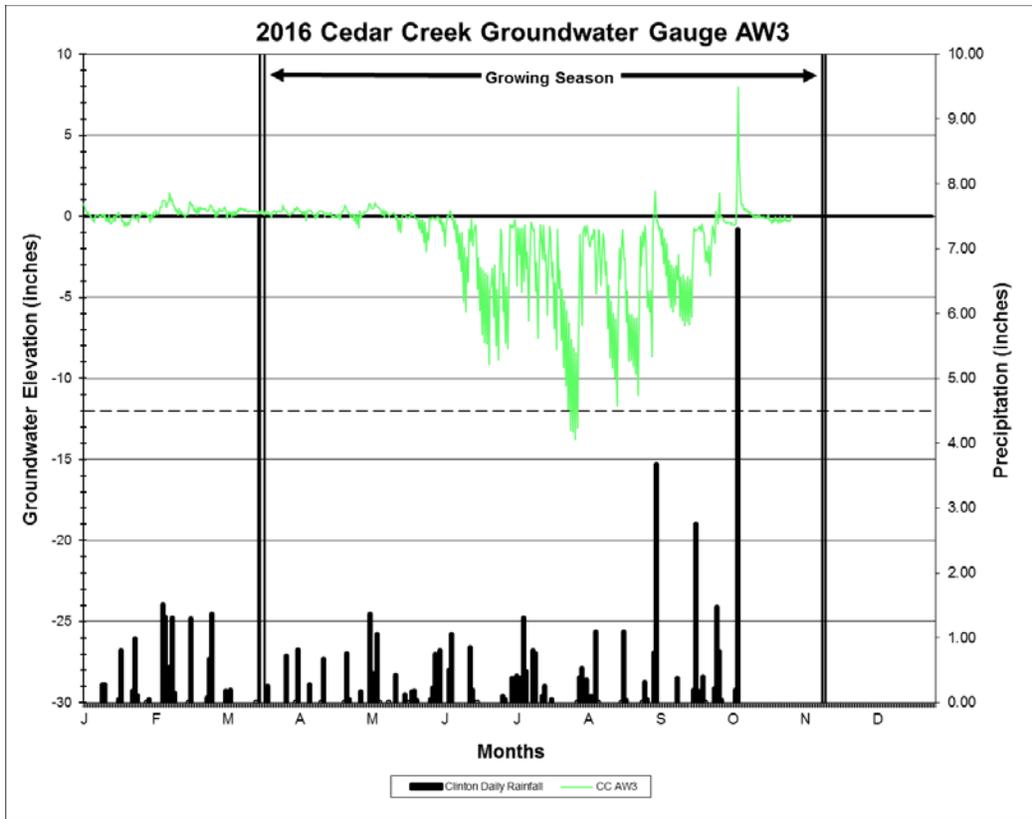




2016 Cedar Creek Groundwater Gauge AW5


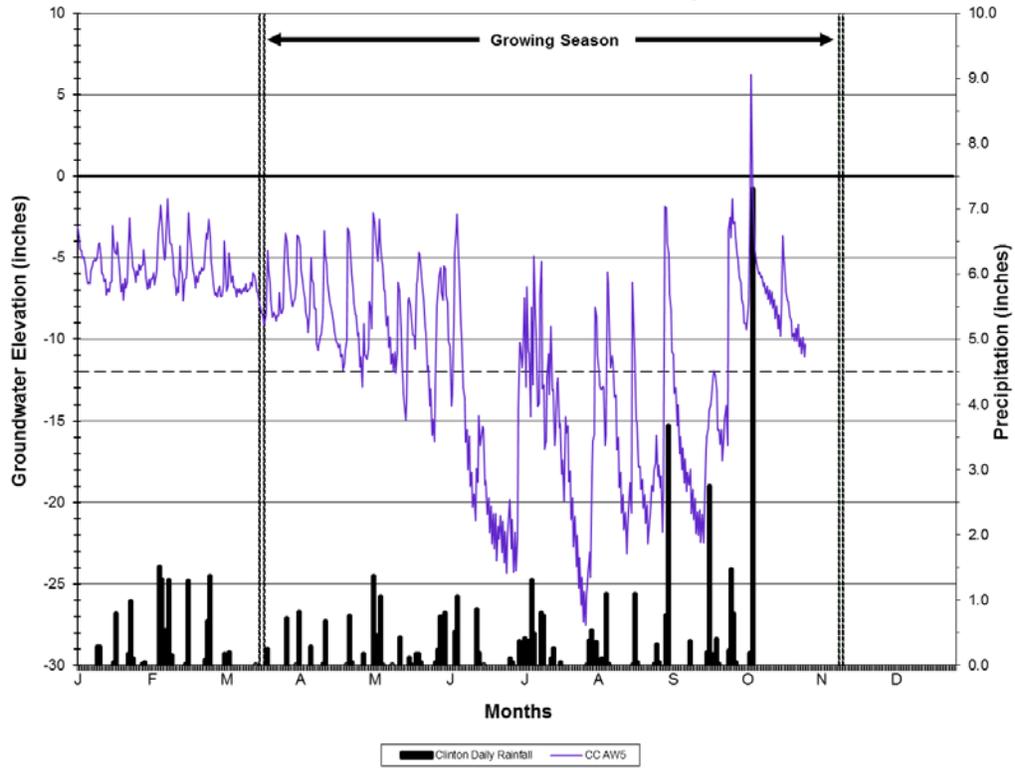


2016 Cedar Creek Groundwater Gauge AW6

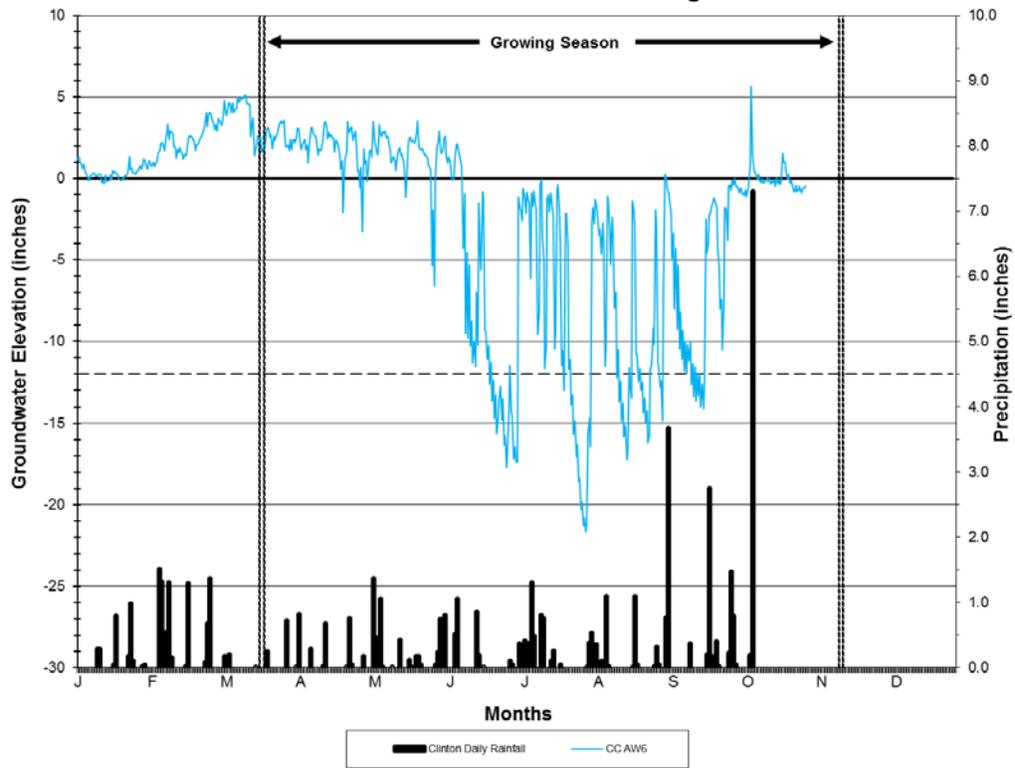


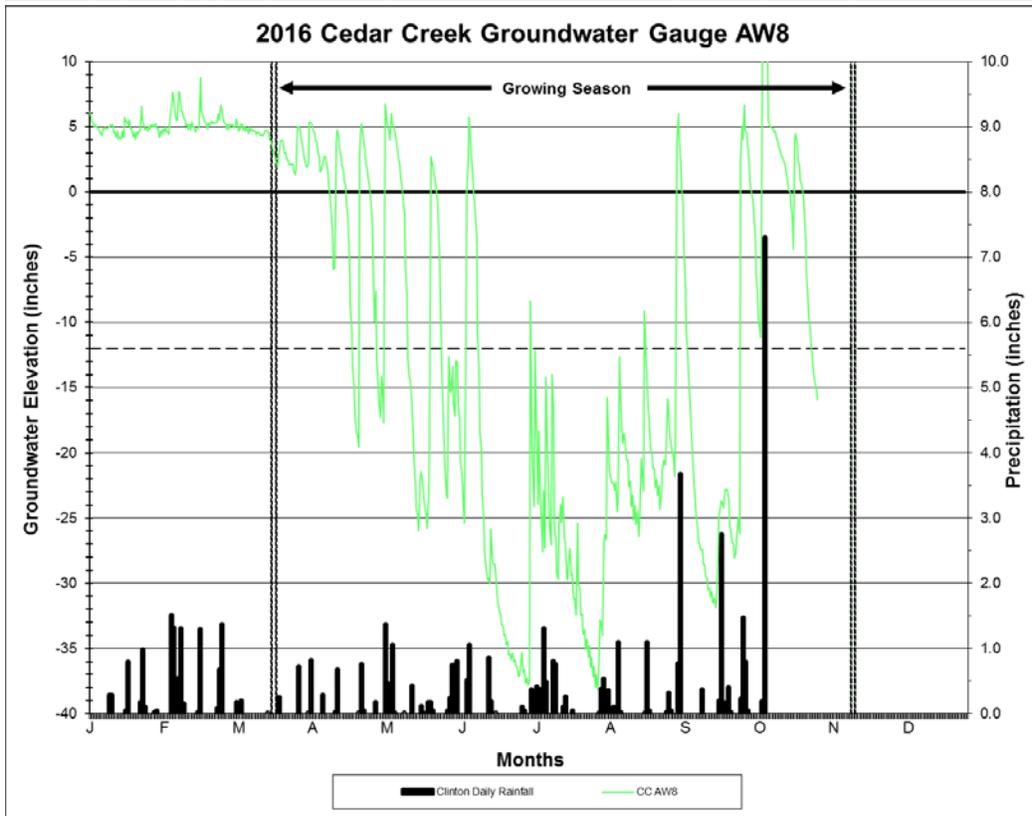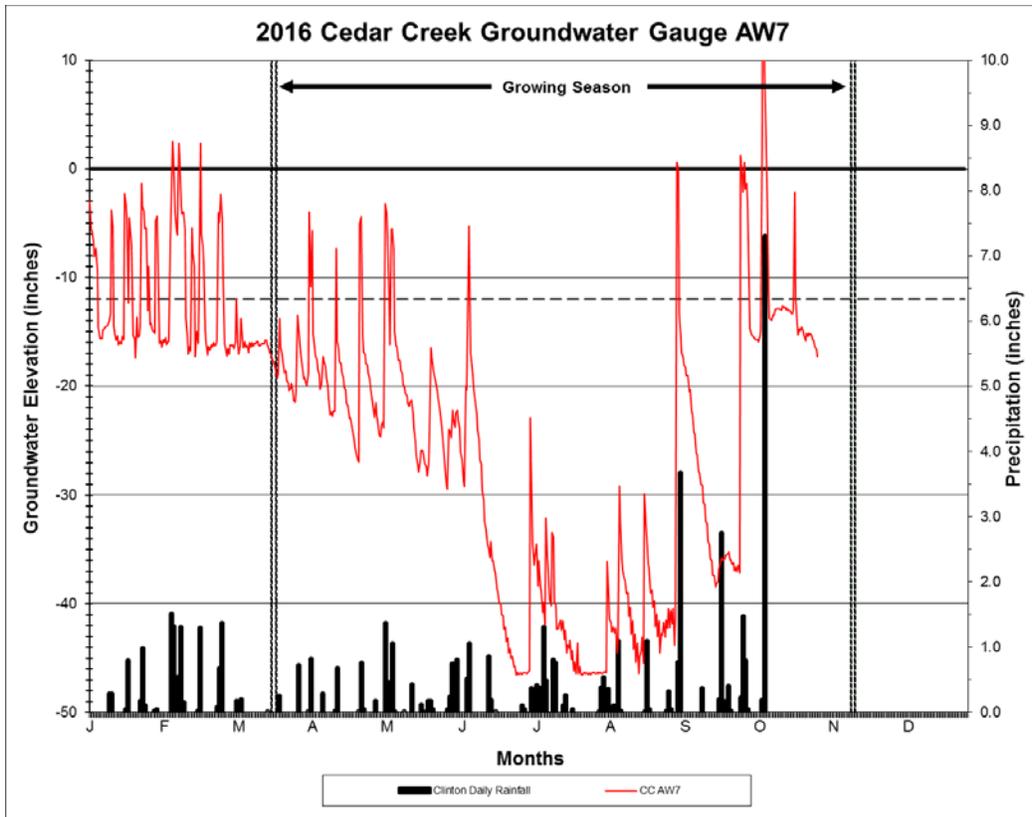

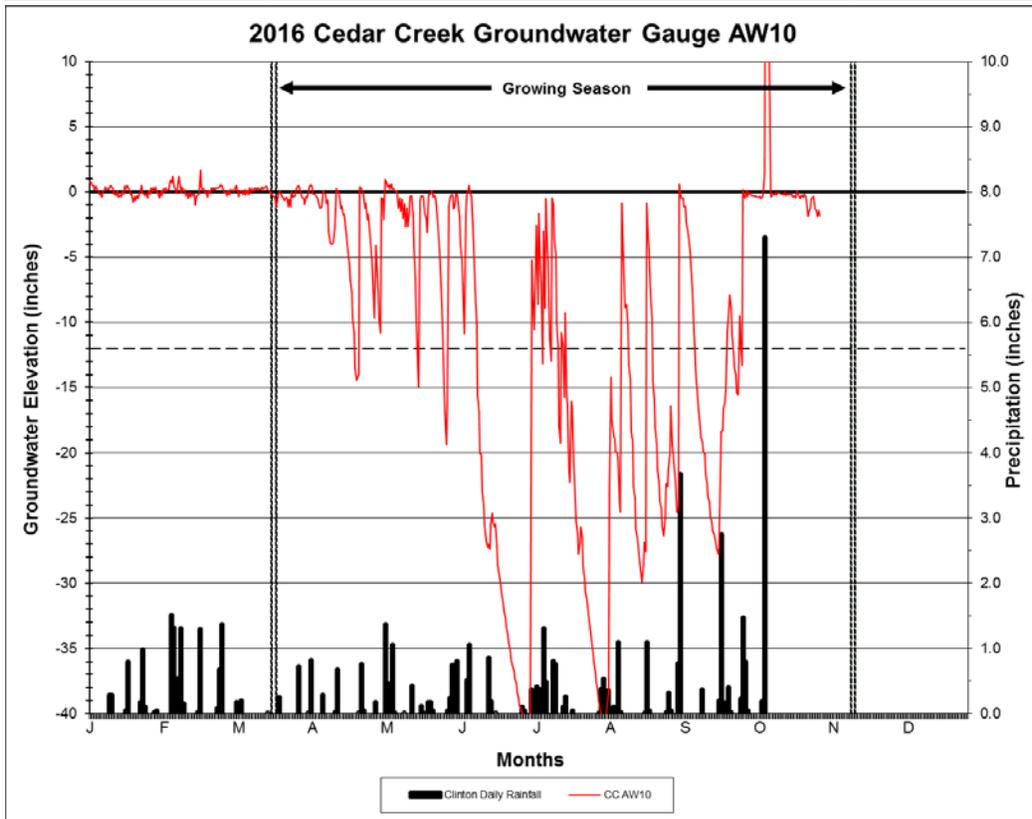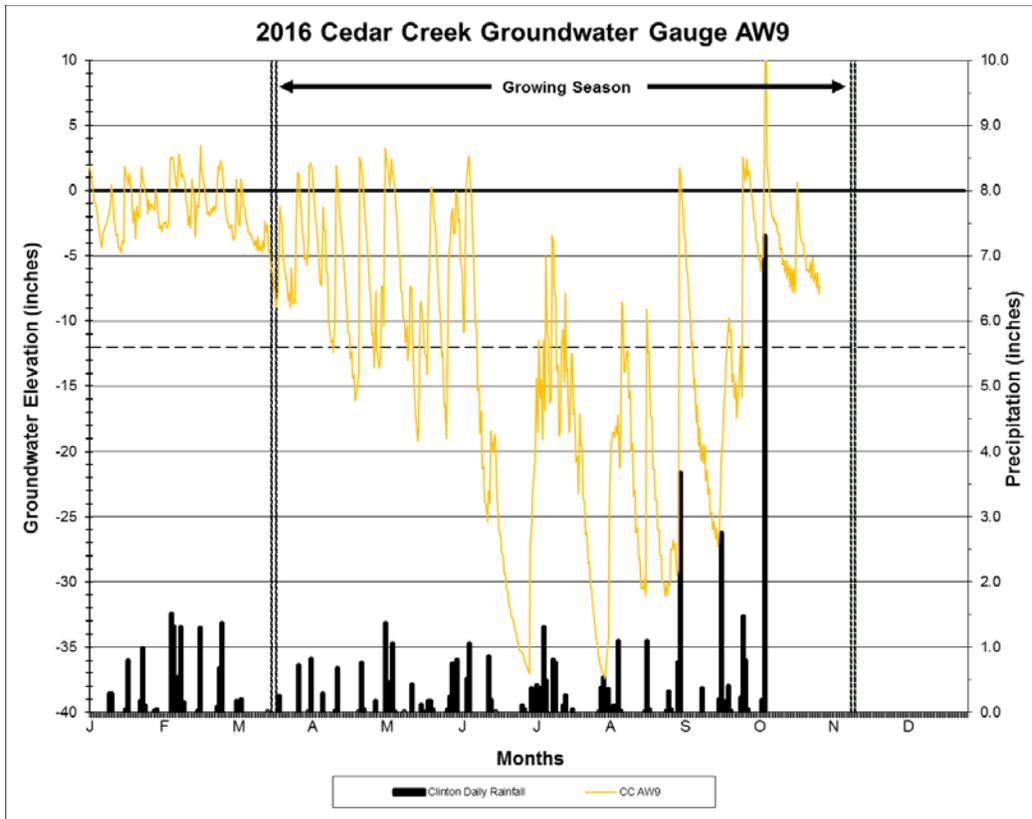


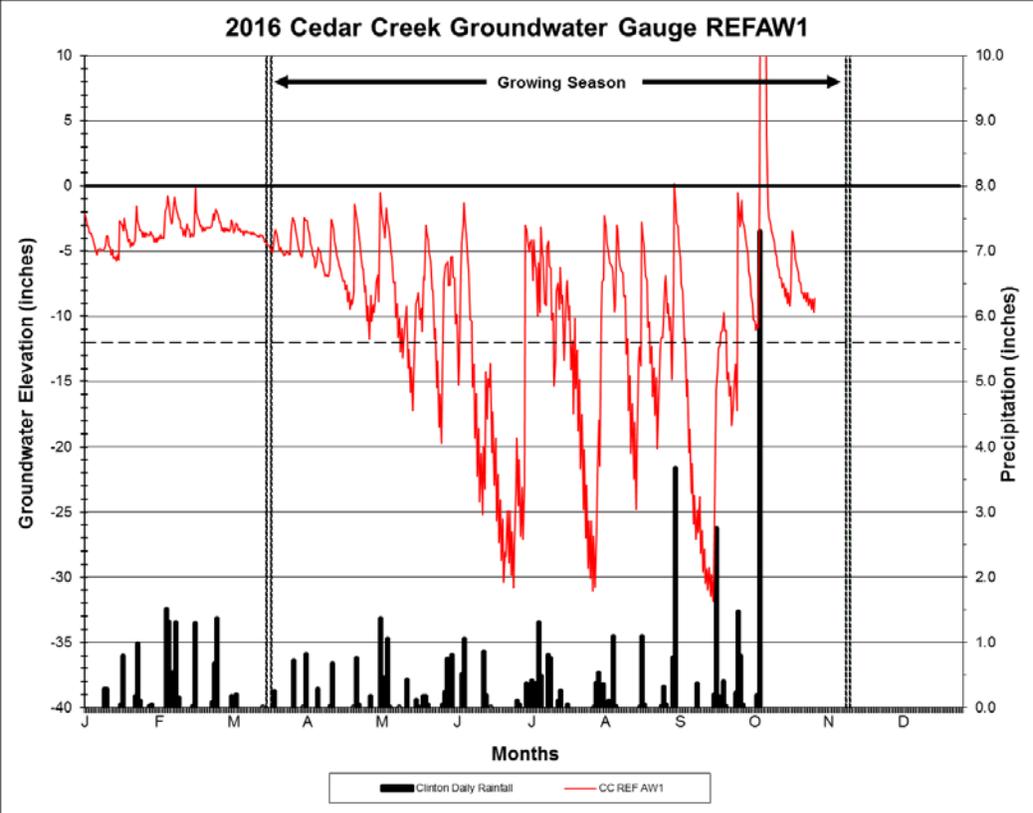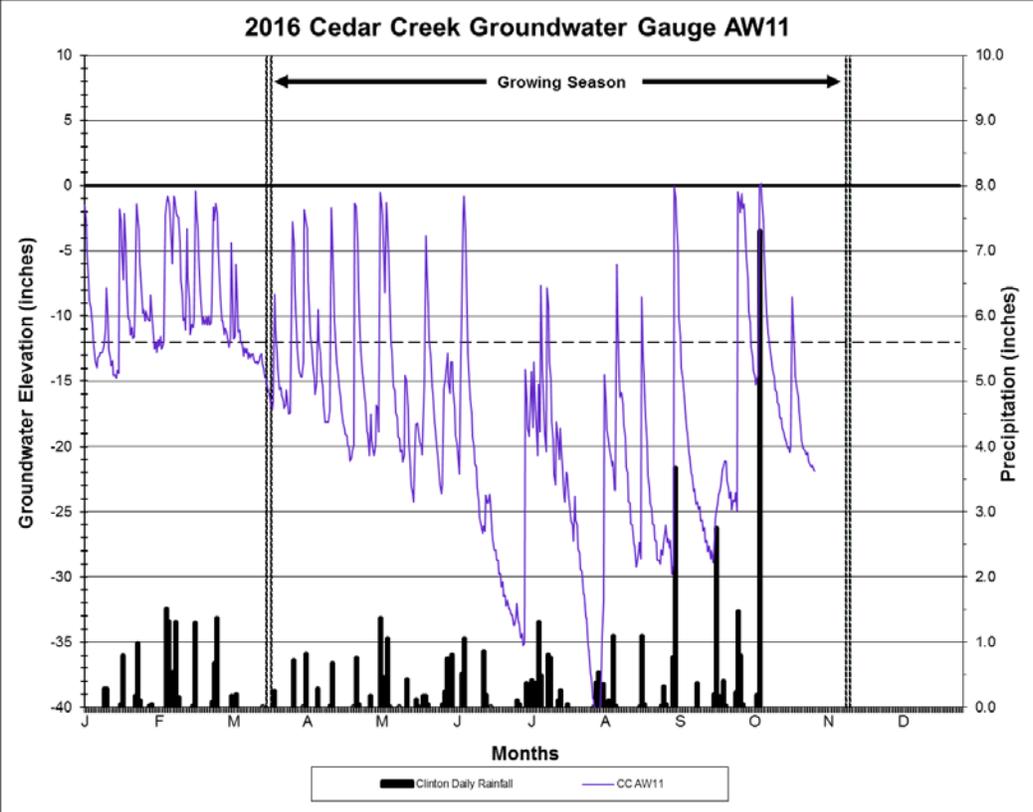

2016 Cedar Creek Groundwater Gauge REFAW2

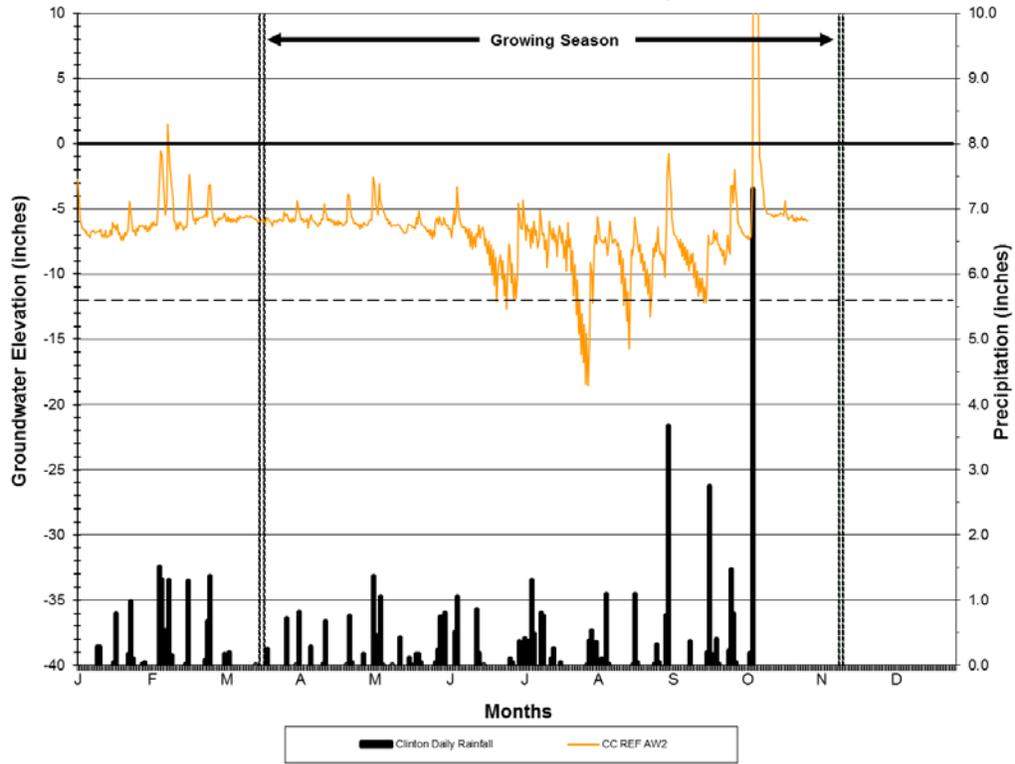

2016 Cedar Creek Groundwater Gauge REFAW3

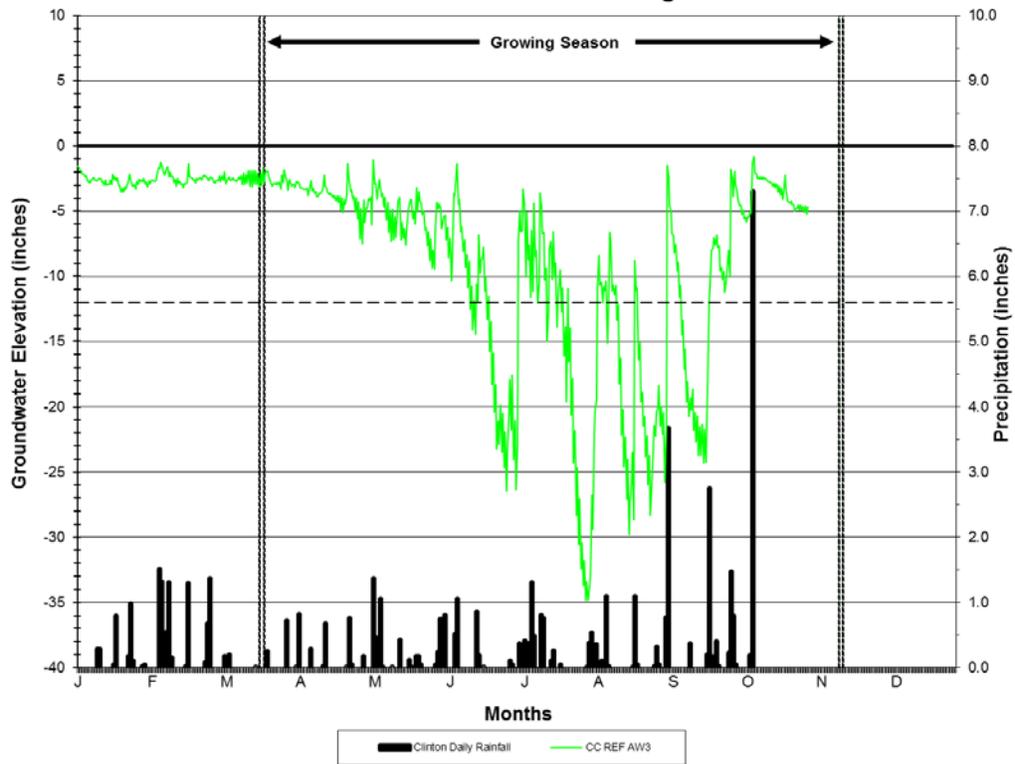

Appendix E – Crest Gauge Verification Photos



Crest Gauge 1 Reading 1.15' (10/8/2016)



Crest Gauge 3 Reading 0.40' (10/8/2016)